


School:	Willyama High School (8491)
Region:	North Western NSW AMU
State Electorate:	Barwon
Local Government Area:	Broken Hill

Last Reviewed By:	ENVIROSCIENCE SOLUTIONS 01-MAR-2024
Last Revised By:	ENVIROSCIENCE SOLUTIONS 28-JUN-2024

Historical Fibro In Grounds Investigations/Events	No
No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.	

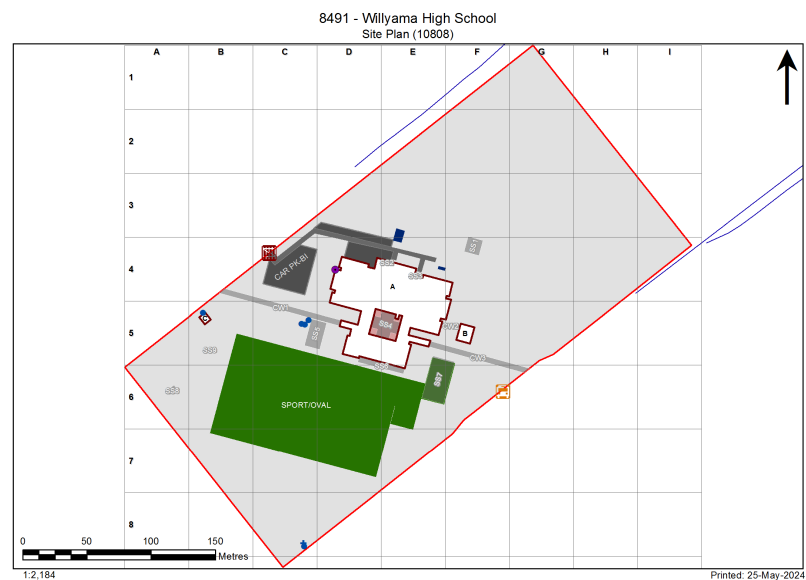

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
 2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
 3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
 4. Successive inspections have reduced any inconclusive records such as "assumed asbestos" in difficult to access areas, by undertaking additional sampling with lifting devices.
 5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
 6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - Any wall cavity
 - Sub floor area, particularly formwork for slabs in/on ground,
 - Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
 7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
- Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were "composite tested" in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Various - 1974 - Brick/Block							
Exterior							
Window	Mastic/Putty/Sealant (Bonded)	Unknown	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Window		Unknown	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
External Roof Structure - Box Gutter	Bituminous Membrane	unknown	Gutter wall lining	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plumbing / Pipework	Mastic	x 1 Chimney	1 main chimney	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Fibre Cement Pipe	2 x pipes throughout subfloor	Refer to building plans	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (Brown asbestos)
Plumbing / Pipework	Gasket Material	6 x chimney flues	Flue	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00A - R0E01 - Welding Area - 9.65 m2							
No Asbestos							
B00A - R0E02 - Materials Store - 14 m2							
No Asbestos							
B00A - R0E03 - Plant - 132.34 m2							
No Asbestos							
B00A - R0E04 - Materials Technology L.S. - 179.9 m2							
No Asbestos							
B00A - R0E05 - Movement - 7.64 m2							
No Asbestos							
B00A - R0E06 - Design L.S. - 51.19 m2							
No Asbestos							
B00A - R0E07 - Design L.S. - 51.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0E09 - Materials Technology L.S. - 205.56 m2							
No Asbestos							
B00A - R0E10 - Dust Extraction Space - 6.38 m2							
No Asbestos							
B00A - R0E11 - Movement - 7.64 m2							
No Asbestos							
B00A - R0E12 - Materials Store - 35.51 m2							
No Asbestos							
B00A - R0E13 - Staff Study - 13.55 m2							
No Asbestos							
B00A - R0E14 - Staff Study - 26.02 m2							
No Asbestos							
B00A - R0E15 - General Storeroom - 24.17 m2							
No Asbestos							
B00A - R0E16 - Distribution Board Cupboard - .69 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R0E17 - Lift - .8 m2							
No Asbestos							
B00A - R0E18 - General Storeroom - 10.85 m2							
No Asbestos							

B00A - R0E19 - Distribution Board Cupboard - 2.55 m2				Note: No inspection of live electrical installation			
No Asbestos							
B00A - R0E20 - Toilets-Boys - 11.37 m2							
Partition Walls (Cubides)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0E21 - Toilets-Girls - 11.6 m2							
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	South	Friable Asbestos Not Vermiculite (5)	Low (1)	High Priority (6-8)	Assumed Asbestos
B00A - R0E22 - Staff - Toilet - 3.35 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0E23 - General Storeroom - 3.35 m2							
No Asbestos							
B00A - R0E24 - Movement - 131.58 m2							
No Asbestos							
B00A - R0E25 - General Learning Space - 58.58 m2							
Floor Coverings Res/Textile	Vinyl Sheet	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0E26 - General Learning Space - 58.65 m2							
Floor Coverings Res/Textile	Vinyl Sheet	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0E27 - Materials Store - 7.57 m2							
No Asbestos							
B00A - R0E28 - General Storeroom - 7.61 m2							
No Asbestos							
B00A - R0E29 - General Storeroom - 7.58 m2							
No Asbestos							
B00A - R0E30 - General Storeroom - 7.63 m2							
No Asbestos							
B00A - R0N01 - Plant - 17.28 m2							
No Asbestos							
B00A - R0N02 - Plant - 137.58 m2							
Plant / Equipment - Boiler	Encapsulated Asbestos material within unit	1 X Boiler Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0N03 - Plant - 11.88 m2							
No Asbestos							
B00A - R0N04 - Movement - 2.22 m2							
No Asbestos							
B00A - R0N05 - Plant - 7.02 m2							
No Asbestos							
B00A - R0N06 - General Storeroom - 7.13 m2							
No Asbestos							
B00A - R0N07 - Cleaning Store - Distributed - 6.8 m2							
No Asbestos							
B00A - R0N08 - Staff Study - 30.25 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0N09 - Movement - 13.83 m2							
No Asbestos							
B00A - R0N10 - Staff Study - 30.2 m2							
No Asbestos							
B00A - R0N11 - Practice/Seminar - 65.42 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0N12 - Music Learning Space - 65.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0N13 - General Storeroom - 4.69 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0N14 - Music Store - 4.94 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0N15 - General Storeroom - 7.66 m2							
No Asbestos							
B00A - R0N16 - Student Canteen - 45.89 m2							
No Asbestos							
B00A - R0N17 - Movement - 2.32 m2							
No Asbestos							
B00A - R0N19 - Movement - 245.5 m2							
No Asbestos							
B00A - R0N20 - Cleaning Supplies Store - 6.81 m2							
No Asbestos							
B00A - R0N21 - Cleaning Supplies Store - 6.94 m2							
No Asbestos							
B00A - R0N22 - Plant - 7.25 m2							
No Asbestos							
B00A - R0N23 - Lift - 2.23 m2							
No Asbestos							
B00A - R0N24 - External Movement - 58.82 m2							
No Asbestos							
B00A - R0S01 - Movement - 21.91 m2							
No Asbestos							
B00A - R0S02 - Movement - 88.16 m2							
No Asbestos							
B00A - R0S03 - General Storeroom - 50.2 m2							
No Asbestos							
B00A - R0S04 - Chair Store - 20.88 m2							
No Asbestos							
B00A - R0S05 - Sport Equipment Store - 25.69 m2							
No Asbestos							
B00A - R0S06 - Distribution Board Cupboard - .41 m2					Note: No inspection of live electrical installation		
No Asbestos							
B00A - R0S07 - Movement - 25.6 m2							
No Asbestos							
B00A - R0S08 - Multi-Purpose Space - 455.56 m2							
Ceiling Structures/Linings	Flat AC Sheeting	180m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos), Amosite (Brown asbestos)
B00A - R0S09 - Movement - 88.6 m2							
No Asbestos							
B00A - R0S10 - Shower/Change - 36.66 m2							
No Asbestos							
B00A - R0S11 - Shower/Change - 25.87 m2							
No Asbestos							

B00A - R0S12 - Shower/Change - 24.02 m2							
No Asbestos							
B00A - R0S13 - Cleaning Store - Distributed - 4 m2							
No Asbestos							
B00A - R0S14 - Movement - 13.48 m2							
No Asbestos							
B00A - R0S15 - Toilets-Boys - 20.89 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0S16 - Garden Store Room - 30.79 m2							
No Asbestos							
B00A - R0S17 - Plant - 4.95 m2							
Plant / Equipment - Flue	Fibre Cement Pipe	3	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0S18 - General Storeroom - 3.94 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0S19 - Movement - 8.8 m2							
No Asbestos							
B00A - R0S20 - Movement - 76.23 m2							
No Asbestos							
B00A - R0S21 - Distribution Board Cupboard - 4.01 m2					Note: No inspection of live electrical installation		
No Asbestos							
B00A - R0S22 - Practice/Seminar - 97.89 m2							
No Asbestos							
B00A - R0S23 - General Storeroom - 9.29 m2							
No Asbestos							
B00A - R0S24 - Shower/Change - 32.2 m2							
No Asbestos							
B00A - R0S25 - Shower/Change - 38.74 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00A - R0S26 - Shower/Change - 32.89 m2							
No Asbestos							
B00A - R0S27 - Toilets-Girls - 19.43 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	0.20	Throughout	Friable Asbestos Not Vermiculite (5)	Low (1)	High Priority (6-8)	Assumed Asbestos
B00A - R0S28 - General Storeroom - 4.4 m2							
No Asbestos							
B00A - R0S29 - Movement - 8 m2							
No Asbestos							
B00A - R0S30 - Sport Equipment Store - 18.44 m2							
No Asbestos							
B00A - R0W01 - Main Switchroom - 11.79 m2							
No Asbestos							
B00A - R0W02 - Movement - 16.12 m2							
No Asbestos							
B00A - R0W03 - Staff - Toilet - 5.67 m2							
No Asbestos							
B00A - R0W04 - Staff - Toilet - 3.35 m2							

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0W05 - Toilets-Boys - 15.14 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0W06 - Toilets-Girls - 15.85 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0W07 - Cleaning Store - Distributed - 2.58 m2							
No Asbestos							
B00A - R0W08 - Darkroom Space - 13.61 m2							
No Asbestos							
B00A - R0W09 - Duplicating Workroom - 22.57 m2							
No Asbestos							
B00A - R0W10 - Movement - 7.64 m2							
No Asbestos							
B00A - R0W11 - Kiln Space - 18.1 m2							
No Asbestos							
B00A - R0W12 - Art Learning Space - 54.86 m2							
No Asbestos							
B00A - R0W13 - General Storeroom - 17.53 m2							
No Asbestos							
B00A - R0W14 - Art Learning Space - 72.4 m2							
No Asbestos							
B00A - R0W15 - Plant - 129.76 m2							
No Asbestos							
B00A - R0W16 - Workshop Area - 53.31 m2							
No Asbestos							
B00A - R0W17 - Plant - 39.49 m2							
No Asbestos							
B00A - R0W18 - Art Learning Space - 52.97 m2							
No Asbestos							
B00A - R0W19 - Resources Store - 10.93 m2							
No Asbestos							
B00A - R0W20 - Distribution Board Cupboard - 2.55 m2					Note: No inspection of live electrical installation		
Ceiling Structures/Linings	Flat AC Sheeting	2.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0W21 - General Storeroom - 10.79 m2							
No Asbestos							
B00A - R0W22 - Duplicating Workroom - 5.65 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0W23 - Materials Technology L.S. - 65.24 m2							
No Asbestos							
B00A - R0W26 - Special Learning Space - 64.54 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0W27 - General Storeroom - 5.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0W28 - General Storeroom - 5.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0W29 - Staff Study - 12.57 m2							

No Asbestos							
B00A - R0W32 - Movement - 174.14 m2							
No Asbestos							
B00A - R0W33 - Laundry - 1.5 m2							
No Asbestos							
B00A - R0W34 - Food Technology L.S. - 94.31 m2							
No Asbestos							
B00A - R0W35 - Materials Store - 15.21 m2							
No Asbestos							
B00A - R0W36 - Pantry - 10.5 m2							
No Asbestos							
B00A - R0W37 - Food/Research Space - 21.86 m2							
No Asbestos							
B00A - R0W38 - Plant - .55 m2							
No Asbestos							
B00A - R0W39 - Food Technology L.S. - 88.54 m2							
No Asbestos							
B00A - R0W40 - Movement - 17.4 m2							
No Asbestos							
B00A - R0W41 - Pantry - 10.39 m2							
No Asbestos							
B00A - R1E01 - Laboratory L.S. - 89.03 m2							
No Asbestos							
B00A - R1E02 - Preparation - 53.33 m2							
No Asbestos							
B00A - R1E03 - Laboratory L.S. - 88.85 m2							
No Asbestos							
B00A - R1E04 - Toilets-Girls - 11.52 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	South	Friable Asbestos Not Vermiculite (5)	Low (1)	High Priority (6-8)	Assumed Asbestos
B00A - R1E05 - Staff - Toilet - 3.39 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E06 - Staff - Toilet - 3.39 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E07 - Toilets-Boys - 11.43 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E08 - Distribution Board Cupboard - 2.55 m2							
						Note: No inspection of live electrical installation	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00A - R1E09 - Apparatus Store - 18.54 m2							
No Asbestos							
B00A - R1E10 - Staff Study - 29.35 m2							
Floor Coverings Res/Textile	Vinyl Tiles	30.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E11 - General Learning Space - 52.39 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E12 - Computer Learning Space - 84.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R1E13 - Plant - 3.77 m2							
Plumbing / Pipework	Fibre Cement Pipe	1	Through ceiling	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1E14 - General Learning Space - 52.54 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E15 - Staff Study - 29.63 m2							
No Asbestos							
B00A - R1E16 - General Storeroom - 12.26 m2							
No Asbestos							
B00A - R1E17 - General Storeroom - 6.15 m2							
No Asbestos							
B00A - R1E18 - Staff Study - 12.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E19 - Plant - 3.77 m2							
Plumbing / Pipework	Fibre Cement Pipe	1	Through ceiling	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E20 - Laboratory L.S. - 88.99 m2							
No Asbestos							
B00A - R1E21 - Preparation - 52.92 m2							
No Asbestos							
B00A - R1E22 - Laboratory L.S. - 88.59 m2							
No Asbestos							
B00A - R1E23 - Lift - .8 m2							
No Asbestos							
B00A - R1E26 - Movement - 309.18 m2							
No Asbestos							
B00A - R1E27 - Movement - 161.68 m2							
Ceiling Structures/Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1E28 - Movement - 90.24 m2							
No Asbestos							
B00A - R1N01 - Commonroom - 149.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	150.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1N02 - General Storeroom - 2.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1N03 - Workroom - 64.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1N04 - General Storeroom - 9.38 m2							
No Asbestos							
B00A - R1N05 - Main Area - 195.21 m2							
No Asbestos							
B00A - R1N06 - Entry - 32.67 m2							
No Asbestos							
B00A - R1N07 - General Storeroom - 22.83 m2							

Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1N08 - General Storeroom - 23.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1N09 - Librarian - 12.43 m2							
No Asbestos							
B00A - R1N10 - Movement - 156.02 m2							
No Asbestos							
B00A - R1N11 - Movement - 50.9 m2							
No Asbestos							
B00A - R1N12 - Cleaning Store - Distributed - 6.8 m2							
No Asbestos							
B00A - R1S01 - Deputy Principal Office - 18.39 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S02 - Movement - 8.16 m2							
No Asbestos							
B00A - R1S03 - Public Entry - 98.69 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	99.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S04 - Cleaning Store - Distributed - 3.98 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Plumbing / Pipework		1	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (Brown asbestos)
B00A - R1S05 - Movement - 43.24 m2							
No Asbestos							
B00A - R1S06 - Clinic - Boys - 12.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S07 - Duplicating Workroom - 22.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S08 - Administration - Clerical - 17.85 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S09 - Principal Office - 27.9 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	28.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S10 - General Storeroom - 1.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S11 - Staff - Toilet - 1.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S12 - Staff - Toilet - 3.33 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S13 - Staff - Toilet - 3.33 m2							
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	North	Friable Asbestos Not Vermiculite (5)	Low (1)	High Priority (6-8)	Assumed Asbestos
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	3.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S14 - Administration - Clerical - 11.84 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S15 - Administration - Clerical - 27.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	28m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1S16 - Control Room - 6.29 m2							
No Asbestos							
B00A - R1S18 - Movement - 66.12 m2							
No Asbestos							
B00A - R1S19 - Movement - 77.05 m2							
Window		Unknown	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Window		Unknown	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00A - R1S20 - Movement - 76.06 m2							
No Asbestos							
B00A - R1W01 - Staff Study - 12.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W02 - Shower/Change - 7.58 m2							
No Asbestos							
B00A - R1W03 - Shower/Change - 5.18 m2							
Partition Walls (Cubides)	Compressed AC Sheet	4m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00A - R1W04 - Self Help Toilet - 8.32 m2							
No Asbestos							
B00A - R1W05 - Staff - Toilet - 3.3 m2							
Partition Walls (Cubides)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W06 - Toilets-Boys - 14.92 m2							
Partition Walls (Cubides)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W07 - Toilets-Girls - 15.6 m2							
Partition Walls (Cubides)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W08 - Cleaning Store - Distributed - 2.6 m2							
No Asbestos							
B00A - R1W09 - Senior Seminar - 17.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W10 - General Storeroom - 9.38 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W11 - General Learning Space - 51.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W12 - General Learning Space - 51.76 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W13 - General Learning Space - 51.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W14 - Plant - 3.83 m2							

Plumbing / Pipework	Fibre Cement Pipe	1	Through ceiling	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W15 - Computer Learning Space - 85.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	86.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W16 - General Learning Space - 51.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W17 - General Learning Space - 53.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W18 - Plant - 3.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plumbing / Pipework		1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (Brown asbestos)
Ceiling Structures/Linings	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W19 - General Learning Space - 51.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W20 - General Learning Space - 51.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W21 - General Learning Space - 52.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W22 - General Learning Space - 51.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W23 - Staff Study - 29.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W24 - General Storeroom - 8.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W25 - Staff Study - 65.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W26 - Distribution Board Cupboard - 2.59 m2						Note: No inspection of live electrical installation	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1W28 - Movement - 458.82 m2							
No Asbestos							
B00A - R2E01 - Laboratory L.S. - 89.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E02 - Preparation - 53.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E03 - Laboratory L.S. - 88.68 m2							

Floor Coverings Res/Textile	Vinyl Tiles	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E04 - Toilets-Girls - 11.51 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	South	Friable Asbestos Not Vermiculite (5)	Low (1)	High Priority (6-8)	Assumed Asbestos
B00A - R2E05 - Toilets-Boys - 11.29 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E06 - Staff - Toilet - 3.51 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E07 - Staff - Toilet - 3.42 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E08 - Music Learning Space - 84.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E09 - General Learning Space - 52.39 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E10 - General Learning Space - 52.4 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E11 - Commonroom - 106.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	107.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E12 - Apparatus Store - 24.98 m2							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E13 - General Storeroom - 5.76 m2							
No Asbestos							
B00A - R2E14 - Chemical Store - 9.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E15 - General Storeroom - 9.42 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E16 - Distribution Board Cupboard - 2.55 m2						Note: No inspection of live electrical installation	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00A - R2E17 - Plant - 2.56 m2							
No Asbestos							
No Asbestos							
B00A - R2E18 - Laboratory L.S. - 88.88 m2							
No Asbestos							
B00A - R2E19 - Preparation - 53.14 m2							
No Asbestos							
B00A - R2E21 - Lift - .8 m2							
No Asbestos							
B00A - R2E22 - Movement - 271 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	260.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2E23 - Itinerant Teachers Unit - 35.46 m2							

Window Putty		Throughout	South	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8)	Chrysotile (white asbestos)
B00A - R2E24 - Student Kitchen - 22.24 m2							
No Asbestos							
B00A - R2E25 - Staff Study - 27.81 m2							
No Asbestos							
B00A - R2N01 - General Learning Space - 121.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	122.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N02 - Cleaning Store - Distributed - 2.33 m2							
No Asbestos							
B00A - R2N03 - General Storeroom - 13.17 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N04 - General Storeroom - 11.84 m2							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N05 - Main Area - 218.45 m2							
Ceiling Voids		Unknown	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	219.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Sunroof/Sky light Wall lining	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N06 - Cleaning Store - Distributed - 6.77 m2							
No Asbestos							
B00A - R2N07 - Workroom - 15.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N09 - Interview/Office - Type 1 - 14.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N10 - Interview/Office - Type 1 - 14.87 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N11 - Audio Visual Workroom - 29.76 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N12 - Workroom - 15.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N13 - Staff Study - 16.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N16 - Uniform Shop - 4.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N17 - Movement - 155.61 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	156.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N18 - Stairs - 11.74 m2							
No Asbestos							
B00A - R2N19 - Movement - 6.11 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2N20 - System Administrators Office - 23.14 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W01 - General Storeroom - 28.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	29.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W02 - Staff - Toilet - 5.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W03 - Staff - Toilet - 3.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W04 - Toilets-Boys - 14.62 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W05 - Toilets-Girls - 15.79 m2							
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	0.20	Throughout	Friable Asbestos Not Vermiculite (5)	Low (1)	High Priority (6-8)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W06 - Cleaning Store - Distributed - 2.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W07 - Staff Study - 28.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W08 - General Learning Space - 51.17 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W09 - General Learning Space - 51.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W10 - General Learning Space - 50.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W11 - Computer Learning Space - 84.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W12 - General Learning Space - 52.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W13 - General Learning Space - 52.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W14 - Duplicating Workroom - 21.48 m2							
No Asbestos							
B00A - R2W15 - Staff Study - 21.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W16 - General Learning Space - 52.7 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W17 - Interview/Office - Type 1 - 52.7 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W18 - General Learning Space - 51.17 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W19 - General Learning Space - 51.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W20 - General Learning Space - 51.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W21 - General Learning Space - 51.17 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2W22 - Plant - 2.54 m2							
No Asbestos							
B00A - R2W23 - Distribution Board Cupboard - 2.55 m2				Note: No inspection of live electrical installation			
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00A - R2W24 - Movement - 413.86 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	414.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	Throughoutm2	Throughout the aircon ducting	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - Other - 2012 - Brick/Veneer							
Exterior							
Ceiling Voids	Assumed Asbestos						
Underfloor Voids	Assumed Asbestos						
Interior							
B00B - R0001 - Workshop Area - 126.65 m2							
Assumed Asbestos - Room Not Accessed							
B00B - R0002 - Dust Extraction Space - 5.88 m2							
Assumed Asbestos - Room Not Accessed							
B00C - Agricultural Science - 2022 - Metal Shed							
Exterior							
No Asbestos							
Interior							
B00C - R0001 - Machine Storage - 23.83 m2							
Assumed Asbestos - Room Not Accessed							
B00C - R0002 - Agriculture Covered Area - 17.28 m2							
Assumed Asbestos - Room Not Accessed							

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 05-Jul-2024