ARBORICULTURAL IMPACT ASSESSMENT REPORT Richmond Agricultural Centre: SINSW Western Sydney University Address: Londonderry Rd and College Dr, Richmond Prepared for: Richard Crookes Constructions

DOC No: ARB-2419-001

JOB No: 2419 REV: E

DATE: 26.05.2025

PREPARED BY:

Guy Sturt

B L Arch (UNSW) AILA Registered Landscape Architect

Dip. Arboriculture AQF5 Consulting Arborist

STURT NOBLE ARBORICULTURE Suite 91, 330 Wattle Street, ULTIMO NSW 2007 Tel. (02) 9211 3744



CONTENTS

1.0	INTR	ODUC	TION	2
	1.1	Purpo	se of this Report	2
	1.2	Backg	ground	2
	1.3	The P	roposal	2
	1.4	Fores	eeable Construction Impacts	3
2.0	PLAN	INING	CONTROLS	5
	2.1	Counc	cil Consent	5
3.0	THE E	EXISTI	NG SITE	6
	3.1	The S	ite	6
	3.2	Soils		6
	3.3	The T	rees	7
4.0	ABOR	RICULT	TURE IMPACT ASSESSMENT	8
	4.1	Const	ruction Assumptions	8
	4.2	Trees	to be removed	8
	4.3	Trees	to be retained	8
	4.4	Works	s within Tree Protection Zones	8
	4.5	Prunir	ng works	9
	4.6	Ongoi	ng management of trees to be retained	9
5.0	MITIG	OITA	N MEASURES	10
	5.1	Tree F	Protection Measures	10
	5.2	Tree F	Protection Zones	10
	5.3	Tree F	Protection Fencing	11
	5.4	Trunk,	, Branch & Ground Protection	11
	5.5	Demo	lition Works within Tree Protection Zones	12
	5.6	Excav	rations within Tree Protection Zones	12
	5.7	Under	ground Services	12
	5.8	Gradir	ng and Level Changes	13
	5.9	Canop	by pruning	13
	5.10	Root I	nvestigation	13
	5.11	Root F	Pruning	14
	5.12	Tree D	Damage/ Decline	14
6.0	CON	CLUSIC	ON	15
7.0	DISCLAIMER		16	
8.0	REFE	RENC	ES	17
APPE	NDIX	1:	METHODOLOGY	18
APPE	NDIX	2:	PLANS	22
APPENDIX 3: TREE ASSESSMENT SCHEDULE			23	
APPE	NDIX	4:	TYPICAL TREE PROTECTION DETAILS	24

1.0 INTRODUCTION

1.1 Purpose of this Report

Sturt Noble Arboriculture was engaged by Richard Crookes Constructions to assess existing trees, prepare an Aboricultural Impact Assessment Report and Tree Protection Recommendations in relation to the proposed construction of Richmond Agricultural Centre in Richmond.

The purpose of this report is to:-

 Identify the number and location of existing trees on site which may be impacted by works.

For those trees in potential areas of encroachment:-

- Detail the size and percentage canopy density of each tree
- To assess and review the condition of existing trees by undertaking a Visual Tree Assessment
- Assess each individual tree's suitability to be retained as a sustainable part of the proposed development in the long term, considering the likely impacts of works proposed.
- Provide recommendations for tree removal, retention and protection
- Provide detailed justification for each tree to be removed or retained and protected
- Provide recommendations where appropriate to enable trees to be retained or have better long-term health outcomes and minimize potentials for hazard.
- To provide information on appropriate tree protection measures, appropriate setbacks, constraints and tree management procedures during site works.

This report has been carried out as per the Methodology outlined in Appendix 1

1.2 Background

The preparation of this report has been prepared in awareness and consideration of the following standards, controls and guidelines:

- Hawkesbury City Council DCP 2002
- Australian Standard AS4970-2009 Protection of Trees on Development Sites
- Australian Standard AS4373-2007 Pruning of Amenity Trees
- Australian Standard AS2303-2015 Tree Stock for Landscape Use

1.3 The Proposal

This impact assessment has been prepared based on the following plans:

 22430detail_BOUNDARY IDENTIFICATION AND DETAIL & LEVEL SURVEY OVER PART OF LOT 2 IN DP1051798 LONDONDERRY ROAD, RICHMOND, NSW, 2753, 18/09/2024 prepared by CMS Surveyors

Refer to plans in Appendix 2

This Arboriculture Impact Assessment has been prepared by *Sturt Noble Arboriculture* on behalf of the Department of Education (DoE) (the Proponent) to assess the potential environmental impacts that could arise from the activities associated with the Richmond Agricultural Centre development at 2 College Street Richmond (Part Lot 2 DP1051798) (the site).

The report has been prepared to assess existing trees, prepare an Aboricultural Impact Assessment Report and Tree Protection Recommendations.

- This report accompanies a Review of Environmental Factors (REF) that seeks approval for the construction and operation of a secondary school with a specialist agricultural curriculum at the site. The activities associated with establishing the Richmond Agricultural Centre involves the following works:
- The removal of trees and fencing
- Construction of a general learning hub
- Construction of a science hub
- Construction of a multipurpose hall
- Construction of an administration building
- Construction of canteen and amenities building
- Construction of a new parking area (including accessible spaces) driveway and kiss and drop facilities
- The provision of outdoor agricultural learning areas comprising:
 - Agricultural plots
 - o Aboriginal enterprise
 - o Agricultural shed and greenhouse
 - Animal plots with associated stock yard, animal shelters, troughs and stock lane
 - Gravel access road with wash bay
- Landscaping including new trees, entry forecourt, village green and kitchen garden
- Ancillary services and infrastructure upgrades including new substation and HV Works, sewer pump station, water booster, dual carriage vehicle access and pedestrian paths
- Wayfinding and school identification signage

For a detailed project description, please refer to the Review of Environmental Factors (REF) prepared by EPM Projects.

1.4 Foreseeable Construction Impacts

Foreseeable impacts noted from the proposed development, construction type and anticipated methodology include:

Excavations for new buildings

- Excavations for new carparking areas
- Excavations for new hardscape areas
- Ripping or cultivation of soil for landscaped areas.
- Soil level changes including the placement of fill material for the footings and to make up grades to landscape areas.
- Laying impermeable paving to paths, carparks and slabs.
- Movement and storage of plant, equipment & vehicles;
- Erection of site sheds;
- Storage of building materials, waste and waste receptacles.

2.0 PLANNING CONTROLS

2.1 Council Consent

Refer section 171 of EP&A Regs and 'Guidelines for Division 5.1 assessments Consideration of environmental factors for health services facilities and schools ADDENDUM OCTOBER 2024'

3.0 THE EXISTING SITE

3.1 The Site

The site is located at Londonderry Road and College Drive, Richmond on part Lot 2 D.P.1051798. The site is currently occupied by grazing land, with a Citrus Orchard to the north-west, Londonderry Road to the north-west, College Drive to the south-east, and grazing land to all other sides. The site is almost flat with a grassed swale to the south-eastern boundary. The arboricultural assessment does not extend beyond the REF boundary.

The site currently contains a mix of endemic and planted native trees and a small number of exotic trees.

Area of Investigation – 160,000m2



3.2 Soils

The site soil is made up of heavy clays and clayey sands with some large boulders throughout. This type of soil covers a wide area between the lower terraces of the Hawkesbury/Nepean River system and west of South Creek. The soil lies overs the Londonderry Clay formation and the landscape is generally flat terraces with some gently undulating low rises.

Most of the remnant natural vegetation that can be found on this soil type is located in the Castlereagh State Forest. There are some small areas of uncleared scrub located between small farms and quarries. This soil type has high erodibility and generally low fertility. It can be a flood hazard, become seasonally waterlogged or be a water erosion hazard.

3.3 The Trees

Nine-hundred and fifty-four (954) trees located within the area of investigation have been surveyed as part of this assessment. The trees consist of a mix of nine-hundred and fifty (950) Australian endemic tree species and four (4) exotic trees. Refer to **Appendix 2** for tree locations

Most trees are well clear of potential work/ development zones so have not been fully assessed. Impacted trees have been fully assessed.

Each of the trees assessed has been allocated a Sustainable Retention Index Value (SRIV) that is based on their health, vigour, structure and age class. The SRIV does not take into account the impact of the proposed development.

A complete and detailed tree assessment schedule was prepared for only those trees identified to likely be impacted and these are included in **Appendix 3**.

In addition trees assessed in the Ecological Constraints Assessment prepared by Narla Environmental located in the area of agricultural plots were viewed.

The majority of these trees are located immediately adjacent to Londonderry road and along College drive. Most of these are endemic tree specimens of *Casuarina glauca*. These range in size from juvenile to mature specimens and have high value to be retained as a grove along the fence line.

4.0 ABORICULTURE IMPACT ASSESSMENT

4.1 Construction Assumptions

It is assumed for this report that excavation for buildings will not extend greater than 500mm from the building envelopes and this limit can be considered to be the extent of disturbance to the root zones with the exception of service lines.

Service plans were reviewed and there are no encroachments on existing trees. Refer to plans in **Appendix 2**

4.2 Trees to be removed

The plans show that one tree (1) will need to be removed to accommodate the proposed development.

Table 1: Trees to be removed

Development footprint critical to the following trees	Other (poor condition, other studies, etc)	
243		

Tree 243 is a native Casuarina of high significance. It is required to be removed to allow for a bitumen driveway from College Drive to access the proposed facilities.

4.3 Trees to be retained

With implementation of the tree protection measures it should be possible to retain all other trees on the developed site. The plans show that nine-hundred and fifty-three (953) trees are proposed to be retained.

Table 2: Trees to be retained

Clear of all works	Minor Encroachment	Major Encroachment
1-242, 244-954		

4.4 Works within Tree Protection Zones

- Any disturbance to soils within TPZ's could destabilise the trees or impact on long term health. Should any changes to soil within the TPZ/ SRZ be proposed further discussion and assessment must be undertaken.
- It is noted little major demolition is required on this site.

The plan in **Appendix 2** indicates trees TPZ's and SRZ's and should be used to inform later design decisions and temporary tree protection fences.

4.5 Pruning works

In addition to Tree Protection Zones, the extent of the canopy (canopy dripline) should also be considered, particularly in relation to construction activities and along access points.

Significant pruning of trees to accommodate digging machinery is generally not acceptable. Trees may not be pruned by more than 10% without consent.

Branches should be temporarily pushed or tied where possible to minimise the amount of pruning works.

4.6 Ongoing management of trees to be retained

A number of the trees identified to be retained have structural defects and/or deadwood at the time of assessment. Ongoing monitoring and maintenance should be undertaken especially for trees located in areas of high use and activity.

5.0 MITIGATION MEASURES

5.1 Tree Protection Measures

It is recommended that a site-specific Tree Protection Plan (TPP) is prepared to guide the construction process to ensure all trees designated for retention remain as a sustainable part of the landscape in the long term.

The plan shall be prepared by a consulting arborist (AQF Level 5) and should at a minimum include a detailed plan of the locations of, and specifications for, tree protection measures.

The TPP shall include a monitoring schedule relating to critical points during the works (hold points) where the Project Arborist is required to visit the site and confirm that works are being undertaken as conditioned by Council/as required.

The following tree protection measures shall be implemented prior to the commencement of any site works and shall remain in place for the duration of the development.

5.2 Tree Protection Zones

The Tree Protection Zones recommended for all trees within the site are to be retained and shall be equivalent to the Tree Protection Zone as specified in this report. This is a radial distance measured from the centre of the trunk of the subject trees.

The following activities are prohibited within the specified Tree Protection Zones:-

- Excavations and trenching (with exception of the approved foundations and underground services);
- Ripping or cultivation of soil;
- Excavation within soil remediation areas
- Mechanical removal of vegetation:
- Soil disturbance or movement of natural rock;
- Soil level changes including the placement of fill material (excluding any suspended floor or slab);
- Movement and storage of plant, equipment & vehicles;
- Erection of site sheds;
- Affixing of signage or hoardings to trees;
- Storage of building materials, waste and waste receptacles;
- Disposal of waste materials and chemicals including paint, solvents, cement slurry, fuel, oil and other toxic liquids;
- Other physical damage to the trunk or root system; and
- Any other activity likely to cause damage to the tree.

Place a 50-75mm layer of coarse organic mulch over the entire surface of the TPZ. Where the TPZ is adjacent to construction activities first lay down geotextile fabric

beneath the mulch to facilitate easy removal of the mulch at completion and any accidental spillage of construction materials.

Install drip irrigation around the root zone if required by the Project Arborist.

5.3 Tree Protection Fencing

All trees within the site to be retained shall be protected prior to and during construction from all activities that may result in detrimental impact by erecting a suitable protective fence beneath the canopy to the full extent of the Tree Protection Zone (excluding the footprint of the proposed works and areas within adjoining properties).

As a minimum the fence should consist of temporary chain wire panels 1.8 metres in height, supported by steel stakes as required and fastened together and supported to prevent sideways movement. The fence shall be erected prior to the commencement of any work on-site and shall be maintained in good condition for the duration of construction. Where tree protection zones merge together a single fence encompassing the area is deemed to be adequate.

Appropriate signage shall be installed on the fencing to prevent unauthorised movement of plant and equipment or entry to the Tree Protection Zone.

Refer to **Appendix 4** for examples of protective fencing and signage.

Where remediation of contaminated soil cannot be carried out within TPZs it is noted permanent fencing will be installed to limit access to these areas.

5.4 Trunk, Branch & Ground Protection

Where provision of tree protection fencing is in impractical due to its proximity to the proposed building envelope, trunk protection shall be erected around the tree to avoid accidental damage. As a minimum, the trunk protection shall consist of two metre (2m) lengths of hardwood timbers (100 x 50mm) spaced at 100-150mm centres secured together with 2mm galvanised wire. These shall be strapped around the trunk (not fixed in any way) to avoid mechanical injury or damage. Trunk protection should be installed prior to any site works and maintained in good condition for the duration of the construction period.

Pavements should be avoided within the Tree Protection Zone of trees to be retained where possible. Proposed paved areas within the Tree Protection Zone of trees to be retained should be placed above grade to minimise excavations within the root zone and avoid root severance and damage.

Placement of fill material within the Tree Protection Zone of trees to be retained should be avoided where possible. Where placement of fill cannot be avoided, the material should be a coarse, gap-graded material such as 20 – 50mm crushed basalt (Blue Metal) or equivalent to provide some aeration to the root zone. Note that Roadbase or crushed sandstone or other material containing a high percentage of fines is unacceptable for this purpose. The fill material should be consolidated with a non-vibrating roller to minimise compaction of the underlying soil. A permeable geotextile may be used beneath the sub-base to prevent migration of the stone into the sub-grade. No fill material should be placed in direct contact with the trunk.

Refer to **Appendix 4** for examples of trunk, branch and ground protection.

5.5 Demolition Works within Tree Protection Zones

Where demolition of structures and pavements is required within the Tree Protection Zones of trees to be retained it is to be carried out to avoid disturbance to existing soils, damage to existing roots or potential root growth.

Machinery shall work within the footprint of existing pavements where possible to avoid compaction of the adjacent soil and Tree Protection Zones.

When removing hard surfaces it shall be stripped-off in thick layers using a small rubber tracked excavator or alternative approved method to avoid damage to underlying roots and minimise soil disturbance. The final layer of sub-base material shall be removed using hand tools where required to avoid compaction of the underlying soil profile and damage to woody roots.

If any concentrations of roots or roots with diameters equal to or greater than 50mm are encountered, they must be retained in an undamaged condition for assessment by the Project Arborist. If the Project Arborist deems surrounding underground elements such as footing and pipes are providing support, these elements shall be left in-situ.

5.6 Excavations within Tree Protection Zones

The excavator shall work within the footprint of existing pavements where possible to avoid compaction of the adjacent soil and Tree Protection Zones.

Further detail of foundation/footing systems is required prior to construction so any additional impacts can be assessed.

5.7 Underground Services

All proposed underground services should be located as far away as practicable from existing trees to be retained to avoid excavation within the Tree Protection Zone.

For underground services, where the incursion to the Root Zone is less than 10% of the total TPZ (i.e. beyond the Minimum Setback Distance), a chain trenching device may be used. A backhoe or skid steer loader (bobcat) is unacceptable due to the potential for excessive compaction and root damage. Where large woody roots (greater than 50mm in diameter) are encountered during excavation or trenching, these shall be retained intact wherever possible (eg. by sub-surface boring beneath roots or rerouting the service etc).

Excavations required for underground services within the Structural Root Zone of any tree to be retained should only be undertaken by sub-surface boring. The Invert Level of the pipe, plus the pipe diameter, must be lower than the estimated root zone depth as specified at a minimum depth of 600mm. This will depend on the soil conditions at the site. Where this is not practical and root pruning is the only alternative, proposed root pruning should be assessed by the Project Arborist to determine continued health and stability of the subject tree.

Service plans were reviewed and there are no encroachments on existing trees.

5.8 Grading and Level Changes

Further detail of level changes, particularly within the TPZ of any trees proposed for retention is required prior to construction so any additional impacts can be assessed.

5.9 Canopy pruning

Care shall be taken when operating backhoes, excavators and similar equipment near trees to avoid damage to tree canopies (foliage and branches). Under no circumstances shall branches be torn-off by construction equipment. Where there is potential conflict between tree canopy and construction activities, the advice of the Project Arborist must be sought.

All pruning works shall be directed by the Project Arborist and shall be carried out by an AQF Level 3 Arborist. All pruning works shall be in accordance with the Australian Standard (AS) 4373:2007 Pruning of amenity trees. This standard outlines appropriate pruning practices and procedures that reduce the risk of damage and injury to trees. Correct pruning practices respect the natural form and branching habit of a tree and work with the trees natural defence mechanisms against disease to avoid damage and injury to trees.

Pruning should always be limited to the minimum amount necessary to achieve the desired aim. Significant loss of foliage created by excessive pruning may weaken the tree, leading to premature decline or predisposition to branch failure or disease, creating potential hazards.

Council consent will be required prior to commencement of the work. Pruning must be performed in accordance with *Australian Standard (AS) 4373:2007 Pruning of amenity trees* (Standards Australia 2007).

5.10 Root Investigation

Exploratory excavation may be required where the proposed excavation created by the development works exceeds 10% of the Tree Protection Zone of any Prescribed Tree; or service trenches are required within the TPZ; to determine the impact of the development on the tree. The purpose of the investigation is to verify the quantity, size, type, depth and orientation of tree roots along the perimeter of the proposed encroachment in order to make an informed judgement in relation to the potential impact on the tree.

Exploratory excavation shall only be carried out using non-destructive or non-injurious techniques, such as careful digging using handheld implements, using compressed air (Airspade®), water pressure, or suction (vacuum device) or a combination of these techniques, to carefully remove soil without damaging roots. The work shall be undertaken by an arborist with a minimum qualification of AQF Level 3. Once roots are exposed, a visual examination can be carried out with the Project Arborist to evaluate the potential impact of the proposed root loss on the health and stability of the tree.

The results of the root investigation together with the Development Impact Assessment must be documented in the report and submitted together with the DA. The report shall contain information that demonstrates that the trees will remain viable in conjunction with the works.

5.11 Root Pruning

Where root pruning is required, roots shall be severed with sterile, clean, sharp pruning implements resulting in a clean cut. Any excavated root zones shall be retained in a moist condition during the construction phase using Hessian material or mulch where practical. Trees that have roots removed shall have drip irrigation installed around the root zone to ensure they receive an adequate supply of water.

5.12 Tree Damage/ Decline

If trees show signs of stress or deterioration, remedial action shall be taken to improve the health and vigour of the subject tree(s) in accordance with best practice arboricultural principles. Advice must be sought from the Project Arborist.

In the event of any tree becoming damaged for any reason during the construction period the Project Arborist must be engaged to inspect and provide advice on any remedial action to minimise any adverse impact. Such remedial action shall be implemented as soon as practicable and certified by the arborist.

6.0 CONCLUSION

Nine-hundred and fifty-four (954) trees have been considered on the site as part of this assessment and their locations are shown in **Appendix 1**. The trees consist of a mix of ten (10) Australian endemic trees and two (2) exotic trees. Refer to **Appendix 2** for tree locations

The proposed development is a Richmond Agricultural Centre Secondary School, known as the Hawkesbury and is located within the WSU Richmond Campus.

The plans show that one tree (1) will need to be removed to accommodate the proposed development.

Table 1: Trees to be removed

Development footprint critical to the following trees	Other (poor condition, other studies, etc)	Dead / Weed species to be removed (exempt and can be removed without consent)
243		

Tree 243 is a native Casuarina of high significance. It is required to be removed to allow for a bitumen driveway from College Drive to access the proposed facilities.

Table 2: Trees to be retained

Clear of all works	Minor Encroachment	Major Encroachment
1-242, 244-954		

The majority of these trees are located immediately adjacent to Londonderry road and along College drive. Most of these are endemic tree specimens of *Casuarina glauca*. These range in size from juvenile to mature specimens and have high value to be retained as a grove.

With implementation of the tree protection/mitigation measures set out in Section 5 of this report, it should be possible to retain all other trees on the developed site. The plans show that nine-hundred and fifty-three (953) trees are proposed to be retained.

Trees on site that are to be retained as part of the approved development must be protected from potential damage caused by construction activities. Refer to section 5.0 for tree protection recommendations/mitigation measures.

Service plans were reviewed and there are no encroachments on existing trees.

Where recommended work processes and tree protection measures cannot be adhered to further advice should be sought from the Project Arborist.

7.0 DISCLAIMER

The author and Sturt Noble Arboricultural Consulting take no responsibility for actions taken and their consequences, contrary to those expert and professional instructions given as recommendations.

This is not a hazard assessment report and it should be noted that trees are always inherently dangerous. This assessment was carried out from the ground, and covers what was reasonably able to be assessed and available to the assessor at the time of inspection. No aerial or subterranean inspections were carried out and structural weakness may exist within roots, trunk or branches.

Any protection or preservation methods recommended are not a guarantee of tree survival or safety but are designed to improve vigour and reduce risk. Timely inspections and reports are necessary to monitor the trees' condition. No responsibility is accepted for damage or injury caused by the trees and no responsibility is accepted if the recommendations in this report are not followed.

Limitations on the use of this report: Trees are dynamic living structures, growing and adapting to conditions around them. Tree condition will change and vary over time depending on weather, environmental factors and mechanical or human interaction.

This report is to be utilised in its entirety only. Any written or verbal submission, report or presentation that includes statements taken from the findings, discussions, conclusions or recommendations made in this report, may only be used where the whole of the original report (or a copy) is referenced in, and directly attached to that submission, report or presentation.

Assumptions: Care has been taken to obtain information from reliable resources. All data have been verified insofar as possible; however, Sturt Noble Arboricultural Consulting can neither guarantee nor be responsible for the accuracy of information provided by others.

Unless stated otherwise: Information contained in this report covers only the trees that were examined and reflects the condition of the trees at the time of inspection.

Assessment is limited to the conditions at the time of the inspection and only trees discussed in the report have been assessed.

Where access to the base of the tree is limited, such as difficult site access due to site conditions, only general comments can be made. Assessment of tree health and structure is limited to that visible from the site of proposed works and may not reflect the true condition of the tree. Assessment of tree health and structure is limited to that visible from the site of proposed works and may not reflect the true condition of the tree.

Plans used to assess likely impact are those appended/ referenced.

Ongoing monitoring of all trees is advised and where significant changes are observed, further advice should be requested. Unusual developments or sudden changes in a tree's condition should be addressed immediately.

8.0 REFERENCES

Chapman, G. A & Murphy, C. L, 1989 Soil landscapes of the Sydney 1:100,000 sheet (9130) Pub. NSW Govt.

Draper, D.B and Richards, P.A (2009) Dictionary for managing Trees in Urban Environments, (IACA) Institute of Australian Consulting Arboriculturists ©. Pub. CSIRO Publishing, Melbourne.

IACA, 2010, Sustainable Retention Index Value Matrix (SRIV) Version 4, A visual method of objectively rating the viability of urban trees for development sites and management, based on general tree and landscape assessment criteria, Institute of Australian Consulting Arborculturists, Australia, www.iaca.org.au.

Googlemaps ©. Viewed 30th September 2024

Standards Australia (2007) Australian Standard AS4373-2007 *Pruning of Amenity Trees*, Pub. Standards Australia, Sydney.

Standards Australia (2009) Australian Standard AS4970-2009 *Protection of Trees on Development Sites*, Pub. Standards Australia, Sydney.

Urban Arbor 10/10/2017 Arboricultural Impact Assessment Report

APPENDIX 1: METHODOLOGY

A1.1 Site Inspection

This report, its comments and recommendations have been prepared based on the information gathered during a detailed site inspection carried out on the on the 10th March 2021. This assessment is summarised in **Appendix 1**.

A1.2 Tree Locations

The location of the subject trees are based on the site survey, 79528_REV-A, 11/02/2021. Additional trees found on site that are not represented on the survey, have been shown in approximate locations only.

A1.3 Visual Tree Assessment

The trees were assessed from the ground by the Visual Tree Assessment (VTA) method as described in Mattheck & Breloer (1994), using non-invasive tools such as binoculars and acoustic mallet. No digging or exposing of the root zones occurred in this inspection and no aerial inspection by climbing was performed. No aerial inspection or diagnostic testing was undertaken as part of this assessment.

The following data was collected for each tree:

- Botanical and common name.
- Tree dimensions (approximate only).
- Canopy density (approximate only).
- Overall health and vitality, including epicormic growth, deadwood and predation by pests and diseases.
- Structural condition including evident faults such as Bark Inclusions or poor branch attachments, decay, cavities and mechanical or biological damage.
- Stability of the tree including excessive trunk lean, stability of the soil, soil cracking, soil heaving, exposed roots and root damage.

A1.4 Retention Value

Each tree has been given a Sustainable Retention Index Value (SRIV) according to the rating system set out in the Sustainable Retention Index Value Matrix (refer to the table in section A1.8). The SRIV for each tree is based on its health, vigour, structure and age class as established in the Visual Tree Assessment. The SRIV does not take into account the impact of the proposed development.

A1.5 Landscape Significance Assessment

Landscape Significance is an essential criterion to establish the importance that a particular tree may have on a site. Each tree has been given a Tree Significance in landscape rating based on the 'IACA Significance of a Tree, Assessment Rating

System'. A tree is to have a minimum of three criteria in a category to be applicable for that rating.

Tree Significance in the landscape ratings:

High	Medium	Low
 The tree is in good condition and good vigour; The tree has a form typical for the species; The tree is a remnant or is a planted locally indigenous specimen and/or is rare or uncommon in the local area or of botanical interest or of substantial age; The tree is listed as a Heritage Item, Threatened Species or part of an Endangered ecological community or listed on Councils significant Tree Register; The tree is visually prominent and visible from a considerable distance when viewed from most directions within the landscape due to its size and scale and makes a positive contribution to the local amenity; The tree supports social and cultural sentiments or spiritual associations, reflected by the broader population or community group or has commemorative values; The tree's growth is unrestricted by above and below ground influences, supporting its ability to reach dimensions typical for the taxa in situ - tree is appropriate to the site conditions. 	 The tree is in fair-good condition and good or low vigour; The tree has form typical or atypical of the species; The tree is a planted locally indigenous or a common species with its taxa commonly planted in the local area The tree is visible from surrounding properties, although not visually prominent as partially obstructed by other vegetation or buildings when viewed from the street, The tree provides a fair contribution to the visual character and amenity of the local area, The tree's growth is moderately restricted by above or below ground influences, reducing its ability to reach dimensions typical for the taxa in situ. 	 The tree is in fair-poor condition and good or low vigour; The tree has form atypical of the species; The tree is not visible or is partly visible from surrounding properties as obstructed by other vegetation or buildings, The tree provides a minor contribution or has a negative impact on the visual character and amenity of the local area, The tree is a young specimen which may or may not have reached dimension to be protected by local Tree Preservation orders or similar protection mechanisms and can easily be replaced with a suitable specimen, The tree's growth is severely restricted by above or below ground influences, unlikely to reach dimensions typical for the taxa in situ - tree is inappropriate to the site conditions, The tree is listed as exempt under the provisions of the local Council Tree Preservation Order or similar protection mechanisms, The tree has a wound or defect that has potential to become structurally unsound. Environmental Pest / Noxious Weed Species The tree is an Environmental Pest Species due to its invasiveness or poisonous/ allergenic properties, The tree is a declared noxious weed by legislation. Hazardous/Irreversible Decline The tree is structurally unsound and/or unstable and is considered potentially dangerous, - The tree is dead, or is in irreversible decline, or has the potential to fail or collapse in full or part in the immediate to short term.

A1.6 Tree Protection Zones (TPZ) and Structural Root Zones (SRZ)

The intention of the TPZ is to ensure protection of the root system and canopy from the potential damage from construction works and ensure the long-term health and stability of each tree to be retained.

The Structural Root Zone (SRZ) is located within the TPZ around the base of a tree and provides the bulk of mechanical support and anchorage for a tree.

The Tree Protection Zones (TPZ) and Structural Root Zones (SRZ) have been arrived at using methods as detailed in Australian Standard AS 4970– 2009. Specific site factors are also considered that may influence the location of the TPZ and/or structural tree roots.

A1.7 Encroachment and Development Impacts

Encroachments and development impacts to tree TPZ's and SRZ's include;

- Excavation
- Filling
- Changes to existing soil levels
- Placing items and elements within the zones even if only temporarily
- Soil disturbance
- Any other physical damage to the trunk or root system or any other activity likely to cause damage to the tree.

Under AS 4970:2009 Protection of trees on development sites, a major encroachment is greater than 10% of the area of the TPZ and the Project Arborist must determine and demonstrate that the tree would remain viable. More detailed investigations, such as exploratory excavations and root investigation to enable an informed evaluation of the potential impact of the proposed works may be required.

Encroachments into the SRZ are not likely to be supported unless the Project Arborist has undertaken exploratory investigation and can demonstrate that there will be minimal impact to the tree.

A1.8 SRIV Table

	Vigour Class and Condition Class					INSTITUTE OF AUSTRALIAN CONSULTING AMORICULULISTS
Age Class	Good Vigour & Good Condition (GVG) Able to be retained if sufficient space available above and below ground for future growth.	Good Vigour & Fair Condition (GVF) Able to be retained if sufficient space available above and below ground for future growth.	Good Vigour & Poor Condition (GVP) Able to be retained if sufficient space available above and below ground for future growth.	Low Vigour & Good Condition (LVG) May be able to be retained if sufficient space available above and below ground	Low Vigour & Fair Condition (LVF) May be able to be retained if sufficient space available above and below ground	Low Vigour & Poor Condition (LVP) Unlikely to be able to be retained if sufficient space available above and below ground for
	No remedial work or improvement to growing environment required. May be subject to high vigour. Retention potential - Medium - Long Term.	Remedial work may be required or improvement to growing environment may assist. Retention potential - Medium Term. Potential for longer with remediation or favourable environmental conditions	Remedial work unlikely to assist condition, improvement to growing environment may assist. Retention potential - Short Term. Potential for longer with remediation or favourable environmental conditions.	for future growth. No remedial work required, but improvement to growing environment may assist vigour. Retention potential - Short Term. Potential for longer with remediation or favourable environmental conditions.	for future growth. Remedial work or improvement to growing environment may assist condition and vigour. Retention potential - Short Term. Potential for longer with remediation or favourable environmental conditions.	future growth. Remedial work or improvement to growing environment unlikely to assist condition or vigour. Retention potential - Likely to be removed immediately or retained for Short Term. Potential for longer with remediation or favourable environmental conditions
3	YGVG - 9	YGVF - 8	YGVP - 5	YLVG - 4	YLVF - 3	YLVP - 1
(Y) gnuo Y	Index Value 9 Retention potential - Long Term. Likely to provide minimal contribution to local amenity if height Retain, move or replace	Index Value 8 Retention potential - Short - Medium Term. Potential for longer with improved growing conditions. Likely to provide minimal contribution to local amenity if height Medium-high potential for future growth and adaptability. Retain, move or replace.	Index Value 5 Retention potential - Short Term. Potential for longer with improved growing conditions. Likely to provide minimal contribution to local amenity if height Low-medium potential for future growth and adaptability. Retain, move or replace	Index Value 4 Retention potential - Short Term. Potential for longer with improved growing conditions. Likely to provide minimal contribution to local amenity if height Medium potential for future growth and adaptability. Retain, move or replace	Index Value 3 Retention potential - Short Term. Potential for longer with improved growing conditions. Likely to provide minimal contribution to local amenity if height <5m. Low-medium potential for future growth and adaptability. Retain, move or replace	Index Value 1 Retention potential - Likely to be removed immediately or retained for Short Term. Likely to provide minimal contribution to local amenity if height
Ξ	MGVG - 10	MGVF - 9	MGVP - 6	MLVG - 5	MLVF - 4	MLVP - 2
Mature (M)	Index Value 10 Retention potential - Medium - Long Term	Index Value 9 Retention potential - Medium Term. Potential for longer with improved growing conditions.	Index Value 6 Retention potential - Short Term. Potential for longer with improved growing conditions	Index Value 5 Retention potential - Short Term. Potential for longer with improved growing conditions	Index Value 4 Retention potential - Short Term. Potential for longer with improved growing conditions	Index Value 2 Retention potential - Likely to be removed immediately or retained for Short Term.
6	OGVG - 6	OGVF - 5	OGVP - 4	OLVG - 3	OLVF - 2	OLVP - 0
Over-mature (O)	Index Value 6 Retention potential - Medium - Long Term.	Index Value 5 Retention potential - Medium Term.	Index Value 4 Retention potential - Short Term.	Index Value 3 Retention potential - Short Term. Potential for longer with improved growing conditions.	Index Value 2 Retention potential - Short Term.	Index Value 0 Retention potential - Likely to be removed immediately or retained for Short Term

APPENDIX 2: PLANS



B ISSUE FOR REVIEW
A ISSUE FOR REVIEW
ISSUE DESCRIPTION

16.04.2025 25.11.2024 DATE



environmental & urban design

Suite 307, 166 Glebe Point Rd

W. www.sturtnoble.com.au landscape architecture

Glebe NSW 2037

T. 02 9211 3744

PROJECT

RICHMOND AGRICULTURE CENTRE


CLIENT


RICHARD CROOKES CONSTRUCTIONS


ARBORIST CONTEXT PLAN

DRAWING NUMBER	ISSUE		
ARB-2419-001	В		
SCALE	DRAWN	CHECKED	DIRECTOR
1:1000 @ A1 1:2000 @ A3	jv	gs	gs
	0 10	20	50
ACN: 164 245 514	ABN:	99 164 2	245 514

THIS DRAWING SHOULD BE READ IN CONJUNCTION WITH ALL RELEVANT CONTRACTS, SPECIFICATIONS, REPORTS AND DRAWINGS. COPYRIGHT OF THIS DRAWING IS VESTED IN STURT NOBLE ASSOCIATES PTY LTD.

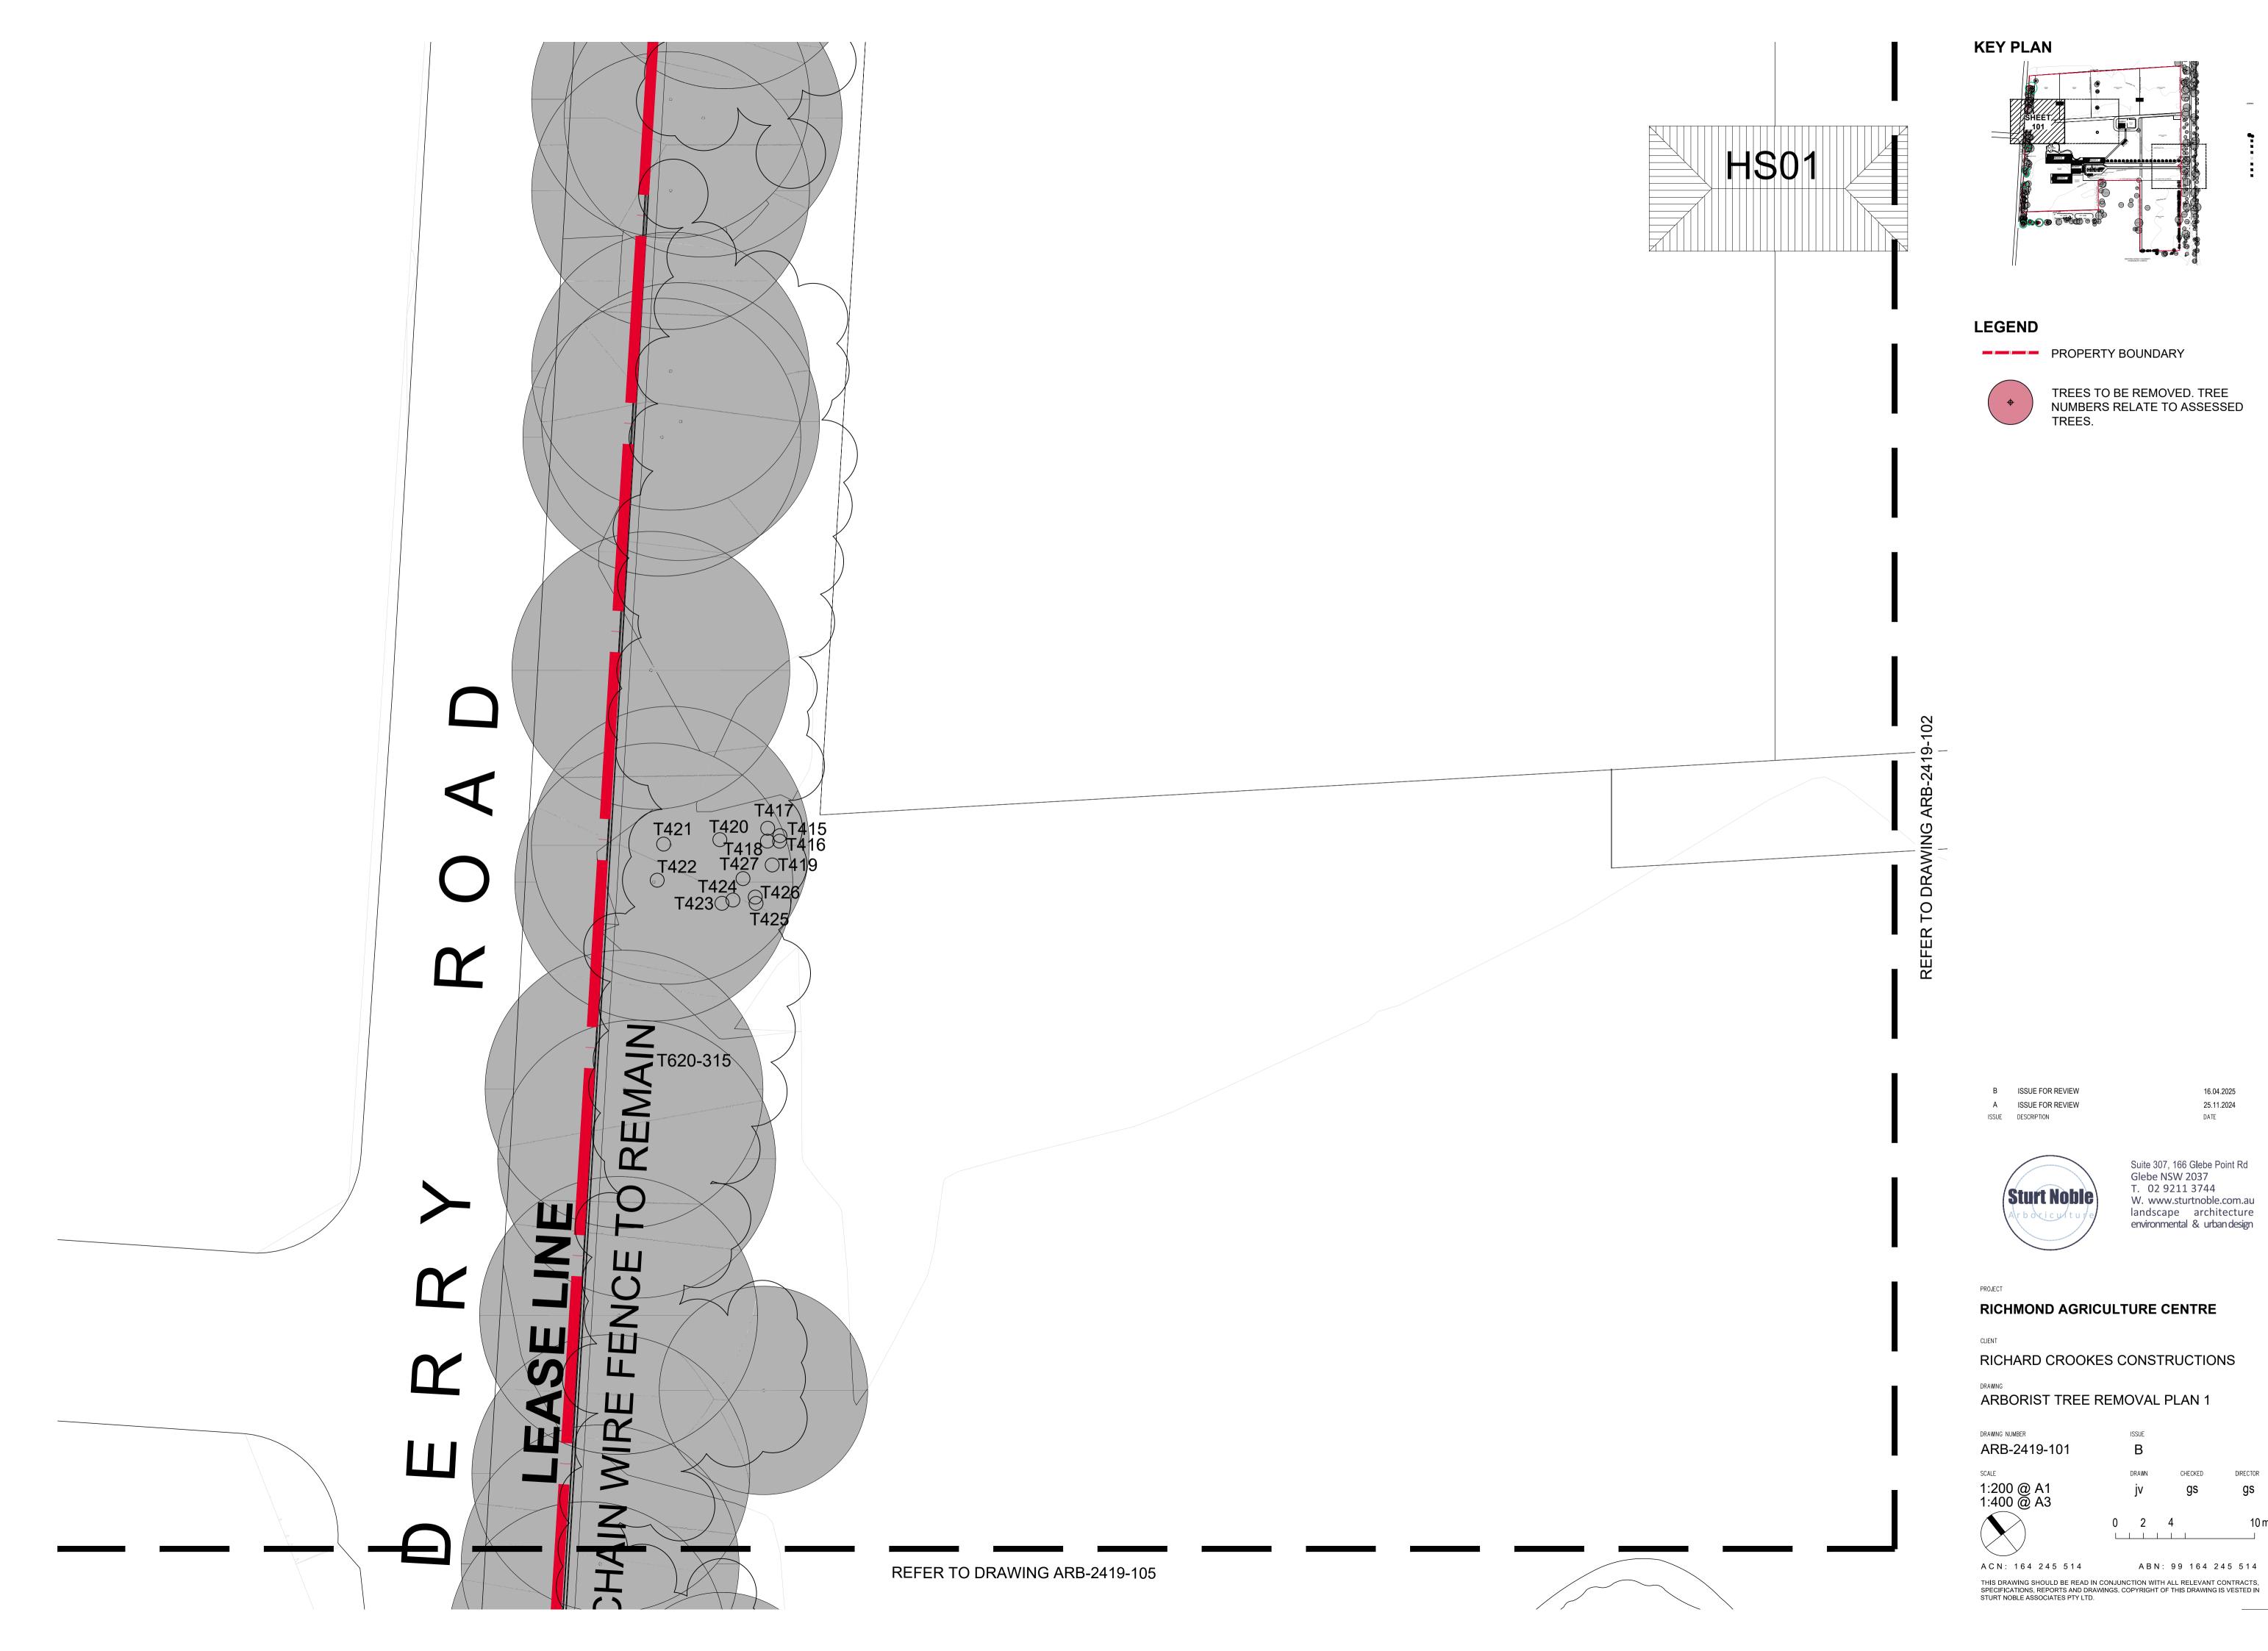

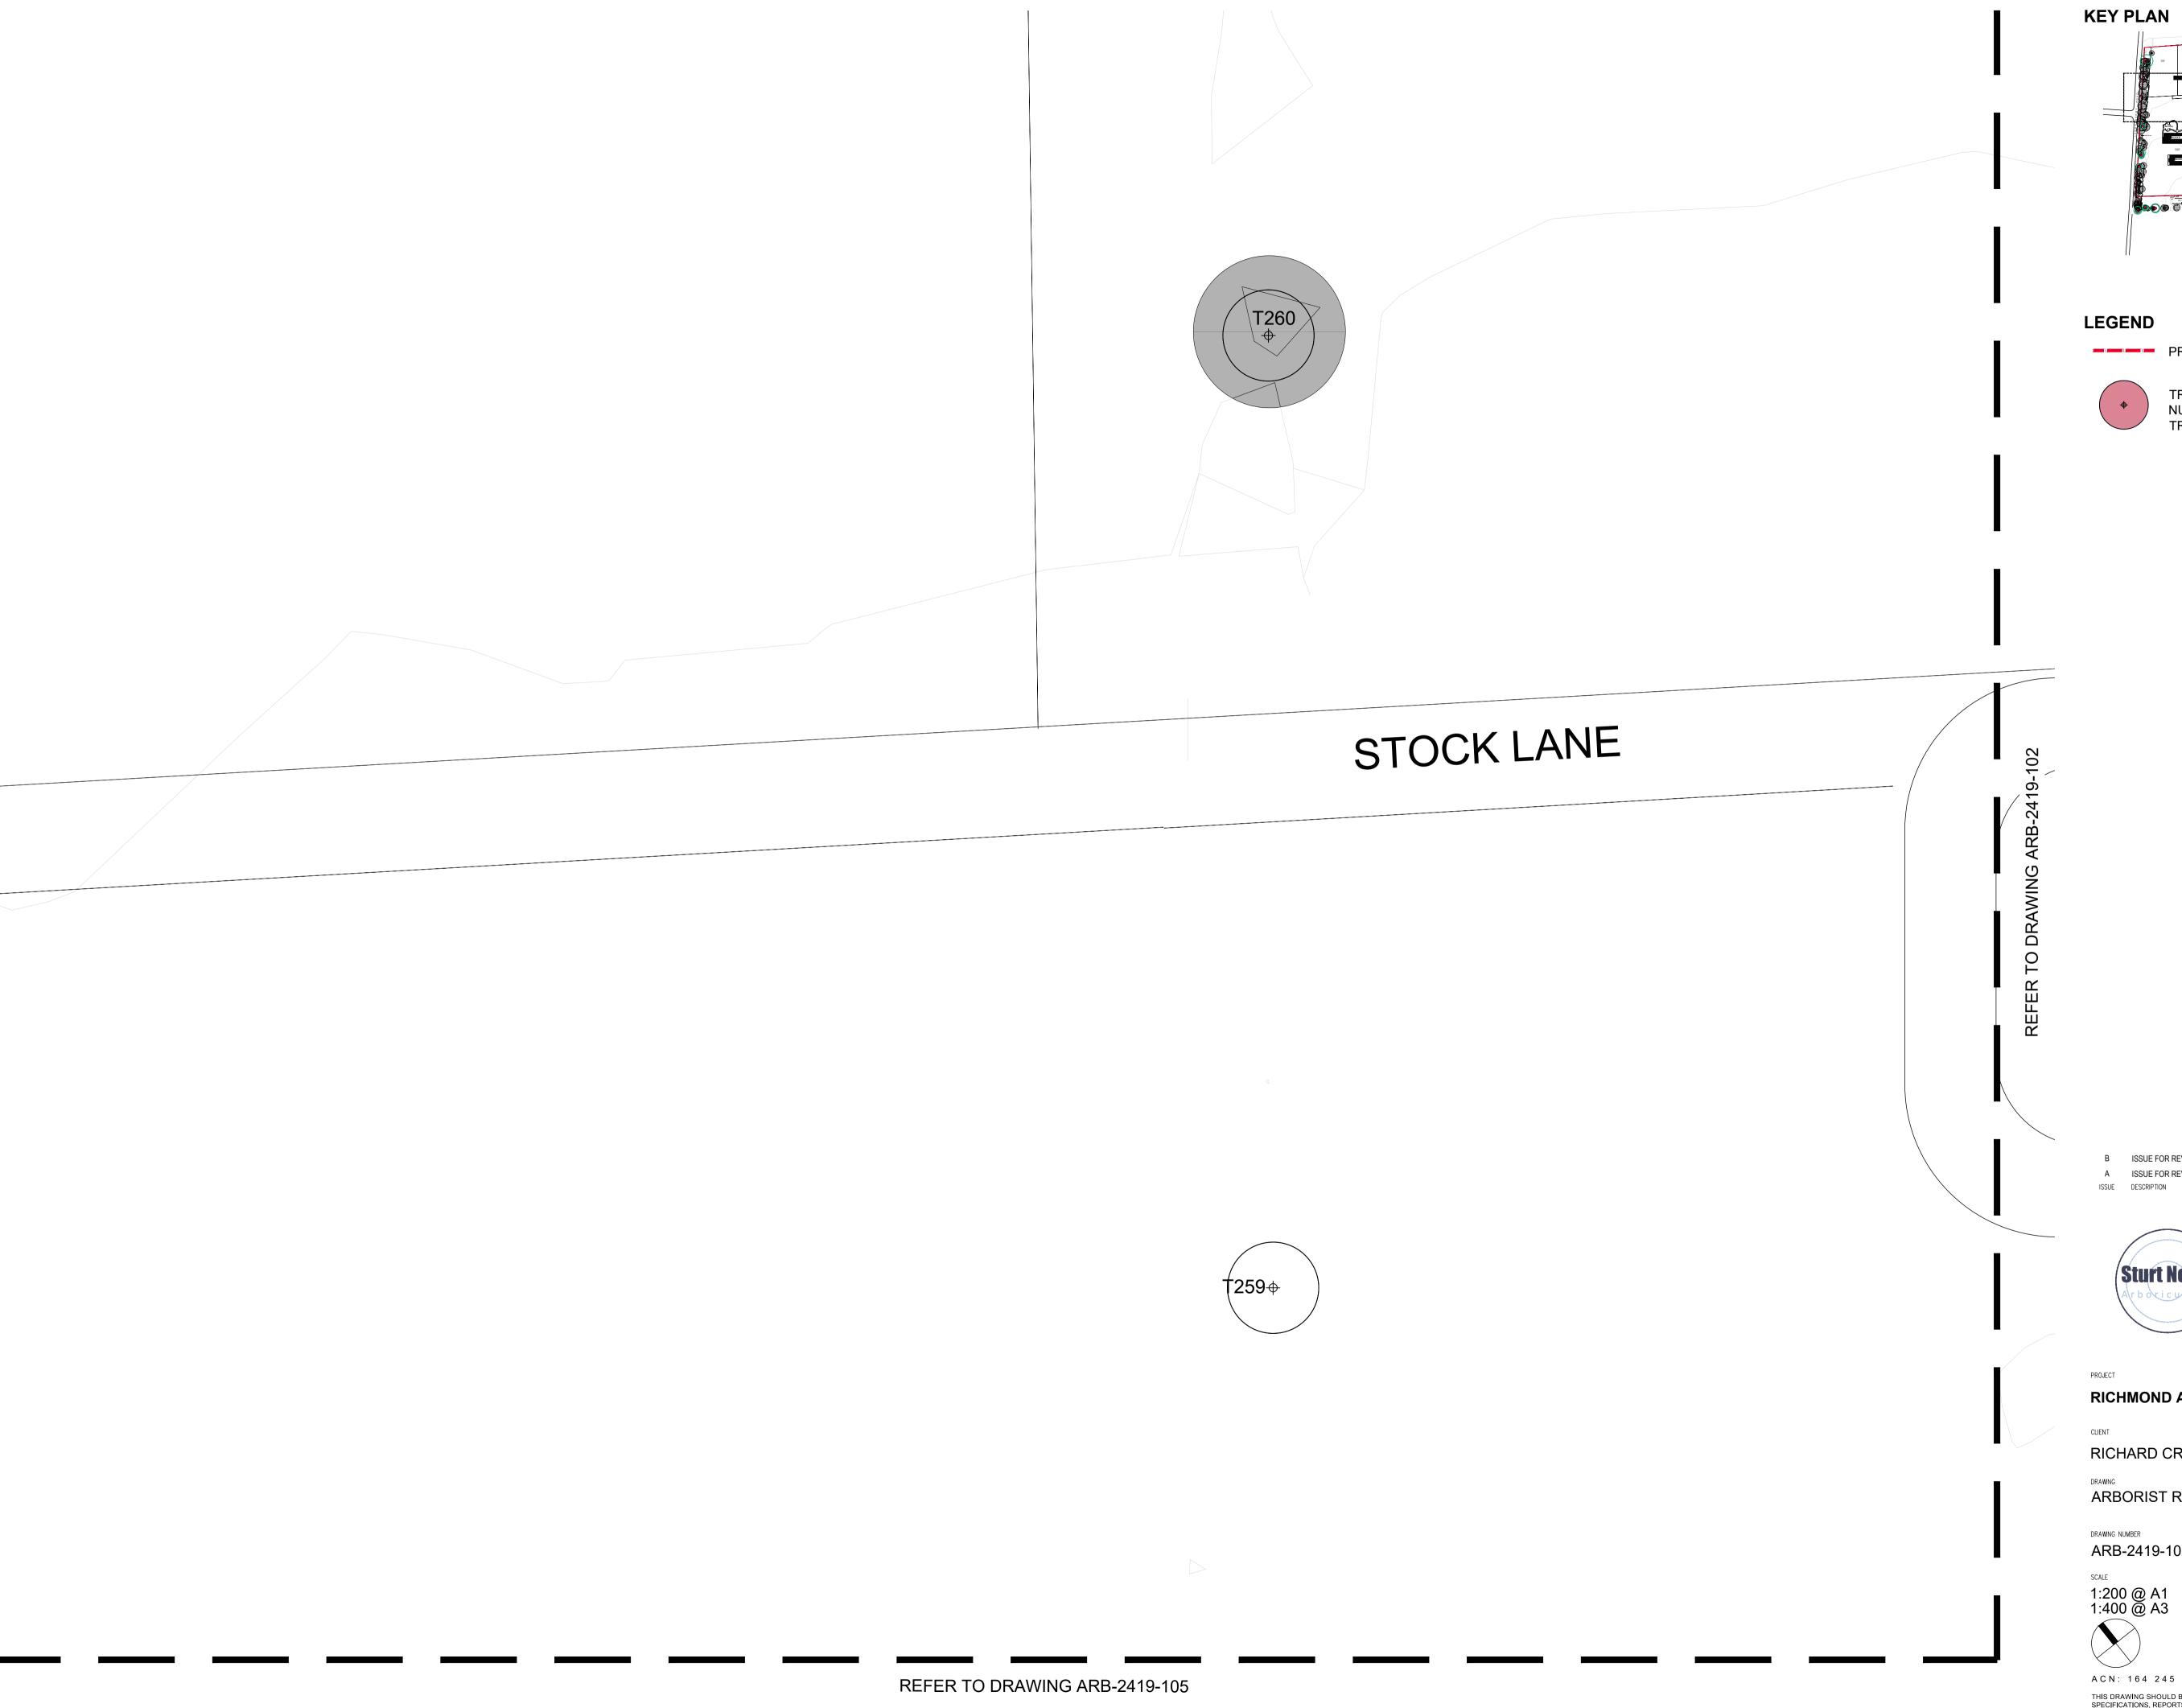

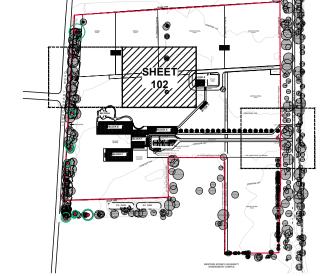

PROPERTY BOUNDARY



B ISSUE FOR REVIEW A ISSUE FOR REVIEW ISSUE DESCRIPTION

16.04.2025 25.11.2024 DATE



Suite 307, 166 Glebe Point Rd Glebe NSW 2037 T. 02 9211 3744 W. www.sturtnoble.com.au landscape architecture environmental & urbandesign

RICHMOND AGRICULTURE CENTRE

RICHARD CROOKES CONSTRUCTIONS


ARBORIST REMOVAL PLAN 2

DRAWING NUMBER	ISSUE		
ARB-2419-102	В		
SCALE	DRAWN	CHECKED	DIRECTOR
1:200 @ A1 1:400 @ A3	jv	gs	gs
	0 2	4	10 m


ACN: 164 245 514

ABN: 99 164 245 514

THIS DRAWING SHOULD BE READ IN CONJUNCTION WITH ALL RELEVANT CONTRACTS, SPECIFICATIONS, REPORTS AND DRAWINGS. COPYRIGHT OF THIS DRAWING IS VESTED IN STURT NOBLE ASSOCIATES PTY LTD.

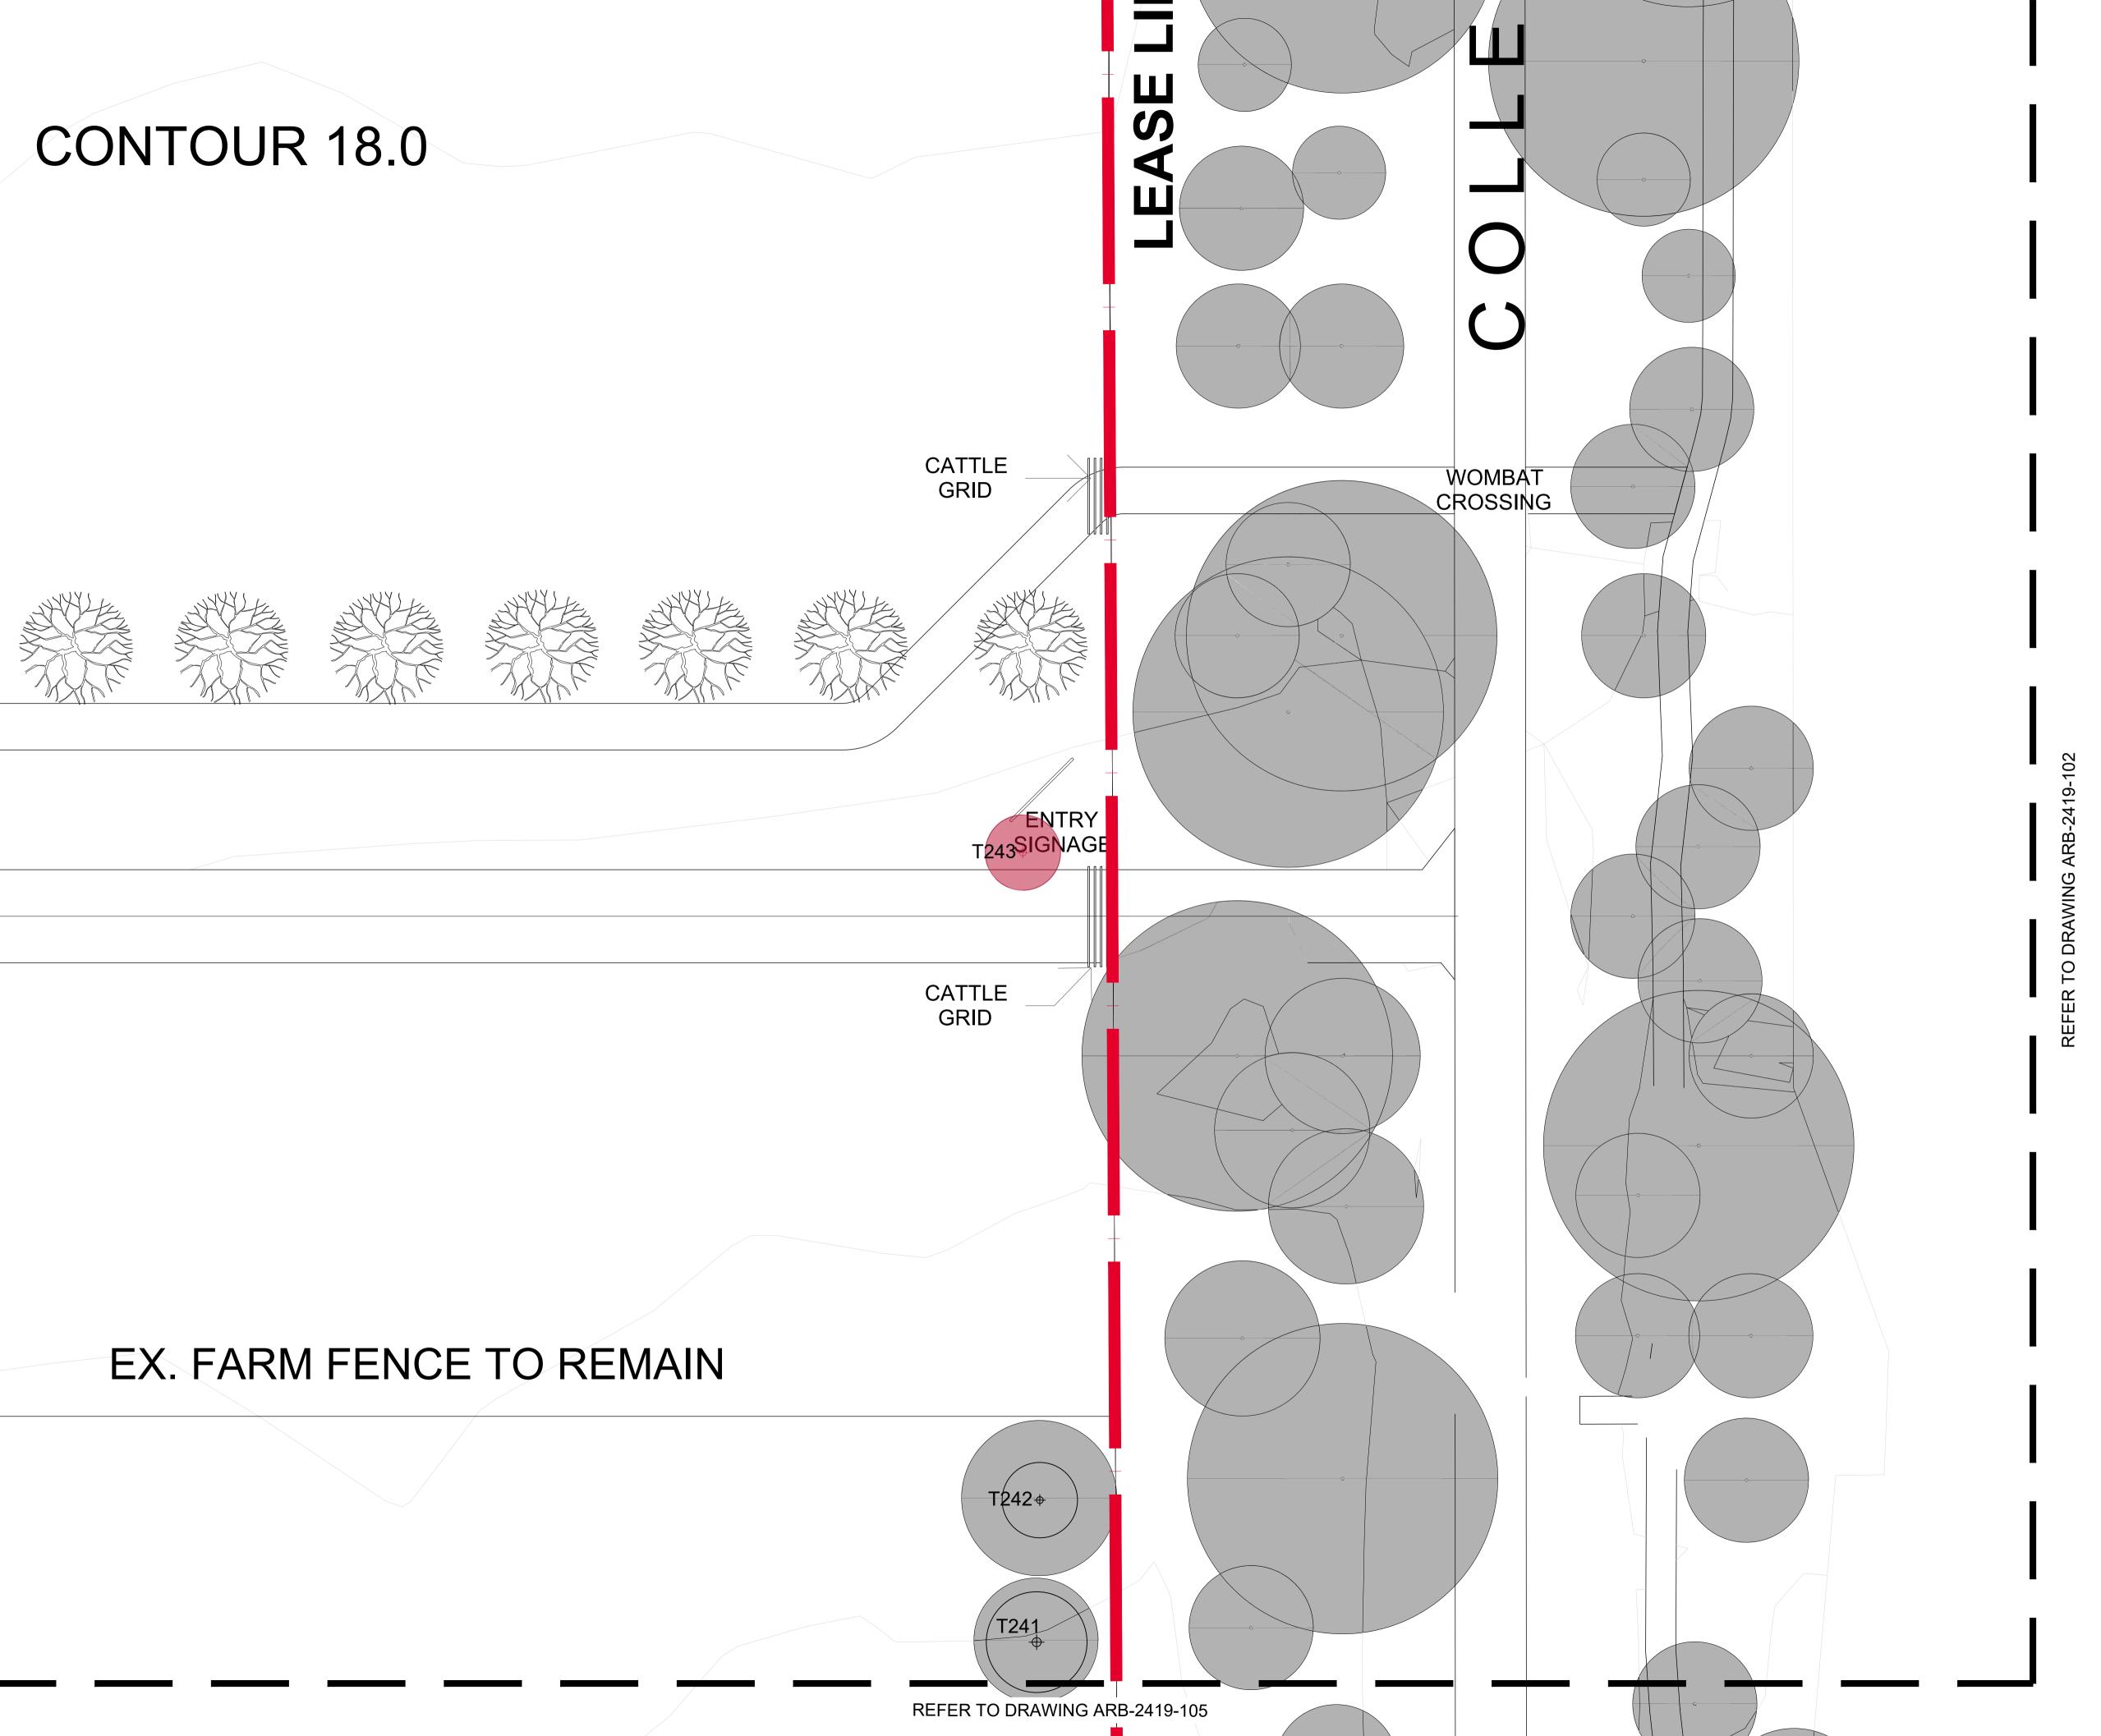

KEY PLAN

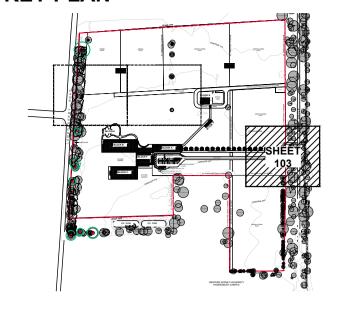

LEGEND

PROPERTY BOUNDARY



TREES TO BE REMOVED. TREE NUMBERS RELATE TO ASSESSED

B ISSUE FOR REVIEW A ISSUE FOR REVIEW ISSUE DESCRIPTION

25.11.2024

Suite 307, 166 Glebe Point Rd Glebe NSW 2037 T. 02 9211 3744

W. www.sturtnoble.com.au landscape architecture environmental & urbandesign




RICHMOND AGRICULTURE CENTRE


RICHARD CROOKES CONSTRUCTIONS


ARBORIST TREE REMOVAL PLAN 3


DRAWING NUMBER ARB-2419-103	ISSUE B		
scale 1:200 @ A1 1:400 @ A3	drawn jv	CHECKED gs	DIRECTOR
	0 2	4	10 m
A C N · 164 245 514	A R N	. 00 164 2	15 511

THIS DRAWING SHOULD BE READ IN CONJUNCTION WITH ALL RELEVANT CONTRACTS, SPECIFICATIONS, REPORTS AND DRAWINGS. COPYRIGHT OF THIS DRAWING IS VESTED IN STURT NOBLE ASSOCIATES PTY LTD.

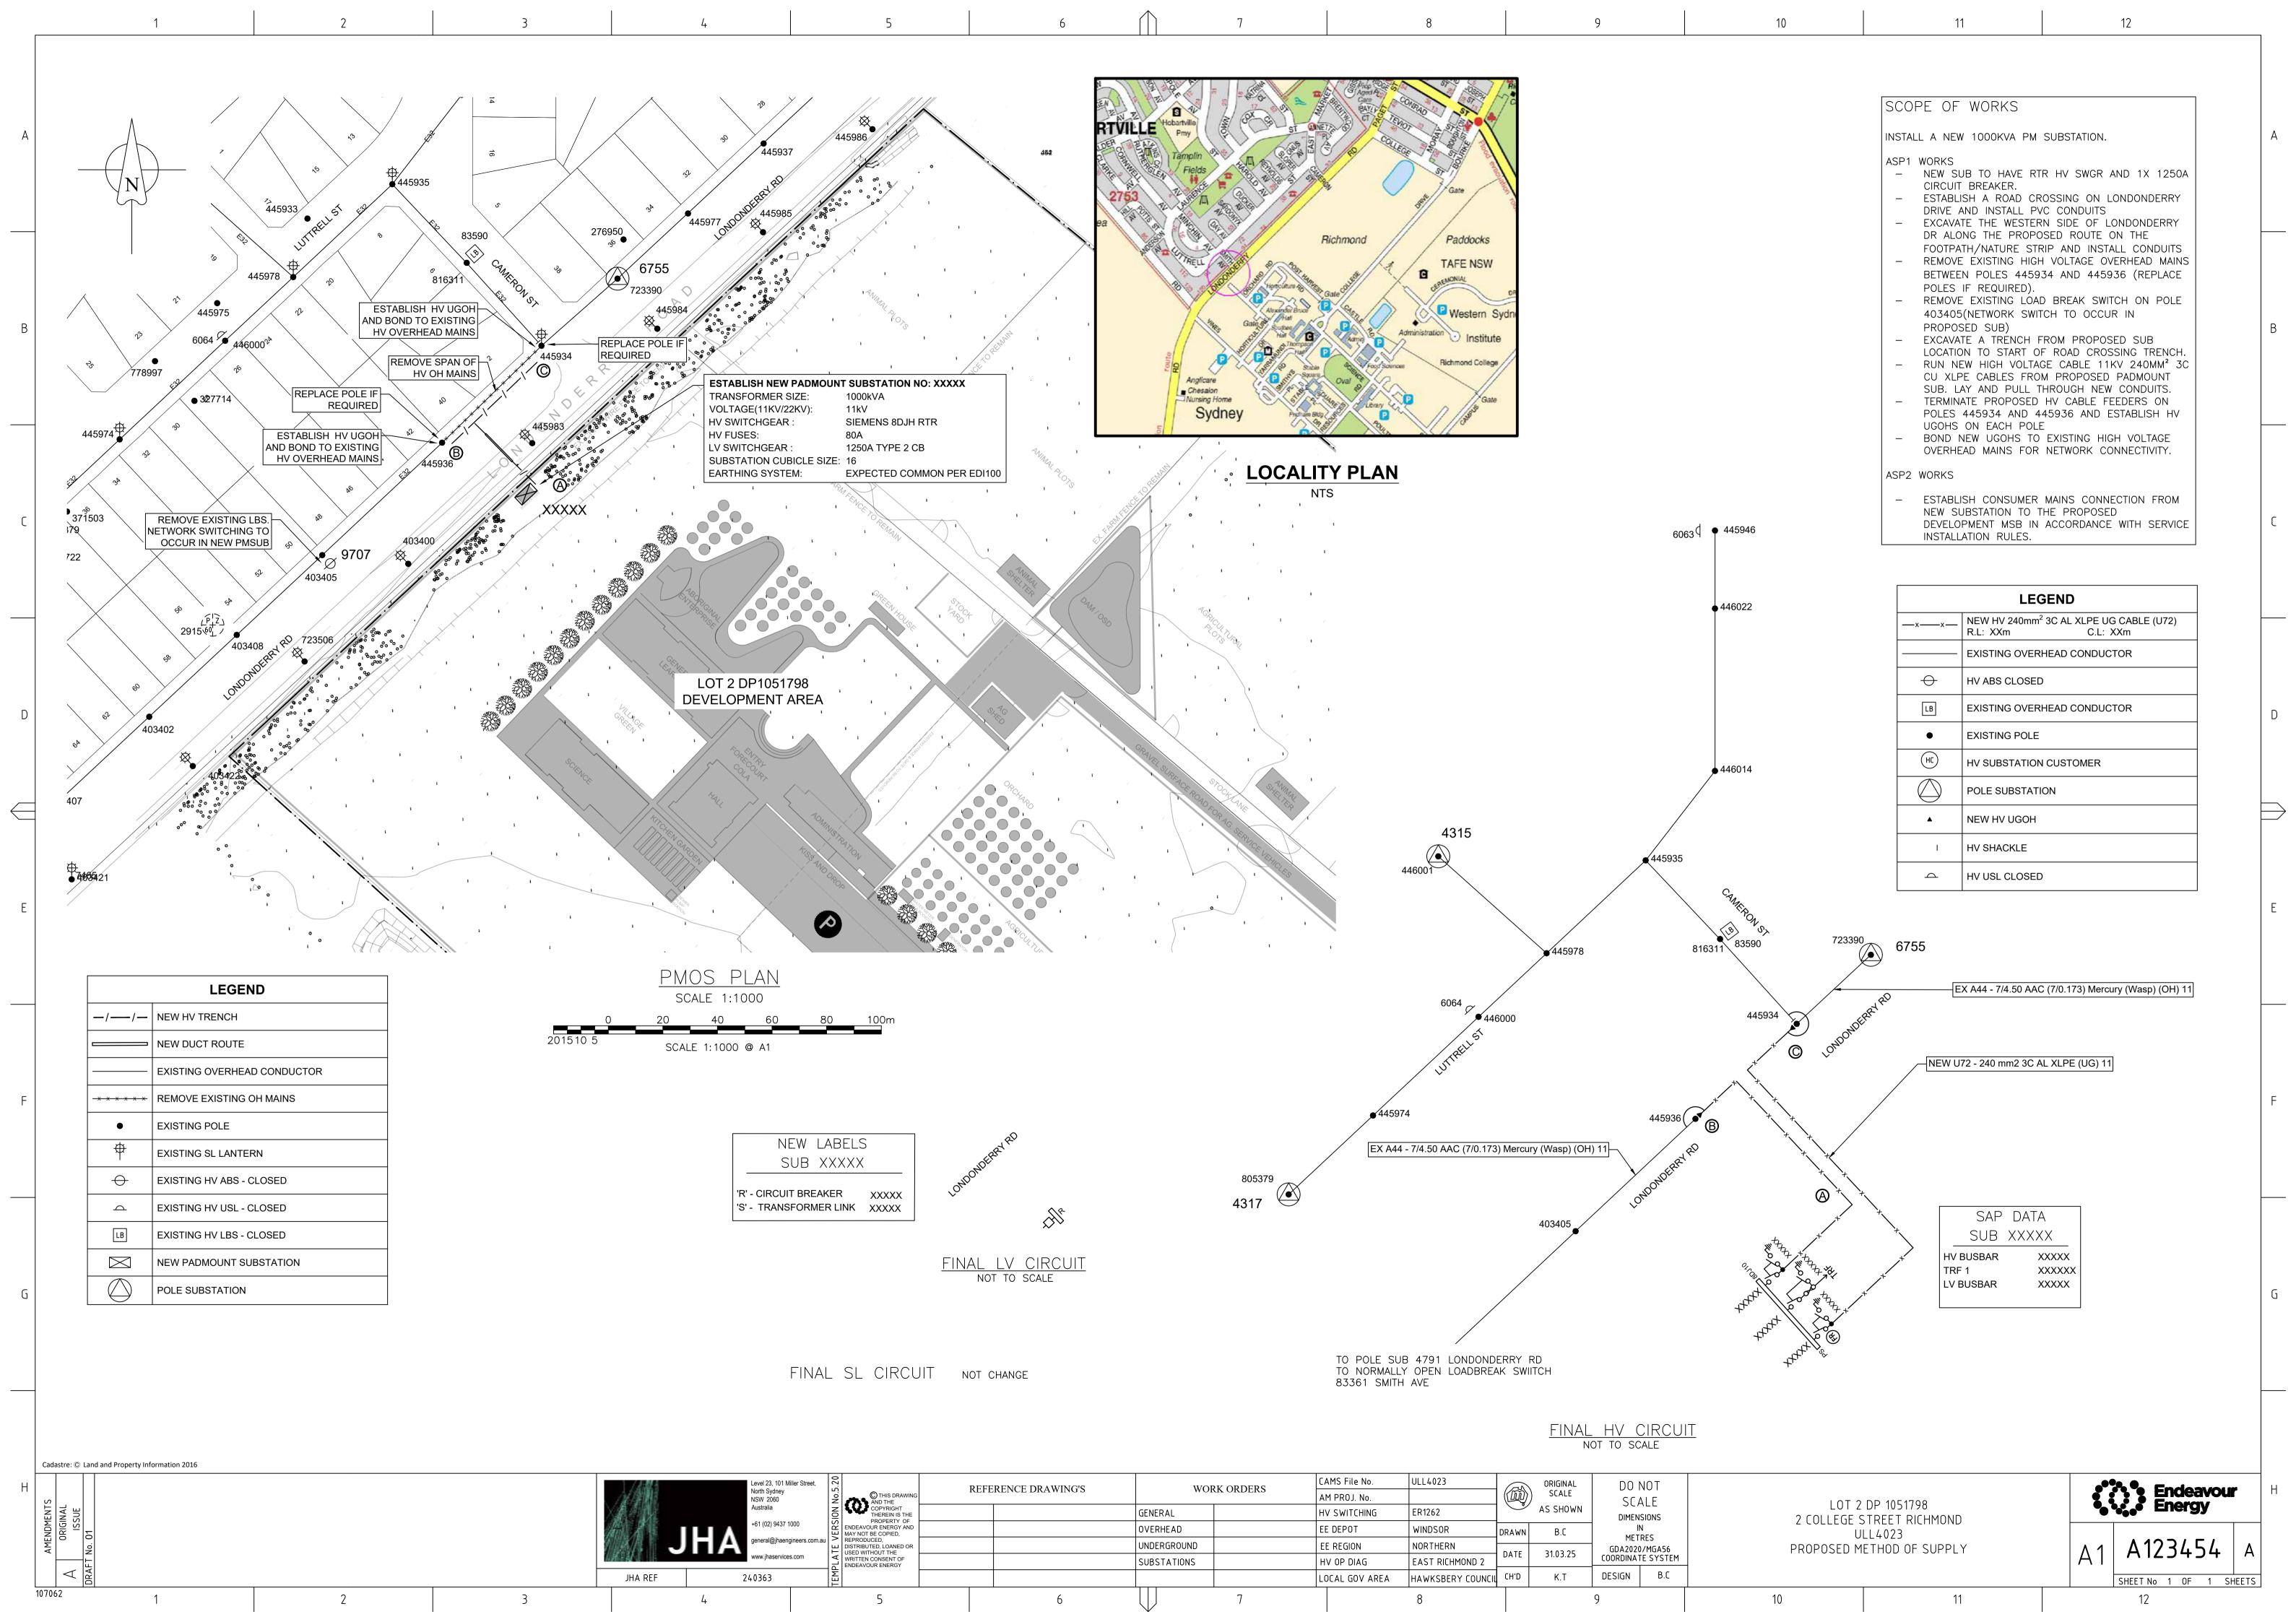

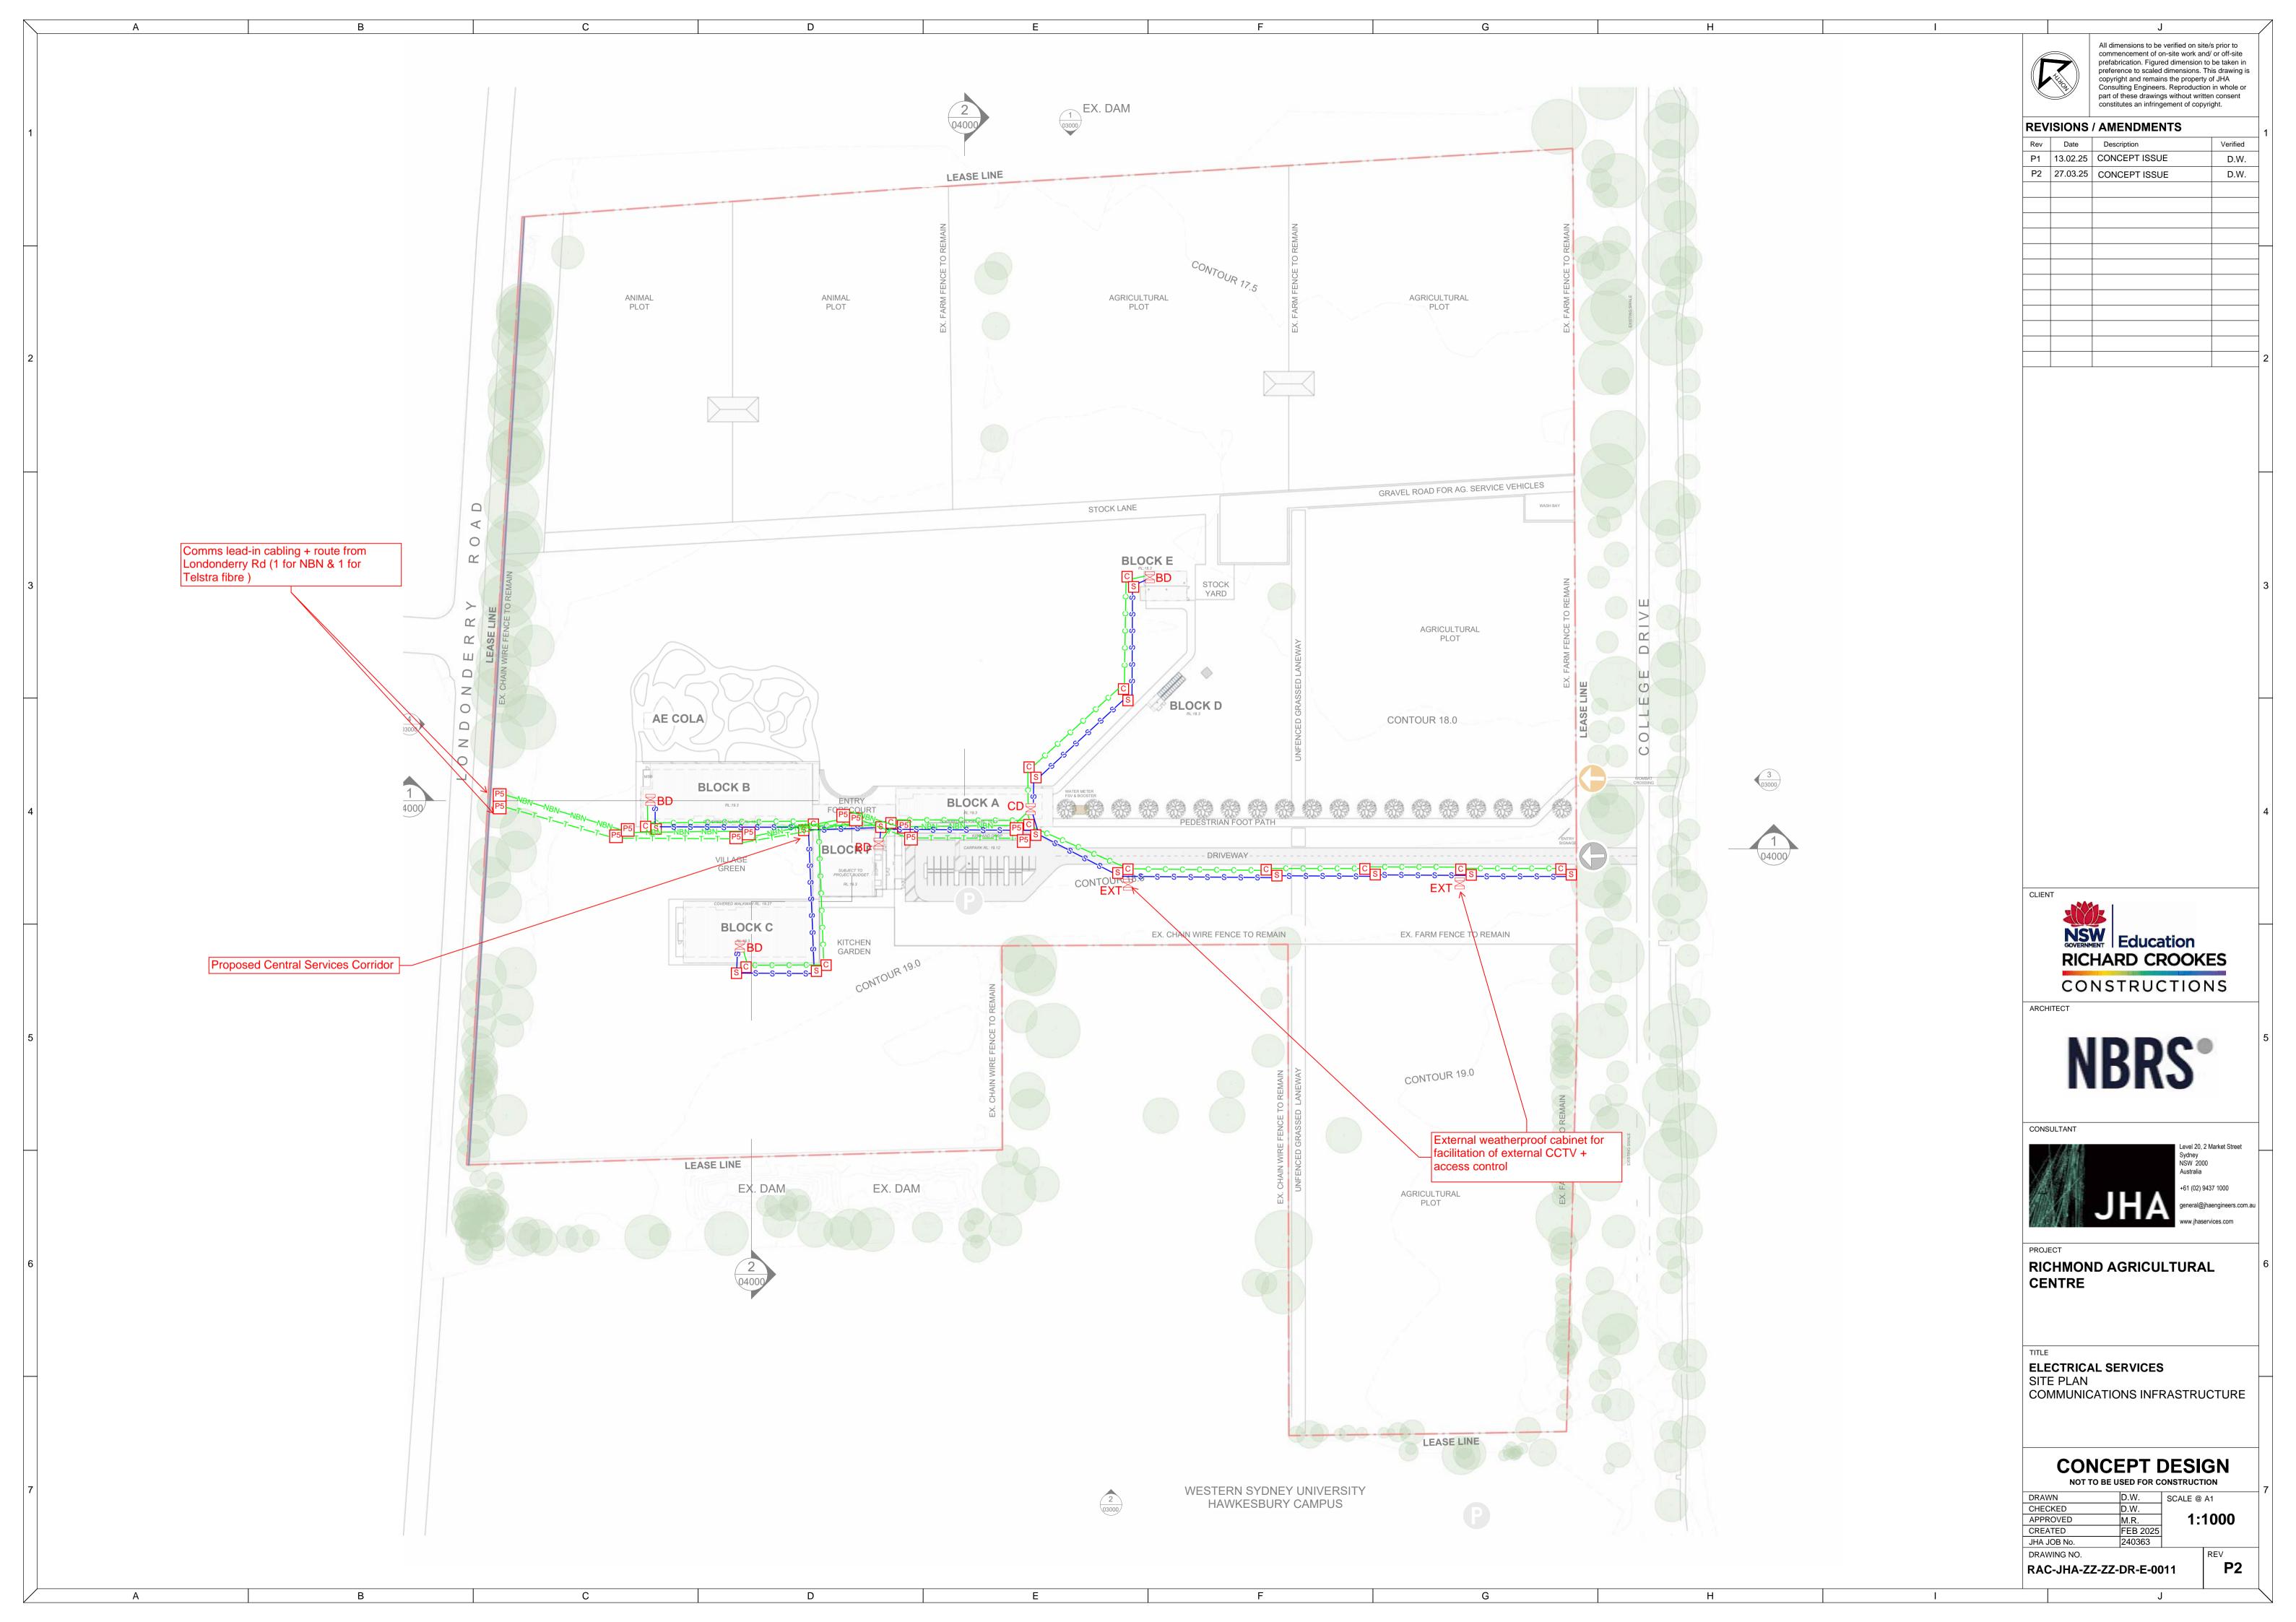

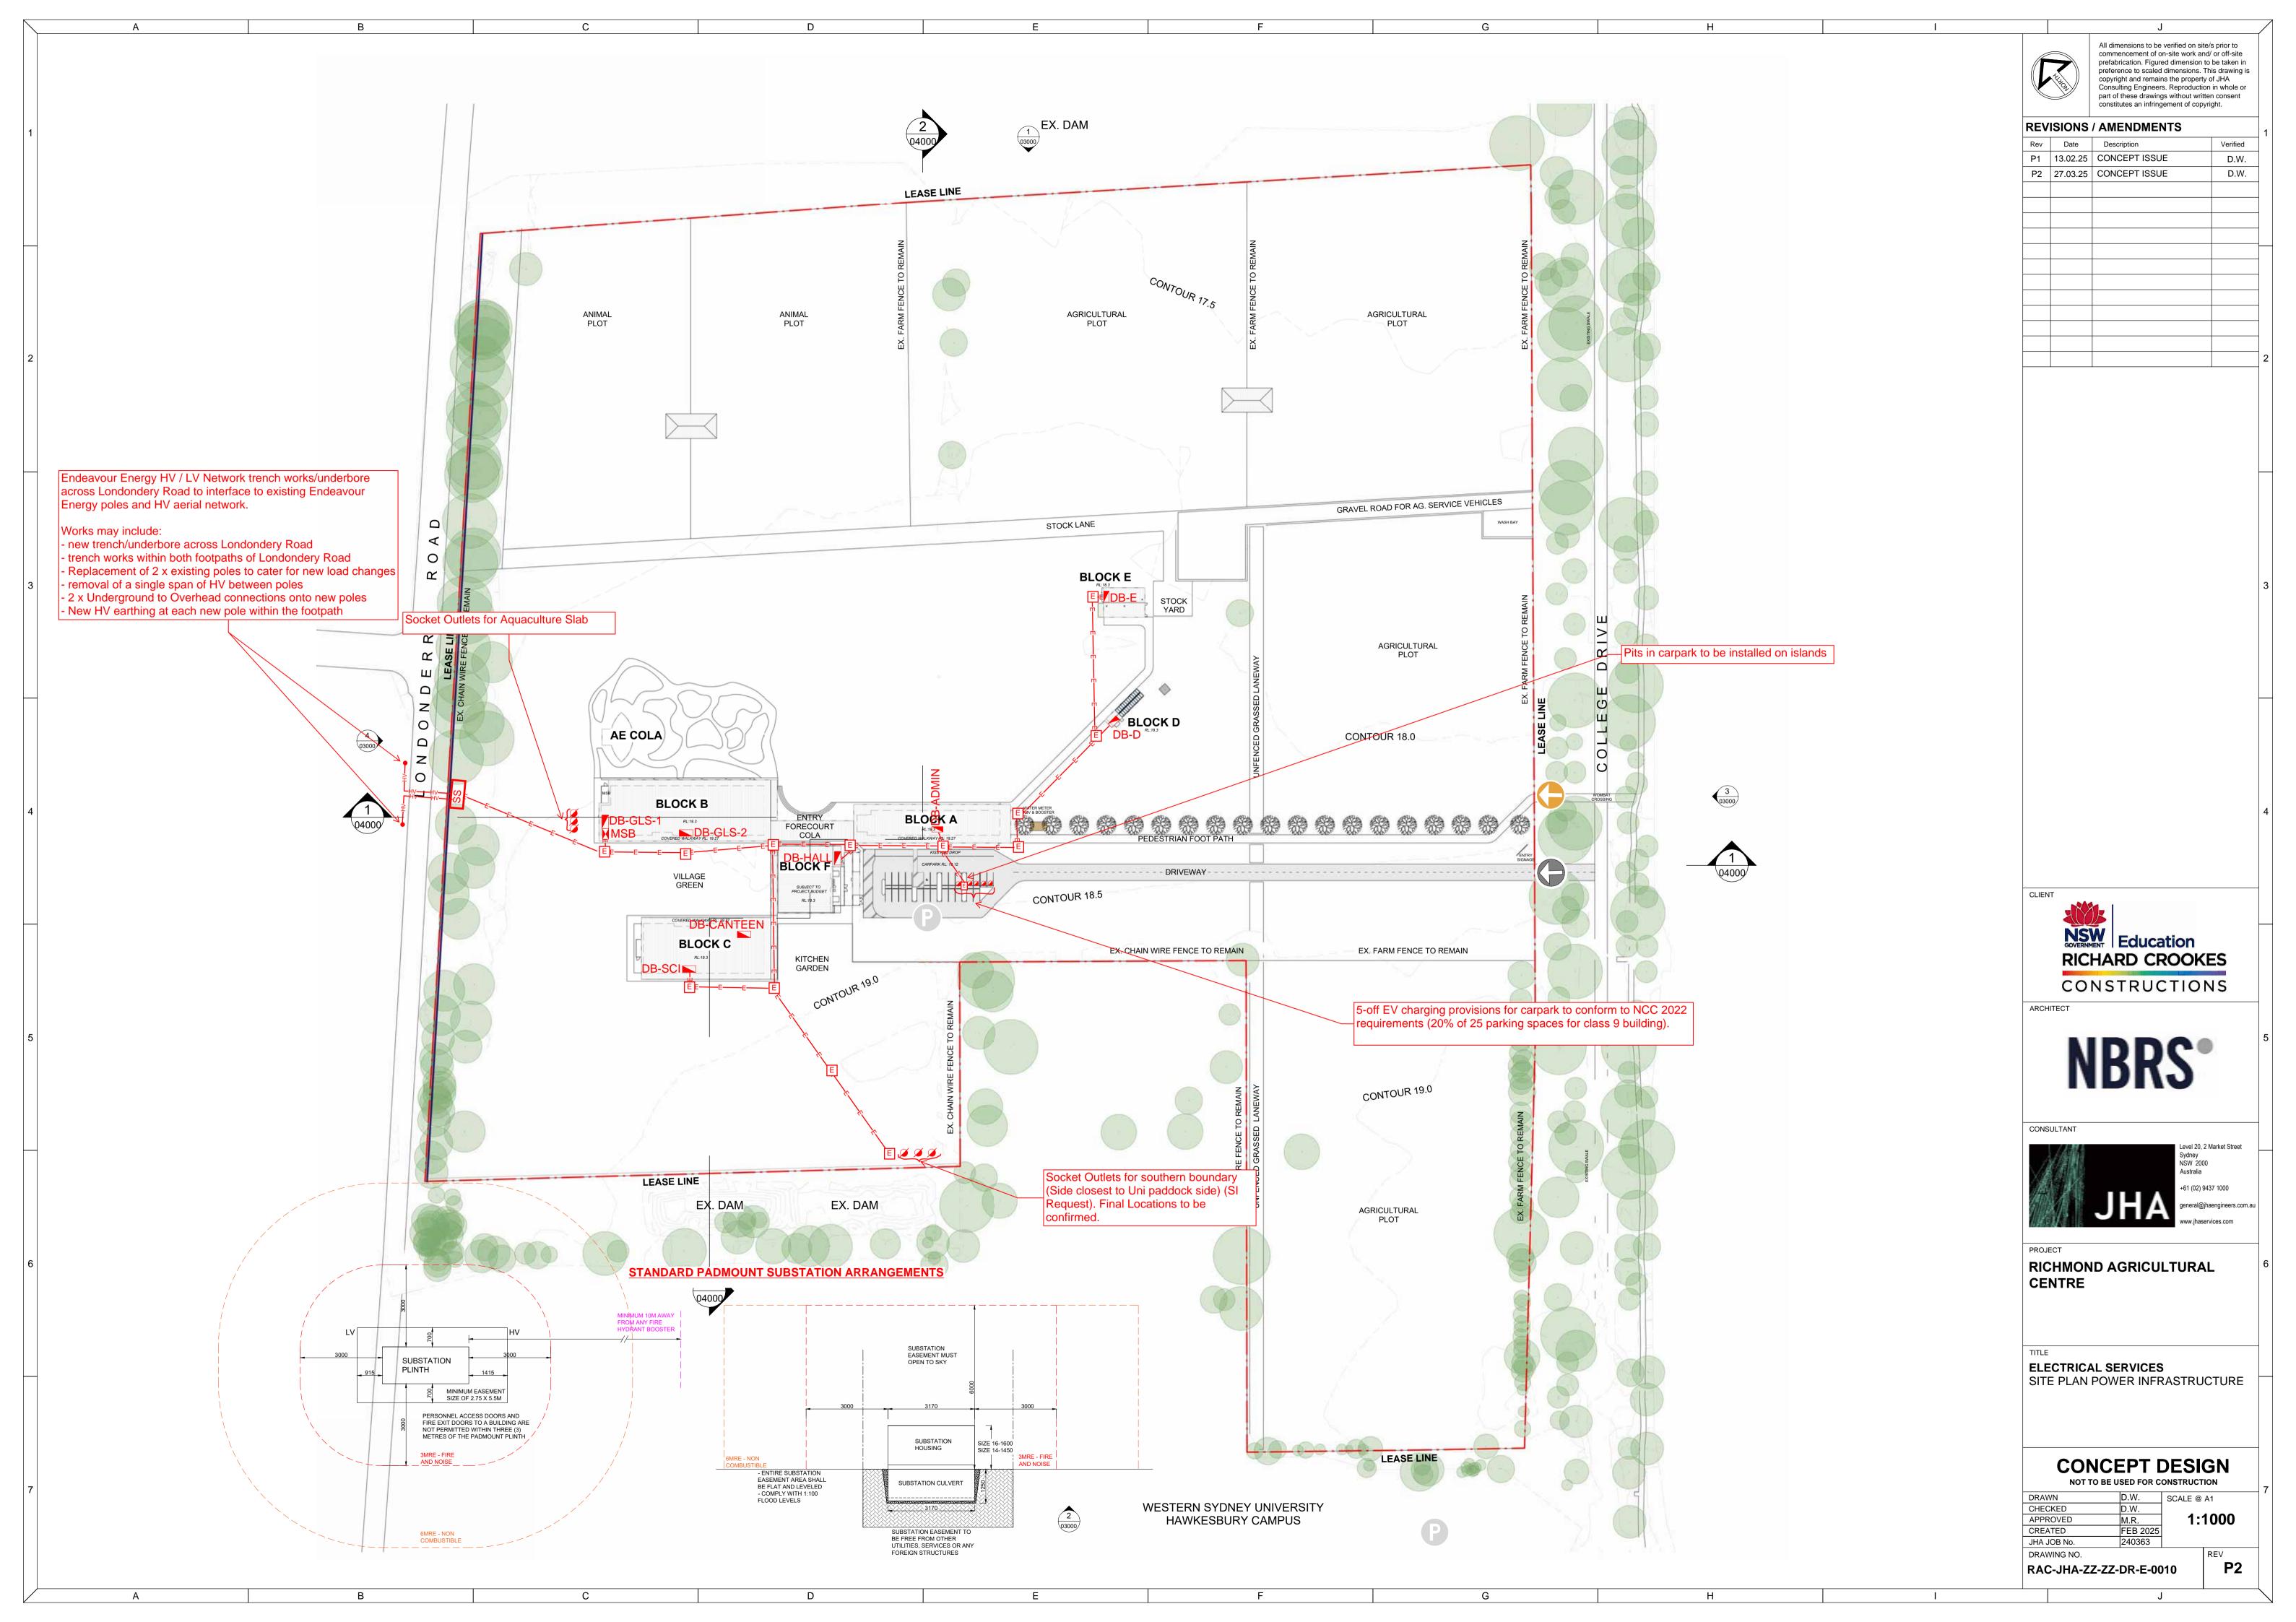

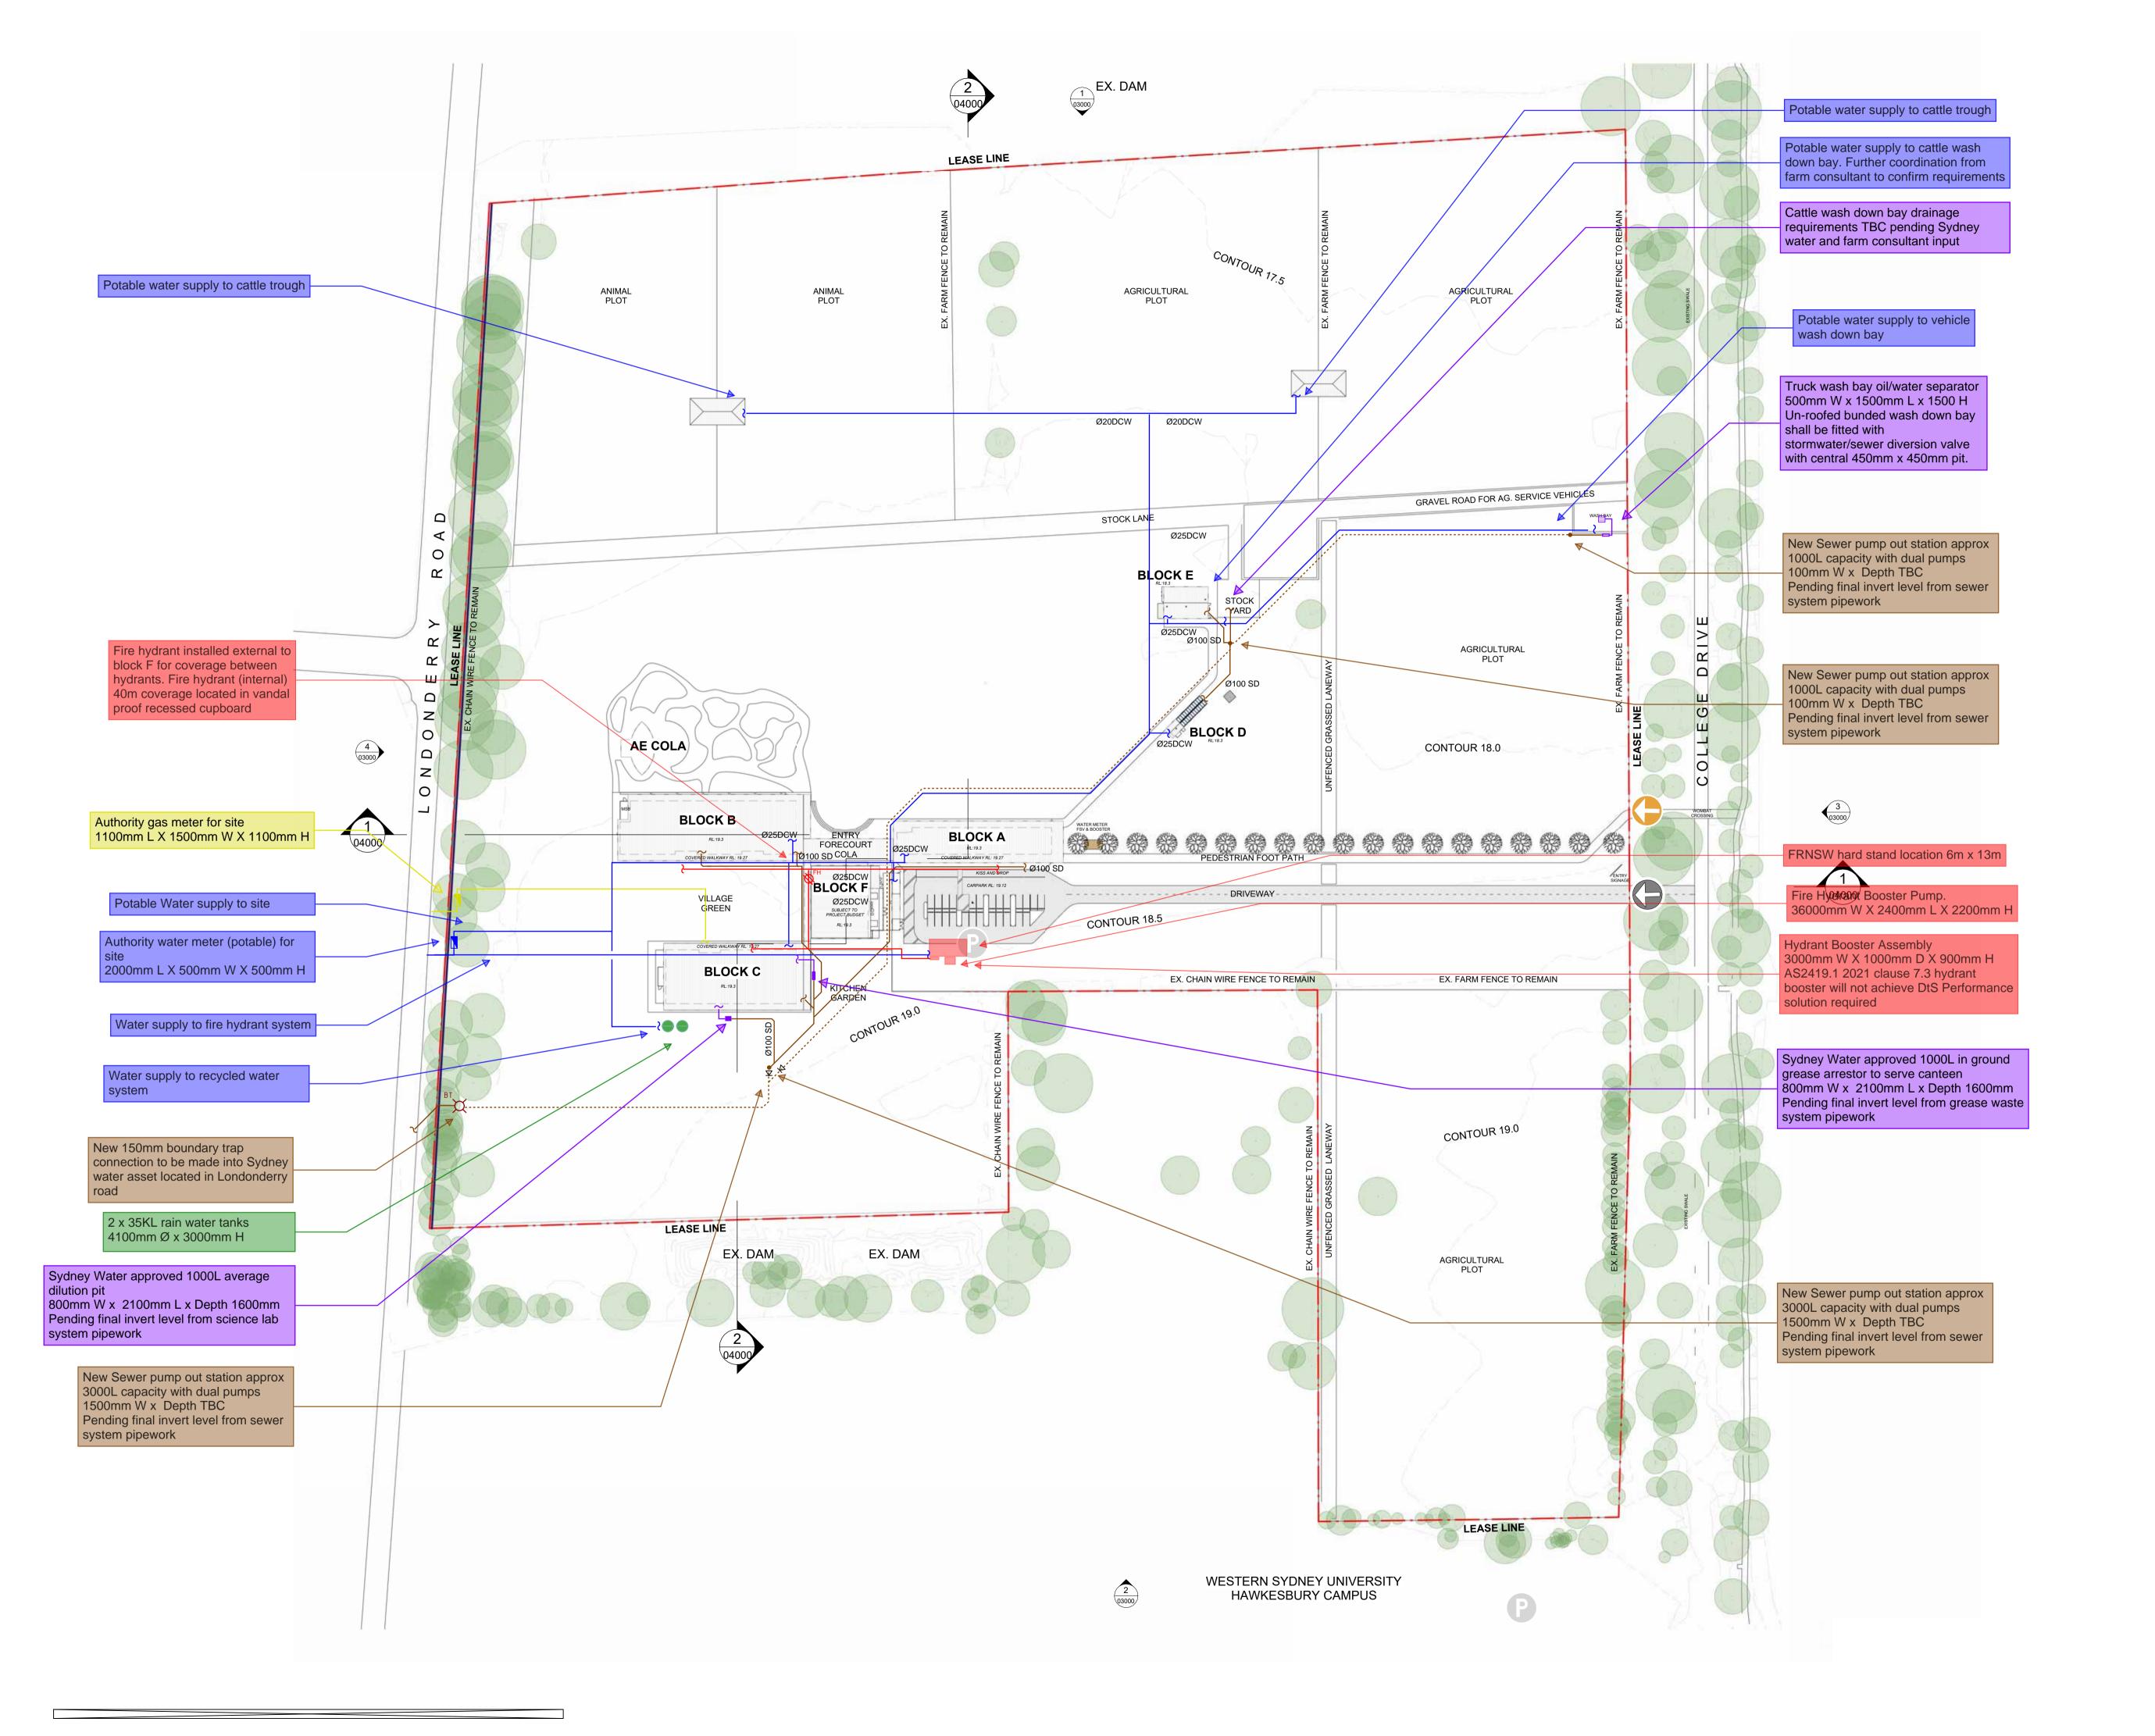



All dimensions to be verified on site/s prior to commencement of on-site work and/ or off-site prefabrication. Figured dimension to be taken in preference to scaled dimensions. This drawing is copyright and remains the property of JHA Consulting Engineers. Reproduction in whole or part of these drawings without written consent constitutes an infringement of copyright.

REVISIONS / AMENDMENTS

KEV	REVISIONS / AMENDIMENTS				
Rev	Date	Description	Verified		
P1	11.12.24	DRAFT CONCEPT ISSUE	S.M.		
P2	02.04.25	CONCEPT ISSUE	S.M.		





_evel 20, 2 Market Street

+61 (02) 9437 1000

Sydney NSW 2000 Australia

CONSULTANT



RICHMOND AGRICULTURAL CENTRE

HYDRAULIC SERVICES SITE PLAN INFRASTRUCTURE LAYOUT

CONCEPT DESIGN

NOT TO BE USED FOR CONSTRUCTION S.M. SCALE @ A1

B B 414/11/10 11/0			í
JHA JOB No.	240363		
CREATED	DEC 2024		
APPROVED	S.T.	1:1	000
CHECKED	S.M.	4.4	000

COE-JHA-ZZ-ZZ-DR-H-0002 **P2**

APPENDIX 3: TREE ASSESSMENT SCHEDULE

Location:	Hawkesbury Centre of Excellence
Client:	Richard Crookes
Date:	25.11.2024

Date			11.20		nensi	ions			Не	alth			Vig	our			Stru	ucture	;		Ac	ge Cl	ass				
Tree No.	Botanical Name / Common Name	TPZ radius (m)	SRZ radius (m)	DBH (mm)			Spread EW (m)	Deadwood Spread NS (m)		Pests	Diseases	Canopy density %	Foliage size	Foliage colour	Extension growth	Inclusions				Senescent		Semi Mature		New planting	Retention Value SRIV	Landscape Significance	Comments
201		0.00	0.00																							HIGH	
202		0.00	0.00																							LOW	
203	Melia azedarach White Cedar	0.00	0.00																							HIGH	
204	Casuarina glauca Swamp Sheoak	0.00	0.00																							HIGH	
205	Eucalyptus sp. Dead Tree	0.00	0.00																							LOW	
206	Eucalyptus fibrosa Red Ironbark	0.00	0.00																							HIGH	
207	Melia azedarach White Cedar	0.00	0.00																							HIGH	
208	Dead Tree	0.00	0.00																							LOW	
209	Dead Tree	0.00	0.00																							LOW	
210	Dead Tree	0.00	0.00																							LOW	
211		0.00	0.00																							HIGH	
212		0.00	0.00																							HIGH	
		0.00	0.00																				~				
214		0.00	0.00																								
		0.00	0.00																								
216	Eucalyptus moluccana Grey Box	0.00	0.00																								
217	Callistemon citrinus Crimson Bottlebrush	0.00	0.00																							LOW	
218	Casuarina glauca Swamp Sheoak	0.00	0.00																								
219	Casuarina glauca Swamp Sheoak	0.00	0.00																								
220	Casuarina glauca Swamp Sheoak	0.00	0.00																								
221	Callistemon citrinus Crimson Bottlebrush	0.00	0.00																							LOW	

Location:	Hawkesbury Centre of Excellence
Client:	Richard Crookes
Date:	25.11.2024

Date		23.	1.20		nens	ione		$\overline{}$	۵	alth		1	Via	our	- 1		Ctri	ucture			Λ.	ge C	loco				
		_	10				(0	· -					Vig		П					- (A				T -	70		
Tree No.	Botanical Name / Common Name	TPZ radius (m)	SRZ radius (m)	DBH (mm)	DAB (mm)	Height (m)	Spread EW (m)	Deadwood Spread NS (m)	Dieback	Pests	Diseases	Canopy density %	Foliage size	Foliage colour	Extension arowth	Inclusions	ractures	Wounds	Covition	Senescent Decav	Mature	Semi Mature	Young	New planting	Retention Value SRIV	Landscape Significance	Comments
222	Casuarina glauca Swamp Sheoak	0.00	0.00																								
223	Casuarina glauca Swamp Sheoak	0.00	0.00																								
224	Casuarina glauca Swamp Sheoak	0.00	0.00																								
225	Casuarina glauca Swamp Sheoak	0.00	0.00																								
226	Casuarina glauca Swamp Sheoak	0.00	0.00																								
227	Casuarina glauca Swamp Sheoak	0.00	0.00																								
228	Casuarina glauca Swamp Sheoak	0.00	0.00																								
229	Eucalyptus fibrosa Red Ironbark	0.00	0.00																								
230	Eucalyptus saligna Sydney Blue Gum	0.00	0.00																							HIGH	
231		0.00	0.00																							HIGH	
232		0.00	0.00																							HIGH	
233		0.00	0.00																							HIGH	
234		0.00	0.00																							HIGH	
235		0.00	0.00																							HIGH	
236		0.00	0.00																							HIGH	
237		0.00	0.00																							HIGH	
238		0.00	0.00																							HIGH	
239		0.00	0.00																							HIGH	
240		0.00	0.00																							HIGH	
241		0.00	0.00					\perp																		HIGH	
242	Eucalyptus saligna Sydney Blue Gum	0.00	0.00																							HIGH	


Location:	Hawkesbury Centre of Excellence
Client:	Richard Crookes
Date:	25.11.2024

Date	•	20.1	1.20																								
1					nensi					Heal				our				uctur				\ge C			71		
Tree No.	Botanical Name / Common Name		SRZ radius (m)	DBH (mm)	DAB (mm)	Height (m)	Spread EW (m)	Spread NS (m)	Deadwood	Dieback	Diseases Pests	Canopy density %	Foliage size	Foliage colour	Extension growth	Inclusions	Fractures	Wounds	Cavities	Decay	Mature	Semi Mature	Young	New planting	Retention Value SRIV	Landscape Significance	Comments
243	Casuarina glauca Swamp Sheoak	0.00	0.00																							HIGH	
244	Casuarina glauca Swamp Sheoak	0.00	0.00																								
245	Cinnamomum camphora Camphor Laurel	0.00	0.00																								
246- 256	Callistemon citrinus Crimson Bottlebrush	0.00	0.00			4-7														٥	0				OGVF5	LOW	
259	Pinus sp.	0.00	0.00																								
260	Pinus sp.	0.00	0.00																								
261	Pinus sp.	0.00	0.00																								
	Casuarina glauca Swamp Sheoak	0.00	0.00																								
265- 267	Casuarina glauca Swamp Sheoak			100-450		15-22						100	G	G	G	**************************************	VARIOUS	VARIOUS		o	0 ≤	SM	Y			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
268	Eucalyptus moluccana Grey Box	14.76	3.81	1230	1400	33						80	٦	٦	٦						Z				MGVG10	HIGH	Co-dominant
269	Eucalyptus moluccana Grey Box	2.88	0.00	240		9	5	5																	YGVG9		
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G		VARIOUS	VARIOUS		o	ο ≤	SM	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G		VARIOUS	VARIOUS		o	ი ≤	SM	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G	***************************************	VARIOUS	VARIOUS		o	n ≤	SM	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
584	Eucalyptus robusta Swamp Mahogany	5.88	0.00	490		2	8	8																	MGVF9		
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G		VARIOUS	VARIOUS		o	0 ≤	MS	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
706	Eucalyptus robusta Swamp Mahogany	9.24	0.00	770		27	12	12																	MGVC10		

Location:	Hawkesbury Centre of Excellence
Client:	Richard Crookes
Date:	25.11.2024


	•		Dimensions						Н	ealth			Vigo	our		Str	uctur	re		A	ge Cl	ass		_		
Tree No.	Botanical Name / Common Name	TPZ radius (m)	SRZ radius (m)	DBH (mm)	DAB (mm)	Height (m)	Spread EW (m)	Spread NS (m)	Dieback	Pests	Diseases	Canopy density %	Foliage size	Foliage colour	Extension growth			Cavities	Senescent Decay	Mature	Semi Mature	Young	New planting	Retention Value SRIV	Landscape Significance	Comments
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G	VARIOUS	VARIOUS		S	М	SM	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
717	Eucalyptus robusta Swamp Mahogany	6.72	0.00	560		24	8	8																MGVC10		
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G	VARIOUS	VARIOUS		S	≤	MS	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
728	Eucalyptus robusta Swamp Mahogany	6.60	0.00	550		10	8	8																MLVF4		Central leader lost
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G	VARIOUS	VARIOUS		S	≤	SM	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
839	Eucalyptus robusta Swamp Mahogany	10.80	0.00	900		25	12	12																MGVC10		
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G	VARIOUS	VARIOUS		S	Z	SM	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.
900	Eucalyptus robusta Swamp Mahogany	9.12	0.00	760		28	14	14																MGVC10		
901	Eucalyptus tereticornis Forest Red Gum	5.40	0.00	450		10	8	6				80												MGVF9		Co-dominant
903	Eucalyptus tereticornis Forest Red Gum	5.88	0.00	490		18	8	8																		
904	Casuarina glauca Swamp Sheoak	0.00	0.00																							
907	Melaleuca linariifolia Dead Tree	0.00	0.00																							
908	Eucalyptus robusta Swamp Mahogany	10.56	0.00	880		28	18	18				100												MGVC10		Co-dominant
909		0.00	0.00			8	6	6																MGVC10		Co-dominant
910	Eucalyptus robusta Swamp Mahogany	0.00	0.00			20	12	12																MGVC10		Co-dominant
	Casuarina glauca Swamp Sheoak	0.00	0.00	100-450		15-22						100	G	G	G	VARIOUS	VARIOUS		S	≤	SM	~			HIGH	Forms part of a screen to Londonderry Road and residential houses across the road.

APPENDIX 4: TYPICAL TREE PROTECTION DETAILS

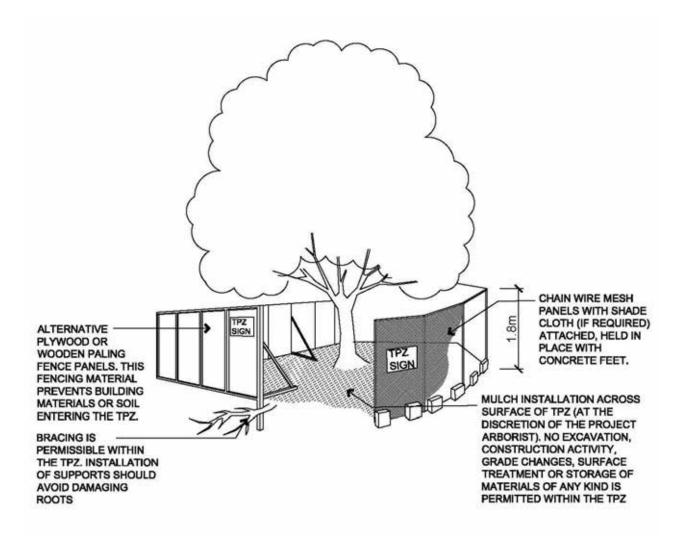

PROTECTIVE FENCING


Based on AS4970-2009 NOT TO SCALE

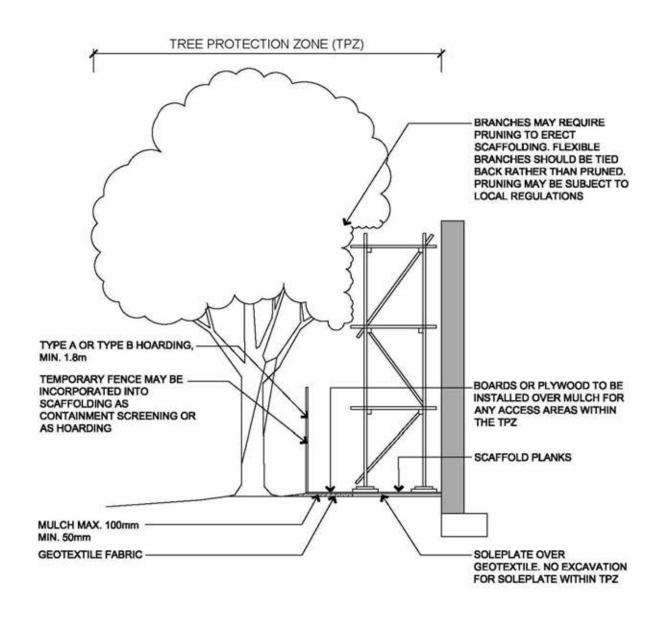

NOTE: Excavation required for the insertion of support posts for tree protection fencing should not involve the severance of any roots greater than 20mm in diameter, without the prior approval of the project arborist.

INDICATIVE SCAFFOLDING WITHIN A TPZ

Based on AS4970-2009 NOT TO SCALE

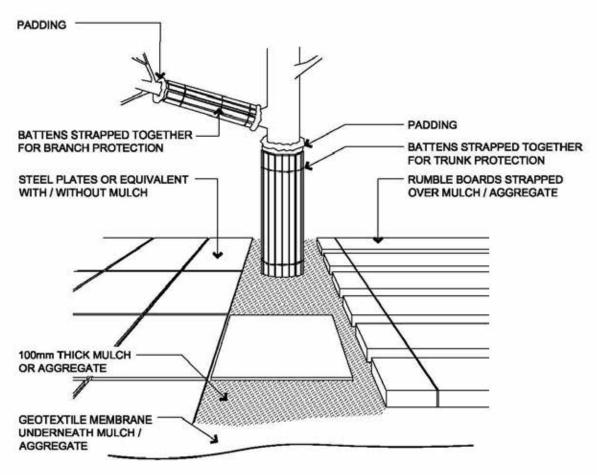

NOTE:

- For trunk and branch protection use boards and padding that will prevent damage to bark.
 Boards are to be strapped to trees, not nailed or screwed.
- 2. Rumble boards should be of a suitable thickness to prevent soil compaction and root damage.

EXAMPLES OF TRUNK, BRANCH AND GROUND PROTECTION

Based on AS4970-2009 NOT TO SCALE



TREE PROTECTION ZONE SIGN

Based on AS4970-2009 NOT TO SCALE