

9 Hickson Circuit Harrington Park NSW 2567 M: 0425 308 275 E: scott@hortmanagement.com.au

ARBORICULTURAL IMPACT ASSESSMENT AND TREE MANAGEMENT PLAN



PROPOSED BOARDING HOUSE DEVELOPMENT APPLICATION DA-21-00558

225 BUNGARRIBEE ROAD BLACKTOWN, NSW

Report prepared for: Gus Fares Architects Pty Ltd

Suite 22, 103 George Street

Parramatta, NSW

Report prepared by: Scott Freeman - Principal

Horticultural Management Services Diploma of Arboriculture (AQF L5)

ISA Tree Risk Assessment (TRAQ) Certified

Diploma of Horticulture

Diploma of Conservation and Land Management

3rd May 2021

Amended 8th September 2021



DISCLAIMER

This report has been prepared in accordance with the scope of services described in agreement between Horticultural Management Services and the client.

This report relies upon data, surveys and site inspections results taken at or under the particular time and or conditions specified herein.

Any representation, statement, opinion or advice, expressed or implied in this publication is made in good faith but on the basis that Horticultural Management Services, its agents and employees are not liable (whether by reason of negligence, lack of care or otherwise) to any person for any damage or loss whatsoever which has occurred or may occur in relation to that person taking or not taking (as the case may be) action in respect of any representation, statement, or advice referred to above.

Every effort has been made in this report to include, assess, and address all defects, structural weaknesses, instabilities of the subject trees. All inspections were made from ground level using only visual means and no intrusive or destructive means of inspection were used. For many structural defects such as decay and inclusions, internal inspection is required by means of resistograph or similar. No such investigation has been made in this case. Trees are living organisms and are subject to failure through a variety of causes not able to be identified by means of this inspection and assessment.

Information contained in this report covers only the subject tree that was assessed and reflects the condition of the subject tree at the time of inspection. Any finding, conclusion or recommendations only apply to the aforementioned circumstances and no greater reliance should be assumed or drawn by the Client.

There is no warranty or guarantee, expressed or implied that problems or deficiencies regarding the subject trees or the subject site may not arise in the future.

Furthermore, this report has been prepared solely for the use by the Client. The Client acknowledges that this assessment, and any opinions, advice or recommendations expressed or given in it, are based on the information supplied by the Client and based on the data observations, measurements and analysis carried out or obtained by Horticultural Management Services and referred to in the assessment.

Horticultural Management Services accepts no responsibility for its use by other parties.



TABLE OF CONTENTS

TABL	E OF FIGURES5
1.0	INTRODUCTION AND BACKGROUND6
2.0	SITE LOCATION7
2.1	AERIAL SITE LOCATION7
3.0	AIMS7
4.0	SITE DESCRIPTION AND PROPOSED DEVELOPMENT8
5.0	METHODOLOGY9
5.1	VISUAL TREE ASSESSMENT
5.2	HERITAGE SIGNIFICANCE
5.3	LANDSCAPE SIGNIFICANCE
5.4	TREES ON ADJOINING LAND
5.5	IMPACT ASSESSMENT
6.0	PRUNING/REMOVAL STANDARDS
7.0	TREE PROTECTION ZONES AND ROOT SYSTEM
8.0	TREE PROTECTION ZONE
8.1	NORMAL STRUCTURAL ROOT FORM OF A TREE
8.2	TYPES OF TREE ROOTS
8.3	ROOT PLATE
8.4	WOODY ROOTS16
8.5	NON-WOODY ROOTS16
9.0	DEFINITION OF ASSESSED HEALTH AND CONDITION OF TREE17
9.1	TREE AGE CLASS TERMINOLOGY
9.2	SAFE USEFUL LIFE EXPECTANCY (SULE)
9.3	ASSESSED STRUCTURAL CONDITION
9.4	ECOLOGICAL VALUE OF TREE
9.5	VISUAL AMENITY PROVIDED-PROMINENCE
9.6	RETENTION VALUE WITHIN THE LANDSCAPE
9.7	RISK LEVEL MATRIX- CONSEQUENCES OF EVENT OCCURRING19
9.8	ENVIRONMENTAL ZONE DEFINITIONS
10.0	TREE IDENTIFICATION ASSESSMENT SUMMARY21
11.0	TREE IDENTIFICATION BASED ON PROPOSED DEVELOPMENT LOCATION. 25
12.0	TREES PROPOSED TO BE REMOVED AND MANAGEMENT PLAN26
12.1	TREE 7 STRUCTURAL AND TREE PROTECTION ZONES27
13.0	SITE PHOTOGRAPHS28
14.0	RETENTION OF ADJOINING SITE TREES NUMBERED 1, 5, 6, 7 AND 1033



14.1	SENSITIVE CONSTRUCTION APPROACH FOR ADJOINING TREES	. 34
14.2	MANAGEMENT OF RETAINED TREES	. 35
14.2.2	2 TRENCHLESS TECHNIQUE (BORING)	. 35
14.2.	3 UNDERBORING FOR PIPELINE INSTALLATION	. 35
15.0	PRE-CONSTRUCTION TREE PROTECTION MEASURES	. 36
15.1	APPOINTMENT OF SITE ARBORIST	. 36
15.2	EDUCATION	. 36
15.3	SITE WORKS TREE PROTECTION ZONES	. 36
15.4	TREE PROTECTION FENCING	. 37
15.5	SIGNAGE	. 37
15.6	SILT FENCING, SEDIMENT CONTROL AND SOIL EROSION	. 38
16.0	SITE MANAGEMENT OF RETAINED TREES	. 39
16.1	MATERIALS STORAGE	. 39
16.2	WASTE STORAGE	. 39
17.0	TREE PROTECTION MEASURES FOR CONSTRUCTION PROCESS	. 39
17.1	SITE ACCESS	. 39
17.2	TEMPORARY SERVICES	. 39
17.3	WORKS WITHIN THE TREE PROTECTION ZONE	. 39
17.3.	1 TREE TRUNK PROTECTION WORKS	. 40
17.3.2	2 TREE BRANCH PROTECTION WORKS	. 40
17.3.	3 ROOT PRUNING AND EXCAVATION WORKS	. 40
17.3.4	4 TREE DAMAGE DURING WORKS	.41
17.3.	5 COMPLETION OF WORKS WITHIN TREE PROTECTION ZONE	.41
17.3.	6 MONITORING	.41
17.4	SOIL PROTECTION WORKS	.41
18.0	POST CONSTRUCTION MAINTENAINCE PROCESS	. 42
19.0	CONCLUSION	. 43
20.0	RECOMMENDATIONS	. 44
		4-
	XURE A: PROPOSED DEVELOPMENT LAYOUT	
	XURE B: PROPOSED LANDSCAPE MASTER PLAN	
	XURE C: S.U.L.E- SAFE USEFUL LIFE EXPECTANCY (BARRELL 1995)	
	XURE D: DEFINITION OF TREE TERMINOLOGY	
	XURE E: REFERENCES	
ΔNNF	XIIRE F. CERTIFICATION	60



TABLE OF FIGURES

Figure 1 Shows the location of the study site	7
Figure 2 Shows an aerial location of the study site	7
Figure 3 Shows a diagram of a typical tree root structure	15
Figure 4 Shows a detailed list of trees observed and assessed in relation to	
this application	24
Figure 5 Shows the site trees location based on the development	25
Figure 6 Shows the trees in RED to be removed based on the plans provided	26
Figure 7 Shows Tree 7 TPZ/SRZ that is sufficiently distanced to be protected	27
Figure 8 Shows the site from the street with Trees 2, 3 and 4	28
Figure 9 Shows Trees 3 and small leaf privet hedge to be removed	28
Figure 10 Shows Tree 4 and minor shrubs to be removed	29
Figure 11 Shows Tree 2 a Date palm required to be removed	29
Figure 12 Shows site and adjoining trees 7, 8, 9 and 10 from a distance	<i>30</i>
Figure 13 Shows Tree 7 from a distance	<i>30</i>
Figure 15 Shows Tree 8 with major open wounds, rot and termite damage	31
Figure 16 Shows Tree 8 and 9 lower trunk located at the rear of the site	31
Figure 17 Shows Tree 8 again with major structural weakness and poor trunk	k 32
Figure 18 Shows Trees 8 and 9 trunk from a distance	32



1.0 INTRODUCTION AND BACKGROUND

Horticultural Management Services were engaged to conduct an Arboriculture Assessment Report with particular regard to the Commonwealth Environment Protection and Biodiversity Conservation Act 1999, with reference made to the Office of Environment and Heritage (OEH) (formerly National Parks and Wildlife Services), replaced by the Biodiversity Conservation Act 2016, Biosecurity Act 2015 and Blacktown City Council, Tree Preservation Order (TPO) under the State Environmental Planning Policy (Vegetation in Non-Rural Areas) 2017.

This Arboricultural Impact Assessment was prepared by Horticultural Management Services.

It is understood that this report is to form part of a Development Application for a proposed 12 room Boarding House Development Application, which includes approved tree and shrub removal, demolition of existing dwelling, basement excavations, proposed construction of a new boarding house dwelling and associated landscaping as per Annexure A Proposed Development Layout.

A site investigation was undertaken on Monday 3rd May 2021 to determine the site and adjoining trees overall health, structural integrity and identification of other physical conditions that may be present within the proposed development site, which may be affected by the proposed design.

The purpose of this report is to identify the trees within and or adjoining the development site, provide information on their individual current health and condition, determine their remaining life expectancy and significance in the landscape and assess their suitability for retention/preservation.

The potential impact of the proposed development has also been assessed, together with recommendations for amendments to the design or construction to ensure the retention of tress considered worthy of preservation.

This assessment takes into consideration the ecological qualities of all trees and other significant vegetation on the site and its biotic, ecological, historical, and visual significance.

The scope of this report includes the allocation of SULE ratings (Safe Useful Life Expectancy), identification of arboricultural and recommended work as required.

Information contained in this report covers only the subject trees that were assessed and reflects the condition of the subject trees on site at the time of inspection.



2.0 SITE LOCATION



Figure 1 Shows the location of the study site. Source whereis.com.au

2.1 AERIAL SITE LOCATION



Figure 2 Shows an aerial location of the study site. Source Nearmaps.com



3.0 AIMS

To detail the condition of the trees and consider the location and condition of such in relation to their surrounds.

Provide as an outcome of the assessment, the following:

- Carry out an inspection of the subject trees within and adjacent to the site/s and site conditions,
- Assess the condition of the subject tree(s),
- A description of the trees and other vegetation on the subject site,
- Observations made,
- Discussion on the trees in their current landscape,
- Determine the subject trees' Landscape Significance including cultural, environmental, and aesthetic values,
- Consider the benefits of retention or removal of the trees for the medium to long-term benefit of the trees and on-going public safety,
- Provide recommendations for Tree Management, if or as required, within the context of a development application, and
- Prepare site specific tree protection specifications for trees recommended for retention,

4.0 SITE DESCRIPTION AND PROPOSED DEVELOPMENT

Relevant site plans and or documents were viewed prior to undertaking the Arborist Assessment.

A site plan accompanies this report and identifies all trees located on and or adjoining this proposed development site, which may be impacted upon.

The site is identified as 225 Bungarribee Road, Blacktown NSW.

The site contains a mixture of introduced (planted) exotic and native vegetation observed. The herbaceous or grass vegetation consists of a mixture of introduced pastoral grasses/weed species due to the sites long term residential pursuits.

It is understood that this report is to form part of a Development Application for a proposed 12 room Boarding House Development Application, which includes approved tree and shrub removal, demolition of existing dwelling, basement excavations, proposed construction of a new boarding house dwelling and associated landscaping as per Annexure A Proposed Development Layout.



5.0 METHODOLOGY

This report was determined as a result of a comprehensive site inspection undertaken on Monday 3rd May 2021. The subject trees were inspected by Horticultural Management Services (HMS).

The comments and recommendations in this report are based on findings from this site inspection. Each tree has been provided with identification number for reference purposed denoted on the attached tree location plan and correlating with the Tree Assessment Schedule and as discussed within the report.

The method of assessment applied to the proposed development site is adapted from the principles developed by the Local Government Tree Resources Association (LGTRA). This recognised form of assessment considers the trees health/condition and subsequent stability, both in the long and short term at the time of the assessment and including but not limited to;

- Species identification (botanical and common),
- Height and form,
- Observations made including an evaluation of the tree's health and vigour using Crown spread and cover, foliage size, colour, extension growth, presence of disease or pest infestation, canopy density, presence of deadwood, dieback and epicormic growth as indicators,
- Condition, using visible evidence of structural defects, instability, evidence of previous pruning and physical damage as indicators,
- Suitability of the tree to the site and its existing location; in consideration of damage or potential damage to services or structures, available space for future development and nuisance issues,
- Likely future amenity based on a visual assessment,
- The trees tolerance to development impacts based on surface observations,
- Significance -specific heritage, cultural or intrinsic importance,
- Amenity value -as shade, windbreak etc or subjective, aesthetic values,
- Habitat value -both as an individual tree and as part of an ecological community,
- Observations of soil conditions and likely root spread,
- Overall condition assessment and suitability.
- Hazard/failure potential of tree to damage property or result in death,
- Safe Useful Life Expectancy (SULE) after Barrell (1995),

Retention Value, was based on the subject tree's Remaining Life Expectancy Range and Landscape Significance. The Retention Value was modified where necessary to take in consideration the subject tree's health, structure, and site suitability.

Landscape Significance, was determined by assessing the combination of the cultural, environmental, and aesthetic values of the subject trees. Whilst these values are subjective, a rating of high, moderate, low, or insignificant has been allocated to the trees. This provides a relative value of the trees' Landscape Significance which may aid in determining their Retention Value. A more detailed explanation is outlined in Section 5.3 Landscape Significance.

Tree height and canopy spread, were estimated only. Diameter at Breast Height (DBH) was determined by measuring the main stem at 1.4m above ground. Photos were taken of the subject trees and subject site for the inclusion in this tabled report.

The components of **tree risk assessment** include the trees failure potential or in the case of the proposed, an environment conductive to tree failure.



5.1 VISUAL TREE ASSESSMENT

The inspection was limited to a visual examination of the subject trees from ground level.

This assessment process is used to determine the sustainability of each tree in the landscape. The assessment of each tree was made using Visual Tree Assessment (VTA).

All trees were assessed from the ground without dissection, probing or coring. No woody tissue testing was undertaken as part of this assessment.

Destructive, resistance testing, or aerial inspections have not been undertaken as part of this assessment. The health of the trees was determined by assessing the following:

- a) Foliage size and colour,
- b) Pest and disease infestation noted,
- c) Extension growth,
- d) Canopy density and form,
- e) Percentage of deadwood noted/observed,
- f) Presence of epicormic growth observed,
- g) Visible evidence of structural defects or instability,
- h) Evidence of previous pruning or physical damage,
- i) Observations made including an evaluation of the tree's health and vigour using Crown spread and cover, foliage size, colour, extension growth, presence of disease or pest infestation, canopy density, presence of deadwood, dieback and epicormic growth as indicators,
- j) Condition, using visible evidence of structural defects, instability, evidence of previous pruning and physical damage as indicators,
- Suitability of the tree to the site and its existing location; in consideration of damage or potential damage to services or structures, available space for future development and nuisance issues,

5.2 HERITAGE SIGNIFICANCE

There are no trees within the site that have been identified as Heritage Items under Council Planning Instrument or identified within a Significant Tree Register.



5.3 LANDSCAPE SIGNIFICANCE

The sites **Landscape Significance** was determined by assessing the combination of the cultural, environmental, and aesthetic values of the subject trees.

Whilst these values are subjective, a rating of **high, moderate, low, or insignificant** has been allocated to the trees.

This provides a relative value of the trees' Landscape Significance which may aid in determining their overall retention value. Generally, the following criteria have been used to determine the Landscape Significance of the subject trees.

LANDSCAPE SIGNIFICANCE	DESCRIPTION								
	The subject tree is listed as a Heritage Item under the <i>Local</i>								
	Environmental Plan with a local or state level of significance.								
	The subject tree forms part of the curtilage of a heritage item.								
	The subject tree creates a 'sense of place' or is considered								
	'landmark' tree.								
	The subject tree is of local, cultural, or historical importance or is								
	widely known.								
HIGH	The subject tree is listed on Council's Significance Tree Register.								
	The subject tree is scheduled as a Threatened Species or								
	Threatened Plant Community under replaced by the Biodiversity								
	Conservation Act (2016)								
	The subject tree is a remnant tree.								
	The subject tree is a locally indigenous species and is								
	representative of the original vegetation of the area.								
	The subject tree provides habitat to a threatened species.								
	The subject tree is an excellent representative of the species in								
	terms of aesthetic value.								
	The subject tree makes a positive contribution to the visual								
	character or amenity of the area.								
1500000400	The subject tree provides a specific function such as screening or								
MODERATE	minimising the scale of a building.								
	The subject tree has a known habitat value.								
	The subject tree is a good representative of the species in terms of								
	aesthetic value.								
	The subject tree is an environmental pest species or is exempt								
	under the provisions of the local Council's Tree Preservation Order.								
LOW	The subject tree makes little or no contribution to the amenity of the locality.								
	The subject tree is a poor representative of the species in terms of								
	aesthetic value.								
INSIGNIFICANT	The subject tree is declared a Noxious Weed under the Biosecurity Act (2015)								

^{*}NOTE: If the tree can be categorised into more than one value, the higher value should be allocated.



5.4 TREES ON ADJOINING LAND

In accordance with Council's requirements, trees adjoining the development have been assessed as part of this report.

There are no trees on adjoining properties that will be affected by this development.

5.5 IMPACT ASSESSMENT

A summary of each tree identified within the study site is outlined in section 10.0 Assessment of Existing Trees Identified on Site.

The assessment in each case has considered the following issues;

- Structural Root Zones (SRZ),
- Building works or footprint within TPZ or SRZ,
- Optimum Tree Protection Zones (TPZ) and Structural Root Zones (SRZ),
- SULE Rating for value of the tree assessed,
- Assessment of the likely impact of the proposed works,
- Recommendations for retention, management, or removal,

Changing the drainage patterns around a tree by constructing a building, driveways, road, and paths etc will alter the amount of water the tree receives and may cause root death or damage. Trenches dug beside or adjoining large trees for water, sewer or services may also damage the roots and will make a tree unstable.

Older trees will tolerate far less stress than younger trees as with age they become less responsive and find it very strenuous to respond to changes in their environment.

The components of tree risk assessment include the trees failure potential or in the case of land clearing/management, an environment conductive to tree failure.

Other factors are also considered related to the site, such as potential development or land use, soil condition and prevailing winds must be considered in conjunction when assessing the potential of failure for any tree.



6.0 PRUNING/REMOVAL STANDARDS

Any pruning recommended in this report is to be to the Australian Standard® AS4373 'Pruning of Amenity Trees', Amenity Tree Industry "Code of Practise 1998 and conducted in accordance with the NSW Work Cover Authority Code of Practice for Tree Work 2007.

All pruning, or removal works are to be in accordance with the appropriate Tree Management Policy where applicable, or Tree Management Order (TMO), or Tree Preservation Order (TPO) and applicable consent conditions.

Tree maintenance work is specialised and in order to be undertaken safely and to ensure the works carried out are not detrimental to the survival of the tree or surrounding vegetation, all works should be undertaken by a qualified Arborist with appropriate competencies recognised within the Australian Qualification frame work, with a minimum of 5 years of continual experience within the industry of operational amenity arboriculture, and covered by appropriate and current types of insurance to undertake such works.

Any pruning near electricity wires should be undertaken in accordance with relative Electrical Safety Rules and be performed by persons individually authorised by Energy Australia with a "Work Near Overhead Power Lines" Certificate to undertake this scope of works.

7.0 TREE PROTECTION ZONES AND ROOT SYSTEM

On average the tree's roots will extend to the outer reaches of their canopies, depending on morphology and disposition of the individual trees' roots, when known to be influenced by past or existing site conditions including but not limited to;

- The individual tree species,
- Soil type, structure, and location,
- Topography and existing drainage,
- Location of either manmade hard structures, or environment,
- Pruning requirements, if required,

These roots have two major functions, which are to obtain water and minerals from the soil and to give anchorage support to the tree.

This area is known as the Tree Protection Zone (TPZ), this is a designated area around tree where optimum protection and preservation efforts are implemented.

No disturbance should occur within this area. It is calculated by using a formula that considers the tolerance level of the species to disturbance, its age class, and its condition and trunk diameter.

The main area for surface feeding roots to occur is from the tree trunk to the outer canopy known as the drip zone. These fibrous roots are less likely to occur under or near other buildings, as there is little surface moisture or soil air presence for root survival. These fibrous roots are those that take up water and nutrients.

While some tree roots will deeply penetrate the soil profile, in search of available water, most will occupy the first 60-70cm of the soil, as to obtain the needed sustenance. At times, it will not be possible to retain the optimum TPZ around each tree and any activities proposed within this area must be carefully analysed to minimise any effects on its health and/or stability.



The actual spread of the root system is largely dependent on the species involved, and their localised environment. Any work carried out within the TPZ should be reviewed and supervised by an appropriately qualified Arborist.

Construction works proposed to be undertaken around the trees if not correctly assessed may modify the natural water table and reduce the amount of soil air and moisture present/available to the trees and their longevity may be greatly diminished.

If under the course of construction, the tree roots are damaged or adversely affected, their demise will cause drought stress; poor uptake of water and nutrients, slower dispersal of gums and resins and could, in the long term, influence the movement of certain compounds which make up the structure of the tree.

8.0 TREE PROTECTION ZONE

A Tree Protection Zone (TPZ) is a radial distance measured from the centre of the trunk of the tree. The intention of the TPZ is to minimise incursions to the root system and canopy to ensure the long-term health and stability of the tree.

A commonly used delineation for the TPZ is the dripline (extent of the crown spread projected to the ground plane). However, this may not provide adequate protection for trees that have prominent leans or distorted imbalanced or narrow crowns. A more appropriate guideline is the trunk diameter.

The Tree trunk measurement is recorded and known as the Diameter at Breast Height (DBH) at 1.4 metres from ground level using a metric tape measure. The TPZ area is then calculated by X 12, another formula is then applied for the trees Structural Root Zone (SRZ) if the development is proposed to encroach into the TPZ.

Other factors included within the TPZ are the individual tree species, soil type, location, and proposed scope of works.

The above criteria also consider the following elements;

- The trunk diameter,
- The sensitivity/tolerance of the species to construction impacts,
- The level of maturity,
- The health, vigour, and structural integrity of the tree,
- The tree's root and crown formation,

Construction Tolerance considers the following elements,

- Good Good tolerance to construction impacts,
- Moderate Moderate tolerance to construction impacts,
- Poor- Poor tolerance to construction impacts,

Maturity class of the tree considers the following elements,

- Over-mature Greater than 80% of the life expectancy for the species,
- Mature Greater than 50 80% of the life expectancy for the species,
- Immature Less than 20% of the life expectancy for the species,



8.1 NORMAL STRUCTURAL ROOT FORM OF A TREE

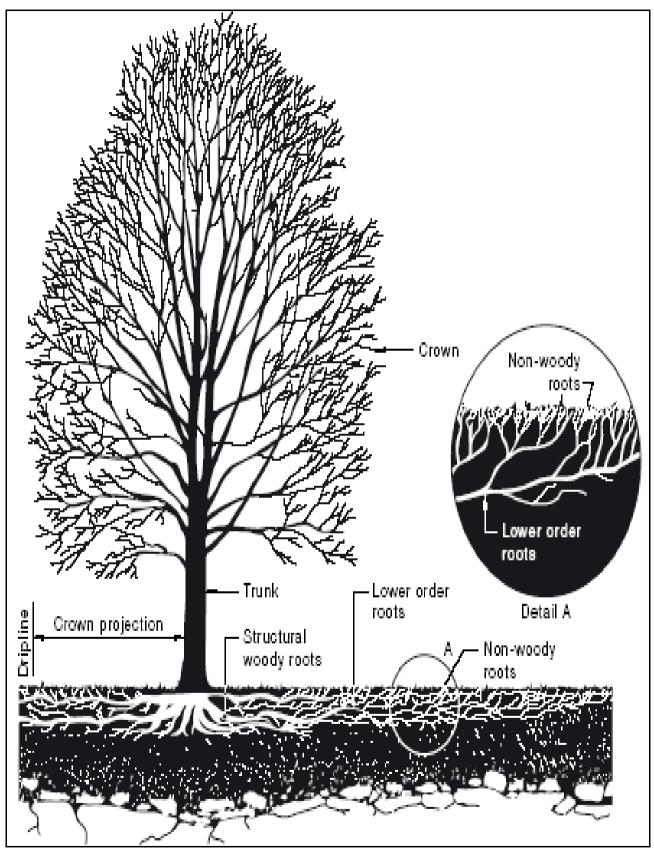


Figure 3 Shows a diagram of a typical tree root structure. Source: Australian Standards - AS 4970-2009 Protection of trees on development sites.



8.2 TYPES OF TREE ROOTS

The tree's root system develops in accordance with its pre-determined, height, soil conditions (availability of water and nutrients) and location of the root systems in response to the need to support the tree.

Unless conditions are uniform around the tree, which would be highly unusual, the extent of the root-systems can be irregular and difficult to predict. As tree roots are very opportunistic, they will not generally show the symmetry seen in the aerial parts.

The majority of the root system is in the surface 600mm to 700mm, extending radially for distances which are frequently in excess of the tree height.

8.3 ROOT PLATE

This forms the main structural woody roots which provides overall anchorage for the tree. It is this central part of the root-system (large root mass with sub-soil normally attached) which may tilt over or rotates in storm events.

8.4 WOODY ROOTS

Beyond the root plate the root system rapidly subdivides into smaller diameter woody roots (hydrotropic) which conduct water and nutrients from the non-woody roots.

8.5 NON-WOODY ROOTS

Off the smaller diameter woody root system, a mass of non-woody, fine feeder roots system develops. These are the roots which are active in water and nutrient uptake, are fine in structure, typically less than 0.5mm diameter, and include mycrorrhizal associations with some soil fungi. They are short lived, growing in response to the needs of the tree, with the majority dieing back each winter.

Conditions should be conductive for maintaining the growth of these non-woody roots to provide for the water and nutrient requirements of the tree.

Non-woody roots are vulnerable to damage, and once it occurs, water and nutrient uptake will be restricted until new ones are produced. Vigorous young trees will be capable of rapid regeneration, but more mature to over mature trees will respond slowly, if at all.

Any root damage and or demise may cause some drought stress; poor uptake of water and nutrients, slower dispersal of gums and resins and could, in the long term, influence the movement of certain compounds which make up the structure of the tree, resulting in the slow decline to death of the trees.



9.0 DEFINITION OF ASSESSED HEALTH AND CONDITION OF TREE

The condition of each tree has been related in overall terms as one of the following headings and information is presented in section 11.0 Assessment of Existing Trees Identified on Site.

Good, the tree is generally healthy, vigorous, and free from the presence of major disease, obvious structural weaknesses, and fungal or insect infestation and is expected to continue to live in the same condition as at the time of the inspection. Only small recommendations may be required to help continue the trees longevity.

Fair, the tree is generally vigorous but has some indication of decline due to the early effects of disease, fungal or insect infestation, or has been affected by physical (storm damage) or mechanical damage (Vandalism or involved in an accident by a vehicle) or is faltering due to the modification of the tree's environment essential for its survival.

This tree group may recover with remedial work undertaken by a Qualified Arborist where appropriate or without intervention and may regain some vigour and stabilise over time. Medium recommendations are required to bring this tree up to a satisfactory standard.

Poor, the tree is exhibiting symptoms of advanced and irreversible decline due to factors such as fungal infestation, termite damage, ring barking of the tree's trunk due to borer infestation, major die-back in branches and the foliage is thinning in the crown due to various effects, epicormic growth is present throughout the inner canopy while the tree is using up its stored sugar and is in a state of stress.

This tree group will decline further to death over a period of time regardless of remedial works or modifications undertaken.

Dead, the tree is no longer alive and is in poor structural condition, that may cause damage to people or property and removal is strongly recommended.

9.1 TREE AGE CLASS TERMINOLOGY

The following maturity class have been allocated to each tree and considers the following elements,

Juvenile: Less than 20% of the life expectancy for the species, Semi-mature: Middle age trees, 20% to 50% of life expectancy,

Mature: Greater than 50 - 80% of the life expectancy for the species, **Over-mature:** Greater than 80% of the life expectancy for the species, senescent

tree, or those declining irreversibly to death,

9.2 SAFE USEFUL LIFE EXPECTANCY (SULE)

The remaining Safe Useful Life Expectancy of a tree is an estimate of the sustainability of the tree within the site/landscape, calculated based on an estimate of the average age of the species in an urban area, compared with its estimated current age.

The estimated SULE of each tree is discussed with the following values;

- Greater than 40 years (Long),
- Between 15 and 40 years (Medium),
- Between 5 and 15 years (Short),
- Less than 5 years,
- Dead or hazardous,



9.3 ASSESSED STRUCTURAL CONDITION

This refers to the tree's form and growth habit modified by its environment, the state of the trunk and main structural branches.

It includes the presence of defects as decay, weak branch junctions and other visible abnormalities. Although some trees without defects fail in major storms, the presence of any defect will increase the chances of failure.

Good; Trees with a single dominant trunk along which evenly spaced

branches are spread. Branches have properly formed collars which provide strong attachment to the trunk and are about 25% of the trunk diameter. Minor structural defects may be present with low

failure potentials.

Average; Trees with structural defects with low failure potential.

Fair; Trees with structural defects with medium failure potentials and

require monitoring on an annual basis.

Poor; Trees with defects which have failed, or have a high risk of failing

soon, and corrective action must be taken soon as possible.

9.4 ECOLOGICAL VALUE OF TREE

These categories are based upon the criteria used in the Thyer Tree Valuation Method (1996) to evaluate a tree's ecological benefit.

0. None Weed species

1. Low Restricts desirable plants or of little benefit to fauna.

2. Medium Beneficial to flora & fauna provides food source and/or shelter.

3. High Remnant /indigenous species of native vegetation.

4. Very High Indigenous species being an integral part of a natural ecosystem.

9.5 VISUAL AMENITY PROVIDED-PROMINENCE

Criteria for the assessment of amenity values are based upon the criteria used in the Thyer Tree Valuation Method (1996) to evaluate a tree's visibility in the local area.

The amenity value of a tree is a measure of its visibility, its overall position within the site, its contribution to the visual amenity and character of the area, its living crown size/spread, visual appearance including natural form/habit and crown density percentage.

As a rule, a prominent (location) larger and significant subject tree, with good form, habit, density etc will achieve a higher amenity value.

0. None Seldom/rarely seen (remote location).

Low Seen frequently by private owners or adjacent residents.
 Medium Seen by neighbourhood residents and or passers-by.

3. High Known locally or seen by many passers-by.

4. Very High Of local historical importance or known widely.



9.6 RETENTION VALUE WITHIN THE LANDSCAPE

The Retention Values of the trees have been determined on the basis of the estimated longevity of the individual tree with consideration of its landscape significance rating. Together with recommendations contained within this report the information should be used to determine the most appropriate action for protection, retention of trees considered worthy of preservation and or removal.

Retention Value Rating		Landscape/Environmental Significance										
Estimated Life Expectancy	1- Very High	2- Very High to High	3- High to Moderate	4 - Moderate	5- Moderate to Low	6- Low	7- Nil					
HIGH – (H) Greater than 40 Years	High Retention Value											
MEDIUM - (M) 15 to 40 Years			Moderate Retention Value									
LOW – (L) 5 to 15 years				Low Retention Value								
Less than 5 Years												
Dead or Hazardous												

Table 2 Landscape Significance Value

9.7 RISK LEVEL MATRIX- CONSEQUENCES OF EVENT OCCURRING

Occupational Health and Safety Legislation places a "Duty of Care" on individuals and companies to ensure potential hazards and risks regarding tree management are eliminated as best as possible and develop controls for long term tree management.

Whilst a trees overall health may be hard to determine to a "Lay or Common person" there are some visible signs that may flag potential safety concerns including but not limited to; Limb shedding, poor canopy and foliage colour, major deadwood or die-back of out limbs etc.

The Risk Matrix table below involves determining the potential risk verses the probable consequence of exposure to the hazard and the likelihood of the event occurring.

RISK	RISK LEVEL MATRIX - CONSEQUENCES OF EVENT OCCURRING										
LIKELIHOOD	Catastrophic (Fatality)	Major (Serious Injury)	Moderate (Medical treatment)	Minor (First Aid)	Insignificant (No Injury)						
Almost Certain	E 25	E 23	E 20	Н 16	H 11						
Likely	E 24	E 21	H 17	H 12	М 7						
Possible	E 22	E 18	H 13	M 8	L 4						
Unlikely	E 19	H 14	М 9	L 5	L 2						
Rare	H 15	H 10	М 6	L 3	L 1						

Table 3 RISK LEVEL MATRIX

Risk Levels are; E = Extreme (18 to 25) – Act Now

H = High(12 to 17) - ASAP

M = Moderate (7 to 11) – Plan, and

L = Low Risk (1 to 6) – Review/assess tree annually



9.8 ENVIRONMENTAL ZONE DEFINITIONS

1. Landscaped: Ornamental gardens including managed open lawns,

tree/shrub planting.

2. Remnant: Remnant vegetation significant to a local ecological community

but managed with hard scaped areas ie. paved areas,

driveways,

3. Natural Bushland: Natural bushland vegetation significant to local and broader

ecological Vegetation communities and or identified under the Threatened Species Conservation Act 1995. Natural Bushland can then be defined further subject to ground truthing into the

following sub-sections.

a) Good. High-quality vegetation and habitat values,

b) Medium. Good quality vegetation with some introduced weed

species, and

c) Poor. Low-quality remnant vegetation, high-level weed

infestation (and range of weed species), erosion, limited native habitat, requires site specific

Vegetation Management Plan.

4. Mapped Environmental Constraint Areas:

As per Council mapping eg. Slope constraint (> 180), watercourse buffer, sensitive vegetation buffer, Flora/Fauna

significant/buffer as identified on site.



10.0 TREE IDENTIFICATION ASSESSMENT SUMMARY

Risk	Catastrophic	Major	Moderate	Low
<u>Matrix</u>	Urgent- Tree requires immediate removal due to WH&S concerns.	development application.	TPO Exempt due to species, height requirements and or approved to be removed by Council.	

Tree Number	Tree Species Common Name Botanical name	Height (m)	DBH @ 1.4m	DAB (mm)	SRZ Required (m)	TPZ Rec	* Semi Mature * Mature * Over Mature	* Good * Fair * Poor * Dead	Tree Structure * Good * Fair * Poor	ng	* High * Medium * Low * Nil	* Moderate	* H 40yrs + * M 15 - 40yrs * L 5 to 15ys * Nil Less 5ys * Dead	Arborist Comments
1.	Chinese Tallowwood Sapium sebiferum Adjoining tree	3			1.5		Mature	Good	Good	3	Nil	Nil	Nil	Based on AS4970-2009 Protection of Trees on Development Sites, this adjoining tree is sufficiently distanced to be retained and protected with no new works within its TPZ.
2.	Canary Island Date Palm Phoenix canariensis	8	650	700	N/A	N/A	Mature	Good	Good	3	Nil	Low	Low	This palm tree is required to be removed as it is located within the proposed new basement excavation and driveway area, it will be replaced in landscape upon completion.



3.	Monterey cypress Cupressus macrocarpa Brunniana Aurea			290			Mature	Good	Good	5	Nil	Low	Low	This minor conifer is required to be removed as it is located within the proposed new basement excavation and driveway area, it will be replaced in landscape upon completion.
4.	Monterey cypress Cupressus macrocarpa Brunniana Aurea	3.5	M/T	290	2.5	6	Mature	Good	Good	5	Nil	Low	Low	This minor conifer is required to be removed as it is located within the proposed new basement excavation and driveway area, it will be replaced in landscape upon completion.
5.	Cocos Palm Syagrus romanzoffiana Adjoining tree	5		250			Mature	Good	Good	3B	Nil	Nil	Nil	Based on AS4970-2009 Protection of Trees on Development Sites, this adjoining palm tree is sufficiently distanced to be retained and protected with no new works within its TPZ.
6.	Weeping Bottlebrush Callistemon viminalis Adjoining tree	5	М/Т	260	2	3.2	Mature	Good to Fair	Good to Fair	3	Nil to Low	Nil to Low	Nil	Based on AS4970-2009 Protection of Trees on Development Sites, this adjoining tree is sufficiently distanced to be retained and protected with no new works within its TPZ.



7.	Grey Gum Eucalyptus moluccana	14	800	920	3.2	9.6	Mature	Good to Fair	Fair	3	Medium	Moderate	Medium	Based on AS4970-2009 Protection of Trees on Development Sites, this site tree is sufficiently distanced to be retained and protected with no works within its SRZ TPZ with minor works being less than 10% within its TPZ.
8.	Grey Gum Eucalyptus moluccana	14	750	800	3.1	9	Mature	Good to Fair	Fair	4C	Medium	Moderate	Medium	This site tree is sufficiently distanced to be safely retained and protected from the proposed development and scope of works; however, it is recommended to be removed due to its noted declining health, poor structural faults and significant open wounds with termites, borers and rot. It is recommended to be removed and replaced in the landscape upon completion with an advanced tree.



9.	Grey Gum Eucalyptus moluccana	14	480 550	800	N/A	N/A	Mature	Good to Fair	Fair	4C	Medium	Moderate	Medium	This suppressed tree is sufficiently distanced to be safely retained and protected from the proposed development and scope of works; however, it is recommended to be removed due to its declining health and condition. The removal of Tre 8 will modify this trees form and stability, hence removal is supported. It is recommended to be removed and replaced in the landscape upon completion with an advanced tree.
10.	Grey Gum Eucalyptus moluccana	14	480 550		N/A	N/A	Mature	Good to Fair	Fair	4C	Medium	Moderate	Medium	Based on AS4970-2009 Protection of Trees on Development Sites, this adjoining tree is sufficiently distanced to be retained and protected with no new works within its TPZ. However, its removal is recommended due to structural faults and crack near the branch/trunk union.

Key. Multi trunk (M/T)

Figure 4 Shows a list of trees observed and assessed in relation to this application by a Qualified Horticulturist and AQF Level 5 Arborist (Dip Arb).



11.0 TREE IDENTIFICATION BASED ON PROPOSED DEVELOPMENT LOCATION

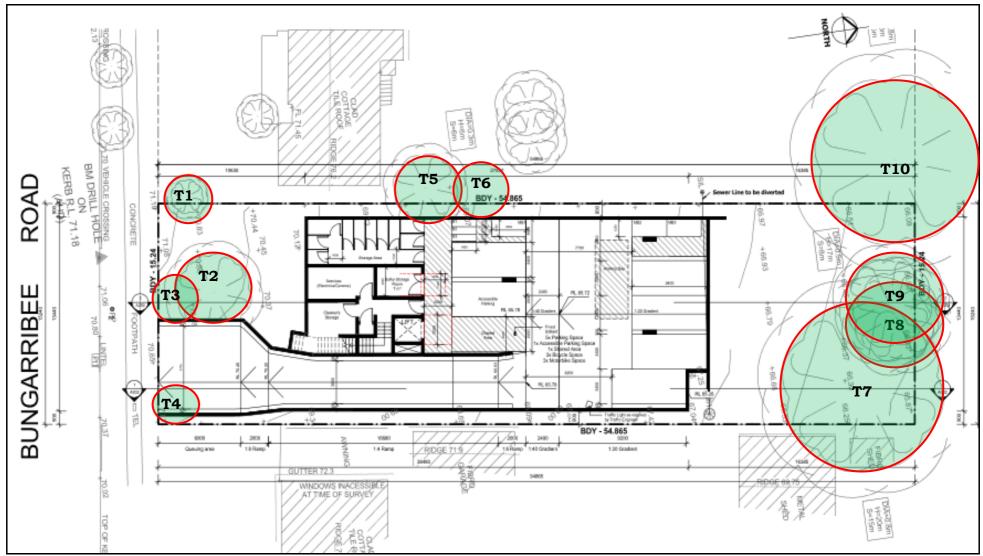


Figure 5 Shows the site trees location based on the proposed basement development layout.



12.0 TREES PROPOSED TO BE REMOVED BASED ON DEVELOPMENT AND MANAGEMENT

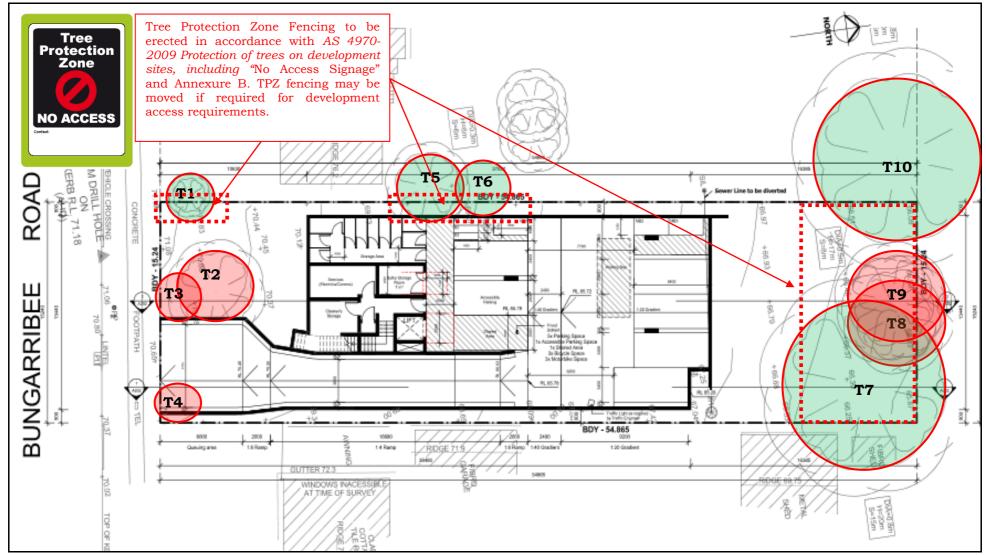


Figure 6 Shows the trees in RED to be removed and management plans for site and adjoining trees.



12.1 TREE 7 STRUCTURAL AND TREE PROTECTION ZONES BASED ON DEVELOPMENT LOCATION

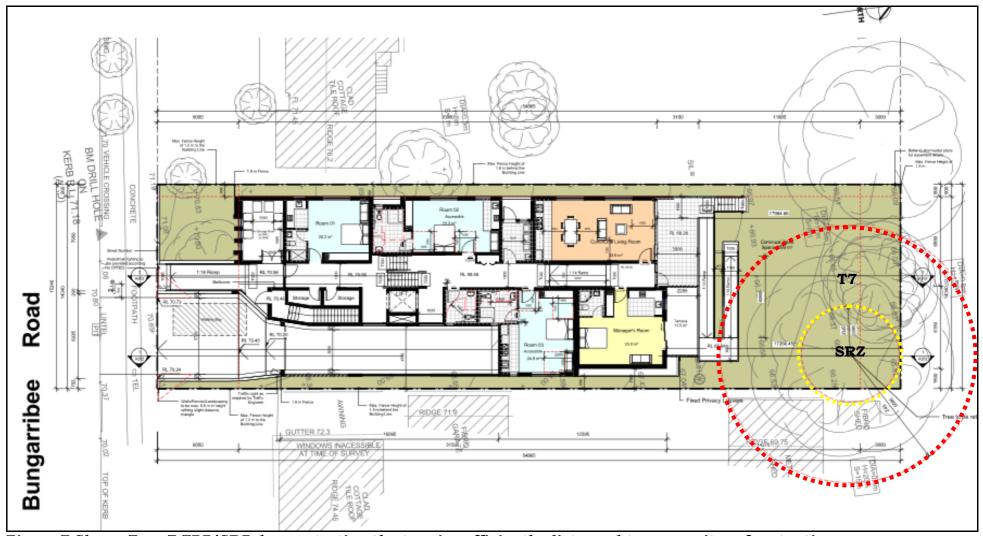


Figure 7 Shows Tree 7 TPZ/SRZ demonstrating the tree is sufficiently distanced to ensure its safe retention.



27



Figure 8 Shows the site from the street with Trees 2, 3 and 4.



Figure 9 Shows Trees 3 and small leaf privet hedge to be removed.





Figure 10 Shows Tree 4 and minor shrubs to be removed.



Figure 11 Shows Tree 2 a Date palm required to be removed.





Figure 12 Shows site and adjoining trees 7, 8, 9 and 10 from a distance.



Figure 13 Shows Tree 7 from a distance that is to be retained, protected and monitored.





Figure 14 Shows Tree 8 with major open wounds, rot and termite damage.



Figure 15 Shows Tree 8 and 9 lower trunks located at the rear of the site.





Figure 16 Shows Tree 8 again with major structural weakness and poor trunk.



Figure 17 Shows Trees 8 and 9 trunks from a distance.



14.0 RETENTION OF ADJOINING SITE TREES NUMBERED 1, 5, 6, 7 AND 10 (General Conditions).

The following points may be considered for the long-term retention of trees as listed in Section 12.0 Assessment of Existing Trees Identified on Site, not affected by this proposed development under this application.

- Avoid large changes to the surface structure due to modification of the tree's moisture / surface feeding roots,
- A Qualified Arborist/Horticulturalist undertakes all Arboricultural works,
- All trenching near the trees as required is to be hand dug to ensure minimal disturbance to additional surface feeding roots,
- Any tree roots discovered are cut cleanly with root pruning devices,
- Vertical deep watering points for stressed mature trees if or as required,
- Air-knife treatments, to alleviate soil compaction where trees are suffering stress, and to inspect tree root structures and growth patterns,
- Any proposed work located near the trunk or outer canopy of the trees drip line, where services are known to be in the vicinity, any excavation for services should be hand dug to ensure minimal impact to the trees surface feeding and support roots,
- Any tree roots that are exposed will be removed by approved Arboricultural techniques and have a root hormone ie. Formula 20® or equivalent applied at the manufacture's specification,
- Any trenches undertaken near tree drip zones will be backfilled and compacted with an approved Australian Standard orchid mix 60/40 containing washed river sand and peat moss to a minimum depth of 700mm, the remaining soil profile is to be filled with an approved topsoil to meet the existing soil surface,
- No building waste is to be disposed of/or stored near the tree trunk or drip zone,
- To ameliorate impact of any development, advanced plants may be used in the Landscape Master Plan,
- Plantings should take into consideration the high priority of the streetscape and visual amenity.
- Any vegetation removed during the development is not mulched and used in landscaping due to the high levels of weed infestation on the site and the likelihood that seeds, and viable cuttings may be spread throughout the development,
- To ameliorate impact of any development, standard erosion and sediment controls are recommended,
- The trees drip line/zone is to be mulched to the Horticultural standard of 75mm,
- Regular watering is to be undertaken in hot dry periods to alleviate any short-term stress or loss of available water,
- Erection of a chain mesh safety fence be installed to ensure the protection of Trees Critical Root Zone as per Annexure B,
- A qualified Arborist should monitor these trees over a twelve (12) month period to evaluate the trees recovery and provide technical information to Council as required.



14.1 SENSITIVE CONSTRUCTION APPROACH FOR ADJOINING TREES

Where works are unavoidable within the Tree Protection Zone (TPZ) and or Structural Root Zone (SRZ) of trees to be retained, the following should be considered, but not limited to;

- Minimise the direct and indirect impacts to tree roots and soil such as root severance or damage, soil excavation, compaction, and contamination,
- Allow for the free movement of water and oxygen within the soil of the TPZ,
- Allow for future rooting area adjacent to the TPZ,

Where the placement of footings within the SRZ cannot be avoided, root sensitive footing systems should be considered. Footing systems such as pier and beam, screw pile, waffle slab or cantilevered have the potential to reduce the impact on trees by retaining sections of soil and roots between the piers.

To achieve the most benefit from this type of construction, the following is recommended;

- Discontinuous footings should be used within the SRZ of the subject tree. (Standard footing design could be used outside this area),
- All beams should be above the natural soil grade/surface,
- The footing design should allow for the greatest achievable span between Piers (as per engineer's specifications/advice),
- Piers should not be placed within the Root Plate Radius of the subject tree,
- Foundations for the proposed piers should be initially hand dug to a depth of 500mm or to rock. If any roots are found that are greater than 40mmø, the pier position should be relocated, subject to engineer's advice,
- The proposed excavations should not result in the severance of roots greater than 40mmø,
- Care should be taken to avoid soil compaction between piers and any drilling machinery should remain outside the Tree Protection Zone. If access within the Tree Protection Zone by machinery cannot be avoided, appropriate compaction control methods should be used.
- Consider the type of equipment that will be used to drill holes for the piers and the clearance/tolerance requirement under the subject tree's canopy,
- These construction methods may require the implementation of postconstruction maintenance such as irrigation and mulching. This would assist in minimising the potential impacts on tree health by providing favourable environment conditions for continued root growth and development.

Where achievable, pedestrian / vehicular access ways should be constructed of a semipermeable material (as listed above) and placed above grade to minimize the need for excavation. The strength of the pavement shall be selected to reduce the reliance on sub-base for strength.

Where appropriate, hand excavation and root pruning should be undertaken along the length of excavations adjacent to SRZs prior to any machine construction work. Major roots (greater than 40mmø) should not be severed or damaged. Minor roots (less than 40mmø) to be pruned should be cleanly severed.



14.2 MANAGEMENT OF RETAINED TREES

14.2.1. TRENCHING

Trenching may cause damage, die-back, structural integrity issues, collapse of the structure or even death to a tree over a period of time due to long term modifications to the site and the trees natural topography and this tree is valuable to the visual landscape amenity.

14.2.2 TRENCHLESS TECHNIQUE (BORING)

Trenchless techniques provide an alternative option for the safe retention and protection of a valuable natural asset for required service infrastructure. Consideration of directional boring, pipe jacking, impact moling and boring will reduce the potential impact to a trees natural environment and retain the sites visual amenity.

These options mentioned are reliable and have been long used to ensure the retention of significant existing vegetation.

Areas of landscape or grass disturbed during these works will be reinstated with the same variety of plants or lawn removed to a condition that would meet Horticultural current best practices.

14.2.3 UNDERBORING FOR PIPELINE INSTALLATION

Where underboring will pass within a tree's root structure consideration of the trees Tree Protection Zone (TPZ) and Structural Root Zone (SRZ) is required. The minimum depth for boring is considered to be around 800mm which is the depth from the existing soil level that the majority of anchorage and feeder root will be encountered.

Where underboring or trenching is adjacent to or within a trees TPZ the site/project Arborist is to be contacted at least three-(3) days prior to any works commencing to arrange and undertake a site inspection with recommendations for tree retention and protection.

Underboring is considered the preferred option for installation of services within close proximity to signification trees. Manual hand digging, or the use of high-pressure water and vacuum truck may be required if works are within the SRZ to ensure the trees anchorage system and overall health is not compromised.



15.0 PRE-CONSTRUCTION TREE PROTECTION MEASURES

15.1 APPOINTMENT OF SITE ARBORIST

A Site Arborist shall be appointed prior the commencement of all works on- site.

The Site Arborist shall monitor the trees to be retained and supervise the tree protection measures. The Site Arborist shall have a minimum qualification equivalent (using the Australian Qualifications Framework) of NSW TAFE Certificate Level 5 or above in Arboriculture. An allowance of Five-(5) working days' notice to allow inspections to be undertaken at the following stages would be considered standard practice.

INSPECTION/HOLD POINT	INSPECTION PERSONNEL
Identification of retained trees and installation of tree protection zone including protection fencing, silt fencing and appropriate signage.	Site Arborist to undertake with Site Supervisor.
Modification of the Tree Protection Zone if or as required.	Site Arborist to undertake with Site Supervisor.
Works within the Tree Protection Zone if or as required.	Site Arborist to undertake with Site Supervisor.
Completion of the construction works (Post Construction) and final inspection/sign off.	Site Arborist to undertake with Site Supervisor.

15.2 EDUCATION

The project development applicant, contractors and site workers shall receive a copy of the final/Council approved Arborist Assessment and specifications with a minimum of 3 working days prior to commencing work on-site.

Contractors and site workers undertaking works within the Tree Protection Zones shall sign the site log confirming they have read and understand these specifications, prior to undertaking works on-site.

15.3 SITE WORKS TREE PROTECTION ZONES

The trees identified to be retained shall be protected prior to and during the construction process from activities that may result in an adverse effect on its health, structure, or longevity.

The area within the Tree Protection Zone shall exclude the following activities, unless otherwise stated and or approved by Council/Consent Authority;

Modification of existing soil levels, Excavations and trenching, Cultivation of the soil, Mechanical removal of vegetation, Soil disturbance, Movement of natural rock, Storage of materials, plant, or equipment, Erection of site sheds, Affixing of signage or hoarding to the tree,
Preparation of building materials,
Disposal of waste materials and chemicals,
Movement of pedestrian or vehicular traffic,
Temporary or permanent location of services,



15.4 TREE PROTECTION FENCING

Tree Protection Fencing shall be installed at the perimeter of the Tree Protection Zone as specified.

As a minimum, the Tree Protection Fence shall consist of 1.8m high temporary chain wire panels supported by steel poles/stakes. They shall be fastened together and supported to prevent sideways movement. The fence must have a lockable opening for access. The tree's woody roots shall not be damaged during the installation of the Tree Protection Fencing.

Shade cloth material shall be attached to the outer surface of the Tree Protection Fence. The shade cloth material shall be transparent to provide visibility into the Tree Protection Zone.

The Tree Protection Fence shall be erected prior to the commencement of works onsite and shall be maintained in good condition for the duration of the development period.

The Tree Protection Fence shall only be removed, altered, or relocated with the authorization from the Site Arborist in consultation with the Site Supervisor.

15.5 SIGNAGE

Tree Protection Signage shall be attached to the Tree Protection Zone and displayed in a prominent position on each tree protection fencing.

The signs shall be repeated at 10m intervals or closer where the fence changes direction. The signage shall be installed prior to the commencement of works on-site and shall be maintained in good condition for the duration of the development period.

The lettering for each sign shall be a minimum 72-point font size. The signs shall be a minimum size of 600×500 mm. The lettering on the sign should comply with AS 1319. Each sign shall advise the following details;



- This fence has been installed to prevent damage to the tree and its natural environment. **Access is restricted.**
- If access, encroachment, or incursion into this Tree Protection Zone is required, prior authorisation is required by the Site Arborist.
- Name, address, and telephone number of the firm.

Source AS 4970-2009 Protection of trees on development sites



15.6 SILT FENCING, SEDIMENT CONTROL AND SOIL EROSION

To protect the sites habitat from soil erosion, an approved sedimentation control fence should be erected prior to the construction process.

The purpose of the silt fencing, and sediment control is to ensure that no soil material (erosion) enters or leaves the building site into Tree Protection Zones or any nearby dams or creeks etc. Silt fence shall be installed parallel to the contours in the area immediately above the Tree Protection Zone. The silt fence shall be installed by securing geo-fabric to secure post fencing.

The post pickets shall be placed at 200mm below existing soil surface. Any sedimentation barrier used is to remain in place for a minimum of 12 weeks after practical completion and can be removed after this time provided, plant growth, health, density, and condition have been noted by the Site Arborist.

A hay/straw bale shall be placed up slope from the silt fence and secured with timber stakes. The bottom of the geo-fabric shall be folded underneath the hay/straw bale.

To allow for the maintenance of both the Tree Protection Fence and the silt fence, the two- (2) fences shall be constructed separately and stand independently of each other. The silt fence shall be erected prior to the commencement of works on-site and shall be maintained in good condition for the duration of the development period.

It should be noted that the installation of silt fences as part of this Tree Protection Plan are not erosion and sediment control measures for the development.

The method and type of barrier is to be directed by Council and or as identified in EPA Guidelines, which covers the recently revised document "Managing Urban Storm water: Soil and Construction Vol.1 (4th Edition)" (also referred to as the "Blue Book". The Blue Book covers a range of technical and management issues relating to erosion and sediment control in urban development (including standard drawings).

In addition, contractors must refrain from including but not limited to doing any of the following activities within or adjoining the tree protection zones.

- Stockpiling of soils, rubble, or other materials,
- Placement of a site office or shed.
- Mixing materials,
- Parking of construction machinery or other vehicles,
- Repairing machinery and or re-fuelling,
- Lighting of fires,

The Site should be left in a clean and tidy manner ensuring suitable mulch cover is applied within the trees drip zone prior to the sedimentation barrier removed.



16.0 SITE MANAGEMENT OF RETAINED TREES

16.1 MATERIALS STORAGE

No materials shall be stored or located within the specified Tree Protection Zone.

A silt fence shall be installed down slope of any storage points. Storage points (where applicable) shall be covered when not in use. An appropriate Environmental spill kit shall be always on site for any unlikely spillages.

16.2 WASTE STORAGE

Waste storage shall not be located within the specified Tree Protection Zone.

A silt fence box style collection point shall be installed down slope from any waste/rubbish collection point. All rubbish shall be stored to prevent material loss caused by wind and or water. Skip bins shall be covered when not in use.

All debris collected should be removed from the site and disposed of in an authorized waste management facility. Natural debris such as logs, and rocks may be left as wildlife habitat provided it does not present a safety hazard or become an obstruction. In such cases it should be appropriately re-arranged and or secured.

Site sheds shall not be located within the specified Tree Protection Zone for any reason.

17.0 TREE PROTECTION MEASURES FOR CONSTRUCTION PROCESS

17.1 SITE ACCESS

Pedestrian and vehicular movement shall not occur within any section of the specified Tree Protection Zone.

17.2 TEMPORARY SERVICES

Temporary services ie. water, electricity, sewer shall not be located within any section of the Tree Protection Zone, for any purpose.

17.3 WORKS WITHIN THE TREE PROTECTION ZONE

The Tree Protection Zone may need to be modified during the construction process to allow access between the tree to be retained and the construction works.

The Tree Protection Zone shall remain intact as specified and approved by Council until these works are to project completion. If access, encroachment, or incursion into the Tree Protection Zone is deemed essential, prior authorization is required by the Site Arborist.

The modification of the Tree Protection Zones may necessitate the dismantling of sections of the Tree Protection Fencing in the short term as part of the construction process. The Tree Protection Fence shall only be removed, altered, or relocated with the authorization of the Site Arborist in writing.



17.3.1 TREE TRUNK PROTECTION WORKS

Where deemed necessary by the Site Arborist, trunk protection shall be provided. Trunk protection may vary subject to the scope of works, trees age, height, and environmental conditions. For semi mature to mature trees shall be installed by wrapping around two-(2) layers of carpet underlay or similar around the trunk to a minimum height of 2m or where the lower scaffold branches allow.

The trunk shall further be protected with 2m lengths of timbers (75 x 50 x 200mm) spaced at 100mm centres, secured by wire rope. The wire rope shall not be fixed to the tree in any way.

17.3.2 TREE BRANCH PROTECTION WORKS

Where deemed necessary by the Site Arborist, branch protection shall be provided. Branch protection shall be installed by wrapping around two-(2) layers of carpet underlay or similar around the branch, secured by wire rope.

The wire rope shall not be fixed to the tree in any way.

17.3.3 ROOT PRUNING AND EXCAVATION WORKS

Minor roots (less than 40mm in diameter) to be pruned shall be cleanly severed with sharp, sterilised pruning implements. Hessian material shall be placed over the face of the excavation. Exposed roots shall be kept in a moist condition during the construction phase.

The main area for surface feeding roots to occur is from the tree trunk to the outer canopy known as the drip zone. These fibrous roots are less likely to occur under or near other buildings, as there is little surface moisture or soil air presence for root survival. These fibrous roots are those that take up water and nutrients.

While some tree roots will deeply penetrate the soil profile, in search of available water, most will occupy the first 60-70cm of the soil, as to obtain the needed sustenance. At times it will not be possible to retain the optimum TPZ around each tree and any activities proposed within this area must be carefully analysed to minimise any effects on its health and/or stability.

The actual spread of the root system is largely dependent on the species involved, and their localised environment. Any work carried out within the Tree Protection Zone should be reviewed and supervised by the engaged Site Arborist.

Construction works proposed to be undertaken around the trees if not correctly assessed may modify the natural water table and reduce the amount of soil air and moisture present/available to the trees and their longevity may be greatly diminished.

If under the course of construction, the tree roots are damaged or adversely affected, their demise will cause drought stress; poor uptake of water and nutrients, slower dispersal of gums and resins and could, in the long term, influence the movement of certain compounds which make up the structure of the tree. Where major roots (greater than 40mmø) are encountered during excavations, further advice from the Site Arborist shall be sought prior to any pruning. Certain instances may require hand digging to ensure the trees health and overall stability.



17.3.4 TREE DAMAGE DURING WORKS

In the event of the tree that is to be retained becoming damaged during the development period, the Site Arborist shall be informed to inspect and provide advice on remedial action if or as required.

17.3.5 COMPLETION OF WORKS WITHIN TREE PROTECTION ZONE

Upon completion of the works within the Tree Protection Zone, the Tree Protection Fencing shall be shall erected until site machinery, sheds, storage facilities are removed.

Where the construction of new structures does not provide sufficient area for the specified Tree Protection Zone, the Tree Protection Zone shall be modified by the Site Arborist prior to any works commencing and be documented.

17.3.6 MONITORING

The Site Arborist shall monitor the site fortnightly throughout the development period to ensure these specifications are maintained.

A site log shall record the details of the site inspections for review by the Principal Certifying Authority prior to the release of the Compliance/Occupation Certificate.

Any changes to the proposed design or through development on site will require additional arboricultural assessment.

The applicant/contractor shall complete all works tabled in this Arborist Assessment in accordance with this program as agreed with, any variations are to be formally submitted to the Site Arborist and or Certifying Authority for approval.

The work shall be deemed 'practically complete' when all works have been completed to the satisfaction of the Contractor and Certifying Authority.

17.4 SOIL PROTECTION WORKS

Where deemed necessary by the Site Arborist, the ground surface within the Tree Protection Zone shall be protected by laying geo-textile over the existing mulch cover.

Large diameter (up to 70mm) recycled railway ballast (basalt) shall be placed over the geo-textile material to a depth of 100mm.

The soil layers shall not be inverted during the excavation works and topsoil shall be stockpiled on site for use in the landscape works. However, it is expected that stringent controls are imposed and implemented to minimise adverse impacts on the soil. These should be site specific and are beyond the scope of this report.

17.5 PEST AND DISEASE MONITORING

All plants should be monitored for pest and disease every two weeks as part of the programmed site inspections. Insecticide is not recommended for native plant species unless the problem becomes severe.

Most native plants will re-shoot after insect predation has passed.



18.0 POST CONSTRUCTION MAINTENAINCE PROCESS

Upon the completion of construction works, a final assessment of the tree(s) shall be undertaken by the Site Arborist in consultation with the Site Supervisor. Items to be inspected and addressed shall include but not limited to;

- Tree Protection Zone measures, (where they adequate)
- Any damage to the tree's root system, (if applicable)
- Any visible damage to the tree's trunk, branches, or canopy, (if applicable)
- Any changes in levels, soil structure, erosion, or loss of organic matter, (*if applicable*)
- Changes to wind loading in the crown through pruning requirement and effects of new structures, (*if applicable*)
- Pest and disease infestation, (if observed)
- Drought stress,
- Requirement for decompaction works, (if applicable)
- Requirement for further pruning works, (*if required*)
- Requirement for ongoing maintenance such as watering, mulching.



19.0 CONCLUSION

The trees which are subject of this report are protected under Blacktown City Council Tree Preservation Order.

Consideration of retaining mature significant vegetation to the area was paramount. After close visual and physical investigation of the various trees condition the results from field investigations are as follows;

Adjoining and Site Trees Numbered 1, 5, 6, 7 and 10, can be safely retained. The proposed works will conform to AS4970 -2009. No adverse impacts and or long-term effects are anticipated to these trees, based on best practise Arboricultural techniques tabled.

Subject to Council process, approval is recommended for the removal of Five-(5) trees numbered 2, 3, 4, 8 and 9.

Trees numbered 2, 3 and 4 are required to be removed due to their individual location within the proposed development or impacts to or from the trees due to their further growth, proposed demolition works, basement excavations, new building envelope, construction, landscaping and considered scope of works within the development.

Trees Numbered 8 and 9 are required to be removed due to their individual poor structural condition with noted open crack/split near the trunk branch union, open damaged wounds on the trunk with noted borer and termite damage. Tree numbered 9 is required to be removed due to its declining and supposed form.

No roosting or habitat hollows were observed in any of these trees proposed to be removed.

As stated, this tabled report is a snapshot of the existing trees structural condition, health ad condition at that particular point in time on site and should be used as a guide when assessing this Development Application.

In summary, no objections to these trees' removal are raised, subject to appropriate environmental safeguards and relevant replacement plantings where appropriate.



20.0 RECOMMENDATIONS

After close visual and physical investigation of the trees condition (VTA) the results from the field investigations indicated the following;

Subject to Council process, approval is recommended for the removal of Five-(5) trees numbered 2, 3, 4, 8 and 9.

Trees numbered 2, 3 and 4 are required to be removed due to their individual location within the proposed development or impacts to or from the trees due to their further growth, proposed demolition works, basement excavations, new building envelope, construction, landscaping and considered scope of works within the development.

Trees Numbered 8 and 9 are required to be removed due to their individual poor structural condition with noted open crack/split near the trunk branch union, open damaged wounds on the trunk with noted borer and termite damage.

Tree numbered 9 is required to be removed due to its declining and suppressed form.


Adjoining and Site Trees Numbered 1, 5, 6, 7 and 10, can be safely retained. The proposed works will conform to AS4970 -2009. No adverse impacts and or long-term effects are anticipated to these trees, based on best practise Arboricultural techniques tabled.

The following points may be considered for the proposed development and tree retention under this application;


- Avoid large changes to the surface structure due to modification of the tree's moisture / surface feeding roots,
- A Qualified Arborist/Horticulturalist undertakes all Arboricultural works,
- **ANY** excavation that is required within adjoining trees TPZ will be hand dug to ensure minimal disturbance to support and or surface feeding roots,
- Any tree roots discovered are cut cleanly with root pruning devices,
- No tree roots over 40mm in diameter will be cut without project arborist and Council approval,
- Any proposed work located near the trunk or outer canopy of the trees drip line, where services are known to be in the vicinity, any excavation for services should be hand dug to ensure minimal impact to the trees surface feeding and support roots,
- No building waste is to be disposed of/or stored near the tree trunk or drip zone,
- A qualified Arborist should monitor these trees over a twelve (12) month period to evaluate the trees recovery and provide technical information to Council as required.
- The applicant considers choosing plant species indigenous to the area as an environmental offset, and thus would help to flora and fauna habitat opportunities and greater diversity of the area,
- On site plantings should take into consideration the high priority of the visual residential element though the use of advanced trees ie. 100Lt,
- The trees should be programmed to be removed whilst they are upright and intact,
- The trees prior to removal shall be fully investigated for any nesting or roosting fauna,




ANNEXURE A: PROPOSED DEVELOPMENT LAYOUT

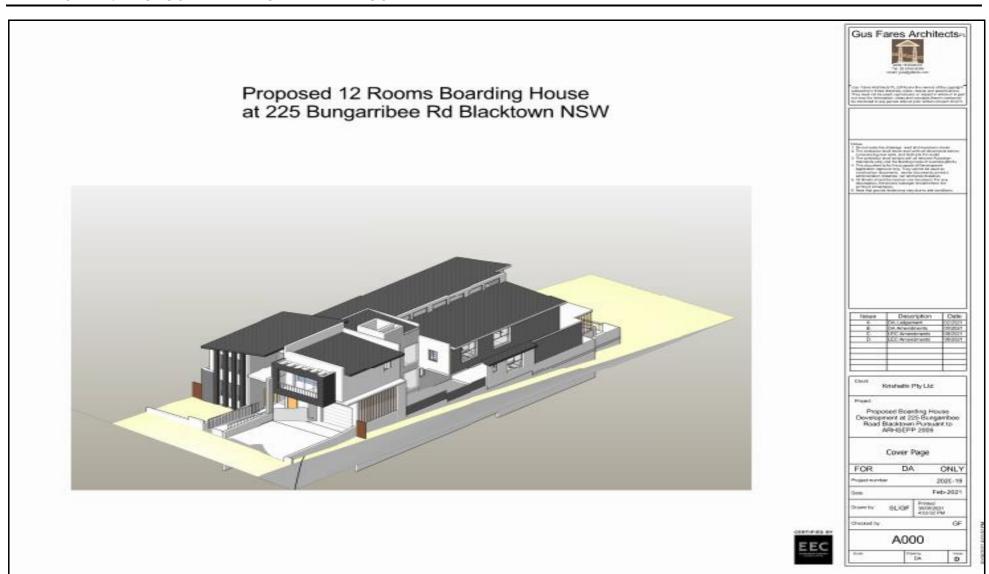




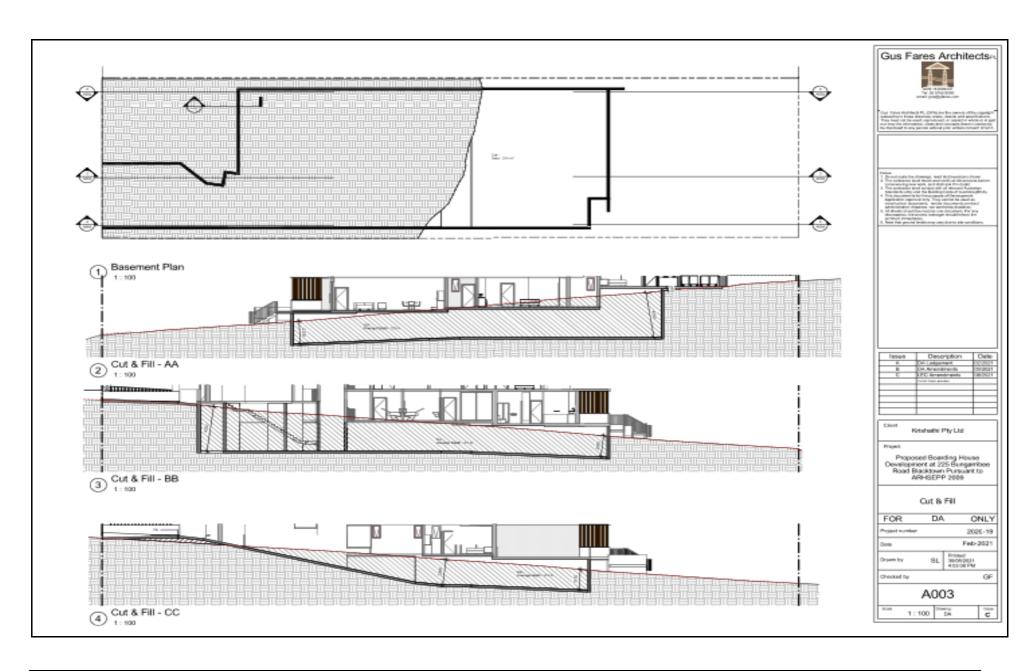




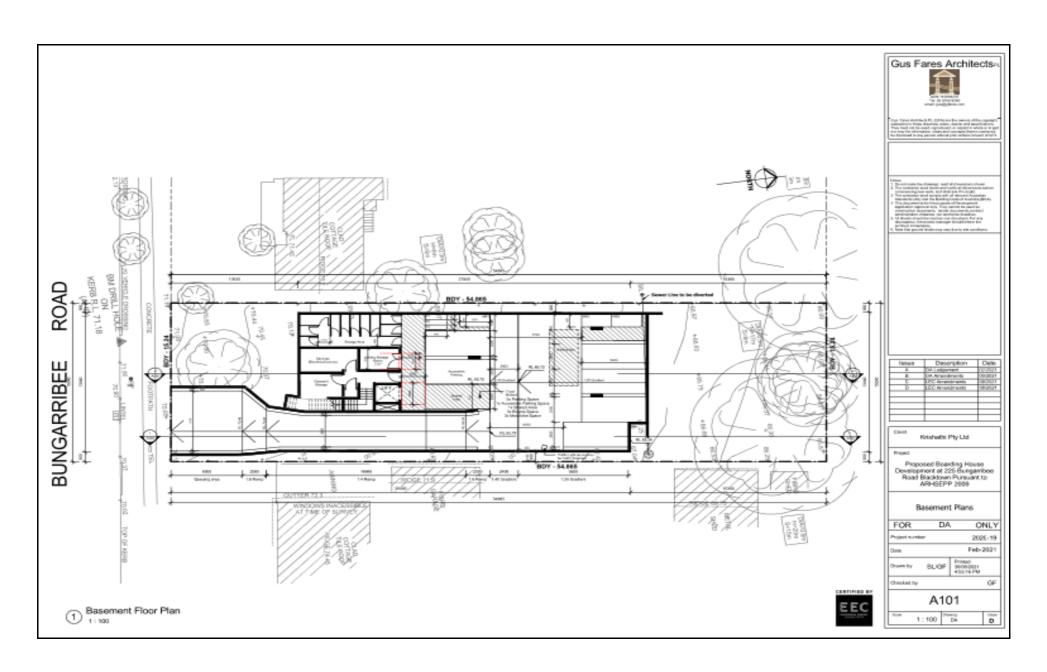




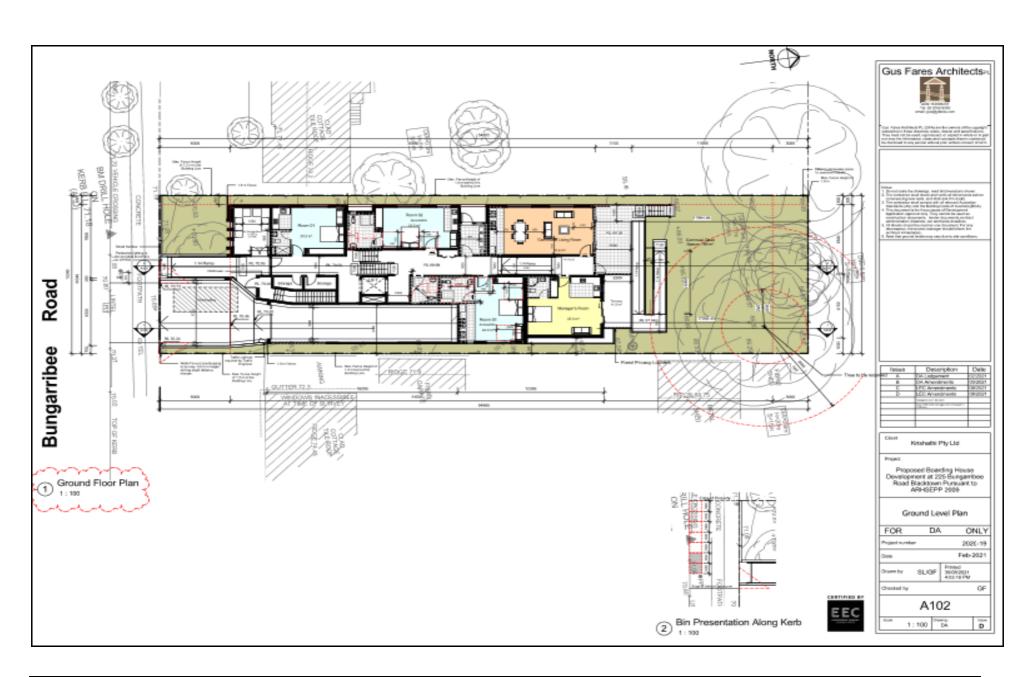



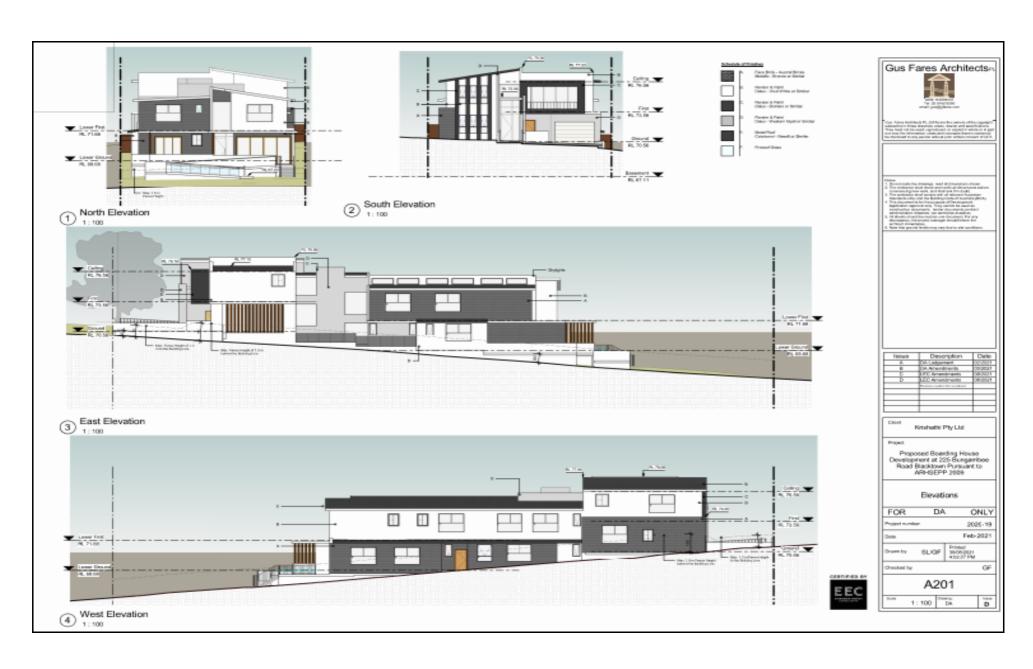




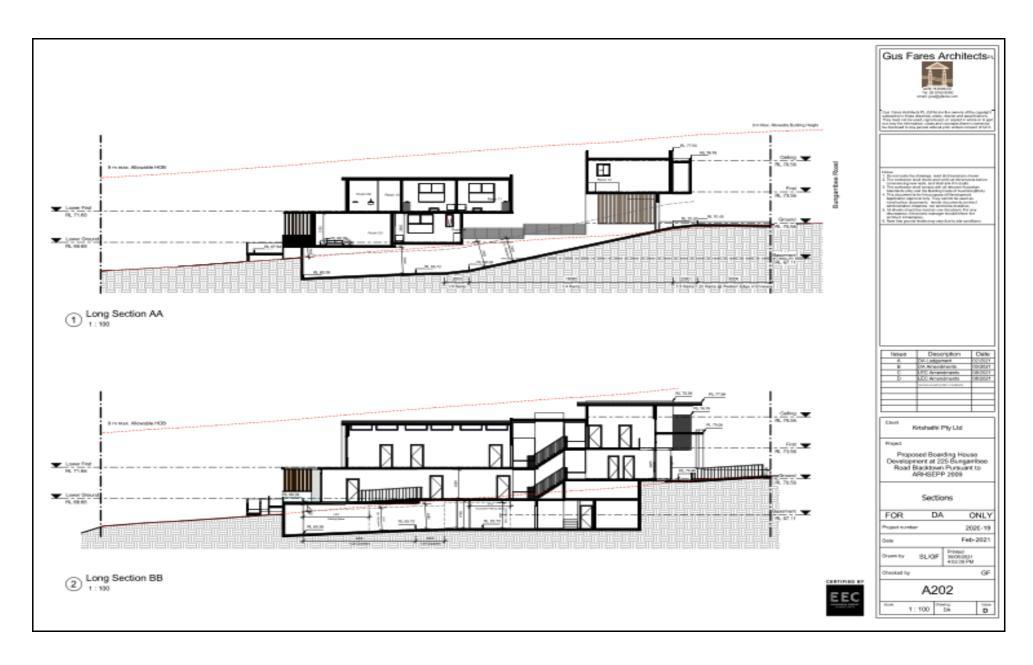





ANNEXURE B: PROPOSED LANDSCAPE MASTER PLAN

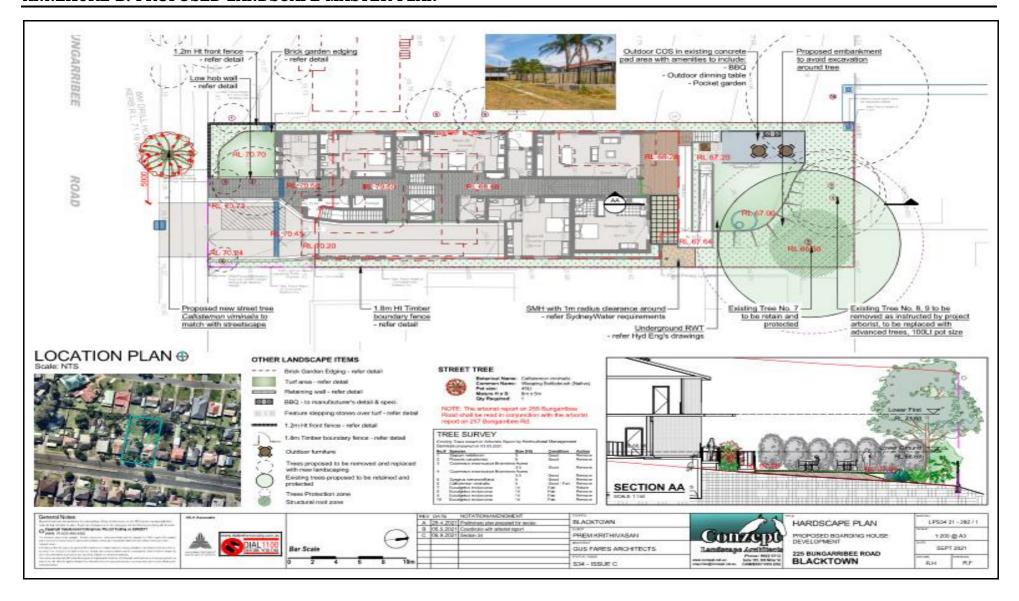



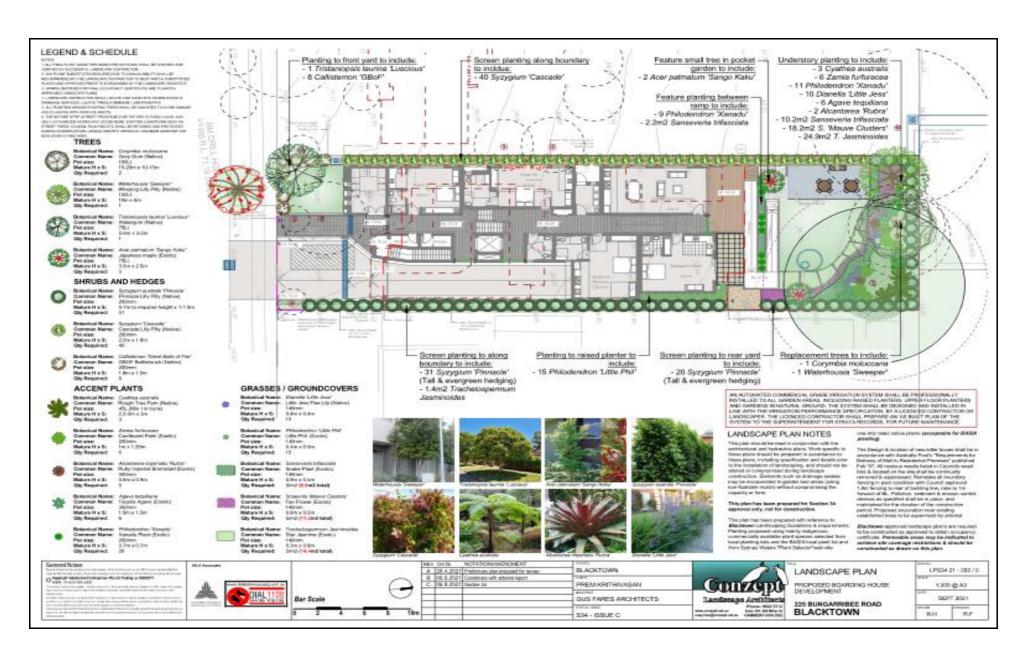



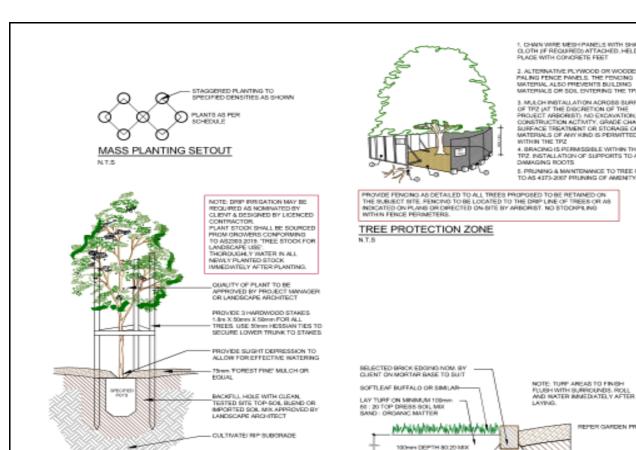

TYPICAL TURF AND BRICK EDGE DETAIL SCALE: 1:10

NUMBER OF STREET STREET, STREE

1. CHAIN WIRE MESH PANELS WITH SHADE CLOTH JIF REQUIRED ATTACHED, HELD IN PLACE WITH CONCRETE FEET

2. ALTERNATIVE PLYWOOD OR WOODEN PALING FENCE PAVELS. THE FENCING MATERIAL ALSO PREVENTS BUILDING MATERIALS OR SOIL ENTERING THE TPZ

3. MULCH INSTALLATION ACROSS SURFACE OF TPZ (AT THE DISCRETION OF THE PROJECT ARBORIST), NO EXCANATION, CONSTRUCTION ACTIVITY, GRADE CHANGES, SUBFACE TREATMENT OR STORAGE OF WATERIALS OF ANY KIND IS PERMITTED WITHIN THE TPZ

4. BRACING IS PERMISSIBLE WITHIN THE TPZ. INSTALLATION OF SUPPORTS TO AVOID DAMAGING ROOTS

5. PRUNING & MAINTENANCE TO TREE REFER TO AS 4373-2007 PRUNING OF AMENITY TREES

REPER GARDEN PREP DETAIL

100MM AGLINE IN BLUE

METAL TRENCH TO CONNECT TO SITE

DRANAGE

TYPICAL SETBACK PROM LAWN/GARDEN EDGE REPORTED PLANTING A DOZDANOS NOS DESCRIPTOS

THIS DETAIL IS ONLY APPLICABLE FOR PLANTING AREA OUTSIDE TREE PROTECTION ZONE OF TREES TO BE DETAINED.

NO CHANGES ARE TO OCCUR TO EXISTING LEVELS, INCLUDING RIPPINGICULTWATING OF THE SOIL WITHIN THE TPZ OF TREES TO BE RETAINED ON SITE

75mm DEPTH "FOREST FINE" MULCH OR EQUIVALENT


SOIL MIX:

58% OF STOCKPILED SITE TOPSOIL FREE PROMIALL BUILDER'S RUBBISH AND DELETERIOUS MATERIALS, TOPSOIL TO BE MIXED WITH MINIMUM SO'N IMPORTED GARDEN MIX OR SOIL CONDITIONER/ COMPOSTED ORGANIC MATTER - SEE SPEC USE 100% IMPORTED SOIL MIX WHEN SITE TOPSOIL RUNS OUT.

TYPICAL GARDEN PREPARATION DETAIL

SCALE 1:10

NOTE: TYPICAL DETAIL ONLY, ALL WALLS WHICH FORM PART OF DRAINAGE WORKS MUST BE BUILT AS DETAILED BY THE HYDRAULIC ENGINEER ALL WALLS EXCEEDING THE HEIGHT SHALL BE DETALED BY A QUALIFIED ENGINEER INSTALL, WALL TO SUIT SITE LEVELS AND TO MANUFACTURES SPECIFICATION.

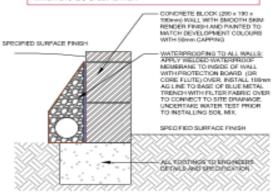

TYPICAL RETAINING WALL DETAIL SCALE 1:10

General Notes: CONSTRUCTION OF THE PARTY

SCALE: NTS

TREE PLANTING DETAIL

YOM, Y ARRESTABLE FOR PLANTING AREA OLDSIDE TIME PROTECTION ZONE OF TREES TO BE RETAINED, NO CHANGES ARE

TO OCCUP TO EXISTING LEVELS, INCLUDING RIPPING/CULTIVATING OF THE SOIL WITHIN THE TPZ OF TREES TO BE RETAINED ON SITE)



REY DATE NOTATION/MONORENT			100401.	
A	29:4.2021	Preliminary plan prepared for review	BLACKTOWN	
- 0	05.5.2021	Countinate with arbunist report	1087	
C	06.8.2021	Section 34	PREMIKRITHIVASAN	
			GUS FARES ARCHITECTS	
\vdash			534 - ISSUE C	


Lamdetage Actifilisch

DETAILS PROPOSED BOARDING HOUSE DEVELOPMENT

225 BUNGARRIBEE ROAD BLACKTOWN

LPS34 21 - 282 / 5 AS SHOWN @ AS SEPT 2021 RF RH



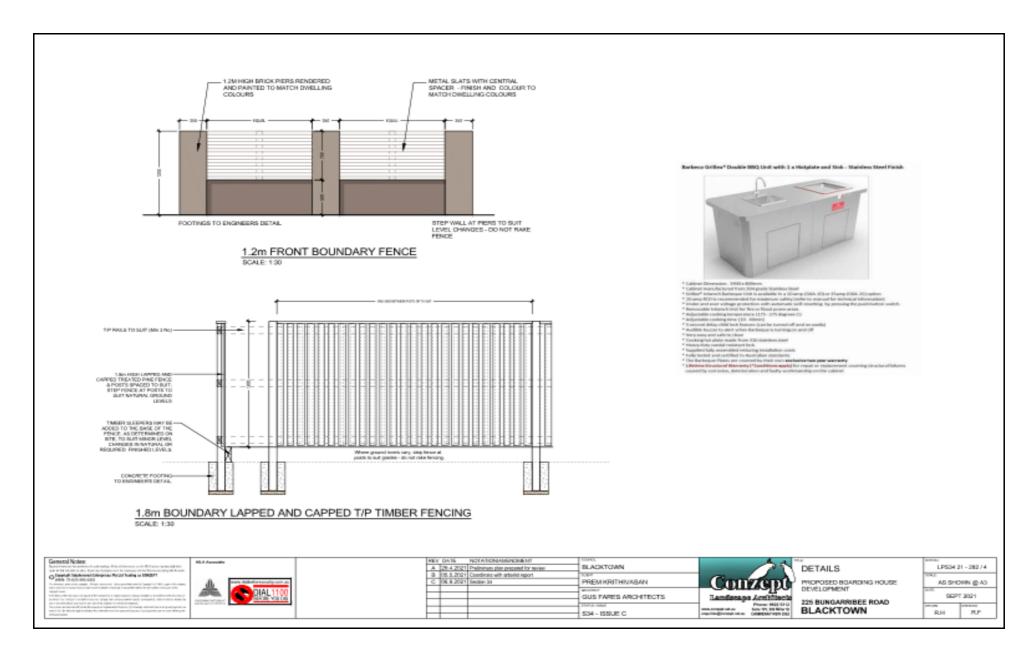



ANNEXURE C: S.U.L.E- SAFE USEFUL LIFE EXPECTANCY (Barrell 1995)

	1	0	2	4	F
	LONG	2 MEDIUM	3 SHORT	4 REMOVAL	5 MOVED OR REPLACED
	Likely to be useful for over 40 years with acceptable risk and assuming reasonable maintenance	Likely to be useful for 15- 40 years with acceptable risk and assuming reasonable maintenance	Trees that appeared to be retainable at the time of assessment for 5 to 15 years with acceptable level of risk.	Tree to be removed within the next 5 years	Tree which can be reliably moved or replaced.
A	Structurally sound trees growing in positions that can accommodate future growth	Trees which may only live 15-40 years	Trees that may only live between 5 and 15 more years.	Dead, dying, suppressed or declining trees through disease or inhospitable conditions.	Small tree less than 5m in height.
В	Trees which could be made suitable for long term retention by further care	Trees which may live for more than 40 years but which would be removed for safety or nuisance reasons	Trees which may live for more than 15 years but which would be removed for safety or nuisance reasons	Dangerous trees through instability or recent loss of adjacent trees.	Young trees less than 15 years old but over 5m in height.
С	Trees of special significance for history, commemorative or rarity reasons that warrant extraordinary efforts to secure their long-term future	Trees that may live for more than 40 years but would be removed to prevent interference with more suitable individuals or to provide space for new planting	Trees that may live for more than 15 years but should be removed to prevent interference with more suitable individuals or to provide space for new plantings	Dangerous trees through structural defects including cavities, decay included bark, wounds or poor form.	Trees that have been pruned to artificially control growth.
D		Trees which could be made suitable for medium term retention by remedial care	Trees which require substantial remediation tree care and are only suitable for retention in the short term.	Damaged trees that are clearly not safe to retain.	
Е				Trees that may live for more than 5 years but should be removed to prevent interference with more suitable individuals or to provide space for new plantings	
F				Trees damaging Or which may cause damage to existing structures within the next 5 years	
G				Trees that will become dangerous after removal of other tress for reasons given in A) to F)	

NOTE: No tree is "safe" i.e. entirely without hazard potential. The SULE rating given to any tree in this report assumes that reasonable maintenance will be provided by & qualified arborist using correct and acknowledged techniques. Retained trees are to have a reasonable setback and be protected from root damage. Incorrect practices can significantly accelerate tree decline and increase hazard potential.



ANNEXURE D: DEFINITION OF TREE TERMINOLOGY

This attachment is to accompany this Arborist Assessment to explain the terminology used and the rationale and assessment of factors used in the Safe Useful Life Expectancy (SULE) method of tree evaluation.

TERMINOLOGY USED:

DBH: Acronym for trunk diameter at breast height (1 4m from ground level).

DEADWOOD: Many trees are noted as having various diameter deadwood over the course of their lifecycle. Deadwood is a normal function for plant growth and development. The trees upper canopy foliage or crown condition is an important indicator of an individual trees' health. Dieback is the progressive death of branches or shoots originating from the tips. Dieback and decline are parts of a disease complex that have similar causal agents. Crown dieback is a recognizable, visible symptom of the early stages of decline and potential tree death (www.fhm.fs.fed.us).

The safety of the target, namely pedestrians, is considered the primary basis for deadwood removal. As deadwood has an ecological value, the removal of deadwood is usually only carried where it is a potential hazard to site users. Dead wooding a tree does not increase its life expectancy.

EPICORMIC GROWTH: The production of epicormic growth from dormant buds is a response to stress. Epicormic growth may be initiated by various causes such as branch loss, excessive pruning, fire damage, drought, defoliation and/or disease.

Epicormic growth comes from dormant buds held in the cambium. Under normal growth conditions, these buds are held in a dormant state by hormones produced in the canopy. These shoots are often produced by the tree in response to injury or environmental stress. Epicormic growth has implications for tree structure as the attachment of an epicormic shoot is much weaker than that of a 'naturally' developed branch (Fakes, 2004).

MYCORRHIZAE / RHIZOSPHERE: Mycorrhizae are fungi that grow in symbiotic association with tree roots (especially the fine root hairs) and are attributed with increasing the uptake of nutrients, particularly phosphorus, and reducing infection from soil borne pathogens. They greatly increase the surface area of a tree's root system. Mycorrhizae require aerobic soil conditions and are reduced in number by compaction, waterlogging and over-use of soil fertilisers. Forest litter or similar mulch provides ideal conditions for the proliferation of mycorrhizae. Rhizosphere is a term describing the peripheral area of a tree's root system where this symbiotic association most commonly occurs.

CONDITION: An evaluation of the structural status of the tree including defects that may affect the useful life of an otherwise healthy specimen. Such influencing factors include cavities and decay, weak unions between scaffolds {major branches} or trunks and faults of form or habit.



TREE HAZARD POTENTIAL: An assessment of the risks associated in retaining a tree in its existing or proposed surrounds. Factors to consider are the growth characteristics of the species, tree vitality, condition and the frequency and type of potential targets. The impact the proposed works may have on tree vitality can only be assumed.

CO-DOMINANT STEMS: Co-dominant stems were noted on several trees throughout the subject site. The term 'co-dominant' is used to describe two or more stems or leaders that are approximately the same diameter and emerge from the same location on the main trunk. The junction where the two stems meet is a common location of above ground tree failure (Harris, Clark & Matheny, 1999).

The relative size of the two leaders is important to the tree's structural stability. Codominant stems split apart more easily than branches that are small, relative to trunk size. This is because the only way trunk xylem can grow around a branch, and form a strong attachment, is for the trunk to be larger in diameter than the branch attachment. If the branch diameters are near the same size, their attachment will be weak because their xylem tissues are essentially parallel and are not able to grow around each other. Co-dominant stems typically lack this overlapping tissue present in a collar, which can lead to possible failure at the point of attachment. Additionally, the weight and leverage of the co-dominant stems will increase with age, intensifying the stress on the attachment (Harris, Clark & Matheny, 1999).

Furthermore, co-dominant stems do not have built in protection zones as with normal branches. This is because they are extensions of the stem. This enables pathogens and insects to spread downward and upward with little natural protection (Shigo, 1989)

DOMINANT: Trees with crowns above the upper layer of the canopy and generally receiving light from above and the sides.

EDGE: Trees located on the edge of a more dominant canopy of trees, and frequently possessing asymmetrical crowns, (heavier on the open side) and trunks that may be distorted due to competing with others for valuable nutrients ie. soil air, water, light.

FOREST: Trees that have grown in a forest setting and only have about 1/3 of their canopy located on tall straight trunks.

INCLUDED BRANCH JUNCTIONS: Included bark was noted on trees throughout the site. Included bark often forms when two branches or trunks grow together at sharply acute angles, producing a wedge of inward-rolling bark.

Junctions with included bark form weak attachments, as there is little connective tissue between the two stems. Although all co-dominant stems should be considered comparatively weak, co-dominant stems that have bark trapped in the union are significantly weaker than those that do not have bark included (Smiley, 2003).

Tree failure can occur when the strength of wood is exceeded by a mechanical stress and/or is compromised by the presence of defects

INTERMEDIATE: Trees that have been overtopped, and become part of the understorey canopy



PROJECT ARBORIST: The person responsible for carrying out the tree assessment, report preparation, consultation with designers, specifying tree protection measures, monitoring and certification. The project arborist will be suitably experienced and competent in arboriculture, having acquired through training, qualification (minimum Australian Qualification Framework (AQF) Level 5, Diploma of Horticulture (Arboriculture)) and/or equivalent experience, the knowledge and skills enabling that person to perform the tasks required by this Standard.

STRUCTURAL ROOT ZONE (SRZ): The area around the base of a tree required for the tree's stability in the ground. The woody root growth and soil cohesion in this area are necessary to hold the tree upright. The SRZ is nominally circular with the trunk at its centre and is expressed by its radius in metres.

This zone considers a tree's structural stability only, not the root zone required for a tree's vigour and long-term viability, which will usually be a much larger area.

TREE: Long lived woody perennial plant greater than (or usually greater than) 3 m in height with one or relatively few main stems or trunks (or as defined by the determining authority).

TREE PROTECTION ZONE (TPZ): A specified area above and below ground and at a given distance from the trunk set aside for the protection of a tree's roots and crown to provide for the viability and stability of a tree to be retained where it is potentially subject to damage by development.

VIGOUR: Ability of a tree to sustain its life processes. The term 'vigour' in this document is synonymous with commonly used terms such as 'health' and 'vitality'.

VITALITY: Indicates the energy reserves of the tree and is determined by the observed crown colour and density, the percentage of dead / dying branches and epicormic growth. The vitality of the canopy and that of the root system is interdependent; root damage or heavy pruning draws on a tree's energy reserves. The tree's ability to initiate internal defence systems (compartmentalisation of damage) is reduced and it can also become predisposed to attack by insects and pathogens.

WORK: Any physical activity in relation to land that is specified by the determining authority.

WOUNDING: Generally, the wounds were located on the lower 2m of trees' trunk or on exposed roots. This suggests that the wounding may be a result of mechanical injury from landscape maintenance equipment. However, wounds were also noted higher up on the trunk and main branches. The likely cause of this wounding is branch failure, splitting or cracking during high wind events.

The primary effect of wounding is reduced translocation of water, minerals, and sugars because of loss of bark, cambium, and sapwood. Mechanical injury may also have implications for tree structure as the long-term effects of tree wounding is the potential development of decay. The long-term effects of tree wounding are the potential development of decay and loss of wood strength (Harris, Clark, Matheny, 1999).



ANNEXURE E: REFERENCES

- 1. American Society of Consulting Arborists (1995), A *Guide to Report Writing for Consulting Arborists*, International Society of Arboriculture, USA.
- 2. Australian Standards AS 4970-2009 Protection of trees on development sites.
- 3. Barrell, J., (1993) 'Pre-planning Tree Surveys: Safe Useful Life Expectancy (SULE) is the Natural Progression' Arboricultural Journal Vol. 17, pp 33-46, AB Academic Publishers, Great Britain.
- 4. Barrell, J., (2001) 'Safe Useful Life Expectancy Categories updated 4/01' from Management of Mature Trees, proceeding of the 4th NAAA Tree Management Seminar, National Arborists Association of Australia, Sydney, Australia, Appendix 3.
- 5. Bradshaw, Hunt & Walmsley (1995), *Trees in the Urban Landscape*, E &FN Spon, London.
- 6. Fakes J (2004), Introduction to Arboriculture, Ryde TAFE, NSW.
- 7. Fakes J (2005), Arboriculture Notes, Ryde TAFE, NSW.
- 8. Gilman E (1997), Trees for Urban and Suburban Landscapes: An Illustrated Guide to Pruning, Delmar, USA.
- 9. Hadlington & Johnston (1988), Australian Trees: Their Care & Repair, UNSW Press, Sydney.
- 10. Harris R W, 1983, Arboriculture. Prentice- Hall Inc., Englewood Cliffs, New Jersey.
- 11. Harris, Clark & Matheny (1999), Arboriculture: Integrated Management of Landscape Trees,
- 12. Heatwole, H. & Lawman, M. (1986) 'Dieback. death of an Australian landscape' Reed Books Pry Ltd. Frenchs Forest, NSW
- 13. Matheny & Clark (1994), A Photographic Guide to the Evaluation of Hazard Trees in Urban Areas, International Society of Arboriculture, USA
- 14. Mattheck & Breloer (1994), The Body Language of Trees: A Handbook for Failure Analysis, The Stationary Office, London.
- 15. Rowell, R. J. (1980) 'Ornamental Flowering Trees of Australia1 Reed Books Pty Ltd.
- 16. Shrubs and Vines, Prentice Hall, New Jersey.
- 17. Simon, Dormer & Hartshorne (1973), Lowson's Botany, Bell & Hyman, London.
- 18. Thyer, P. (1996) 'Thyer Tree Valuation Method'
- 19. www.whereis.com.au.
- 20. www.Nearmaps.com.
- 21. Blacktown City Council Tree Preservation Order (TPO).



ANNEXURE F: CERTIFICATION

I certify that the enclosed "Arboricultural Impact Assessment" for the proposed development at 225 Bungarribee Road, Blacktown, has been prepared by Horticultural Management Services.

To the best of my knowledge and professional integrity, it is true in all material particulars and does not, by its presentation or omission of information, materially mislead.

Qualifications:

- Diploma of Arboriculture (AQF L5)
- International Society of Arboriculture (ISA) Tree Risk Assessment TRAQ Certified
- Diploma of Horticulture
- Diploma of Conservation and Land Management



Scott Freeman Principal Horticultural Management Services

Dated 3.05.2021 Amended 8th September 2021

Published by Horticultural Management Services. Horticultural Management Services Narellan NSW 2567 First edition, first, Published 2021 By Horticultural Management Services.

© Copyright Horticultural Management Services 2021

