

GTE1355 – Preliminary Contamination And Salinity Report

19 October 2017

Client: Club Marconi
c/- Restifa & Partners Pty Ltd
Suite 302, 123 Walker Street
North Sydney 2060

Attention: Sam Restifa
E-mail: Sam@restifa.com.au

Dear Sir,


**RE: PRELIMINARY CONTAMINATION AND SALINITY ASSESSMENT at No.121-133 Prairie Valley Road,
Bossley Park**

This report presents a Preliminary Contamination And Salinity Assessment on the inspection and testing services undertaken at the above project.

Should you have any questions related to this report please do not hesitate to contact the undersigned.

For and on behalf of
Ground Technologies Pty Ltd

Reviewed By



J.George
Environmental Engineer



A.Bennett
Senior Geotechnical Engineer

Contents

1. INTRODUCTION.....	4
2. SCOPE OF WORK	4
3. SITE DESCRIPTION.....	4
4. SITE CONDITION AND SURROUNDING ENVIRONMENT	5
5. SITE GEOLOGY	5
6. SITE HISTORY.....	5
6.1 Aerial Photographs:.....	5
6.2 Search of Contaminated Land Management Register (NSW EPA):.....	7
6.3 Search of Protection of Environment Operations Public Register(POEO).....	7
7. POTENTIAL SOURCES OF CONTAMINATION	7
8. SAMPLING AND ANALYSIS PLAN	8
8.1 Sampling Points.....	8
8.2 Sampling Methodology	8
8.3 Soil Profiles.....	8
8.4 Groundwater.....	9
9. BASIS FOR ASSESMENT CRITERIA.....	10
10. LABORATORY TEST RESULTS – CHEMICAL CONTAMINATION	11
10.1 Discussion of Laboratory Test Results	13
11. SALINITY ASSESSMENT	13
12. LABORATORY TEST RESULTS – SALINITY.....	14
13. LABORATORY TEST RESULTS – ASBESTOS	15
13.1 Discussion of Laboratory Test Results	15
14. LABORATORY QUALITY ASSESSMENT AND QUALITY CONTROL	16
14.1 Laboratory Accreditation.....	16
14.2 Laboratory Duplicate Results.....	16
14.3 Laboratory Blanks.....	16
14.4 Laboratory Control Spikes	16
14.5 Laboratory Matrix Spikes.....	16
15. CONCLUSIONS AND RECOMMENDATIONS	17
16. LIMITATIONS.....	18
17. REFERENCES:.....	19
 TABLE 1 - SUMMARY OF SITE DETAILS	 4
TABLE 2 – SUMMARY OF FIELD OBSERVATIONS	5
TABLE 3 - BOREHOLE PROFILE	9
TABLE 4 – FILL DEPTH.....	9
TABLE 5 - SITE ASSESSMENT CRITERIA.....	10
TABLE 6 LABORATORY TEST RESULTS – CHEMICAL CONTAMINATION.....	11
TABLE 7 : ANALYSIS OF THE SOIL SAMPLES (SALINITY)	14
TABLE 8 - ANALYSIS OF THE SOIL SAMPLES (AGGRESSIVENESS)	14
TABLE 9- LABORATORY TEST RESULTS FOR ASBESTOS IDENTIFICATION	15
 Appendix A – Search results of EPA Contaminated Land Register	
Appendix B – Search of POEO register of licensed and delicensed premises	
Appendix C – Borehole Logs	
Appendix D – Laboratory Test Certificated	

EXECUTIVE SUMMARY

Ground Technologies Pty Ltd have undertaken a Preliminary Contamination Investigation and Salinity Report at Club Marconi, No. 121-133 Prairie Valley Road, Bossley Park. It is understood that this preliminary investigation was undertaken for due diligence purposes prior to re-development of the site. No details pertaining to the re-development were made available to Ground Technologies at the time of preparing this report. Borehole and sampling locations were provided by Mr. Sam Restifa to determine the quality of the subsurface soil material within the marked areas given in figure 6.

The objective of the preliminary Contamination and Salinity Report (factual) was to ascertain whether the sub-surface material present within the boreholes sampled on site poses a risk to human health and/or the environment at the site or neighbouring properties. This was achieved by undertaking a brief desk top study and a sampling regime as advised by the client.

The conclusions of this preliminary contamination report are as follows:

- A review of aerial photography suggests that the neighbouring properties are residential and not considered to have posed a risk for potential contamination to the site.
- A search of the NSW EPA Contaminated Land Management record of notices revealed that there were no notices issued to the subject site. No history of dangerous manufacturing utilizing heavy chemicals or metals was documented.
- Significant filling was observed predominantly at the south-west portion of the site. The source of this fill material is unknown.
- Eleven borehole and sampling locations were requested to be investigated as a part of this investigation in order to determine the quality of the subsurface soil material.
- Twenty four (24) samples were submitted for chemical analysis. The concentrations of all Heavy Metals, PAHs, Petroleum Hydrocarbons and BTEX were well below the Health Investigation Levels (HIL) for all four different exposure settings.
- Eight (8) samples were submitted for salinity analysis. The electrical conductivity results indicate that the soil salinity is predominately non saline to slightly saline, with the exception of two samples which were moderately saline.
- Eight (8) samples were submitted for aggressivity analysis. The laboratory test values of sulphates, chlorides and pH indicate that the soil samples are not aggressive to both steel and concrete.
- One (1) small piece of cement sheeting was recovered from borehole 5 at the time of the site investigation and was identified by laboratory analysis as a piece of asbestos chrysotile cement sheeting (approximately 20 x18 x 7mm). No other signs of bonded asbestos or asbestos fibres were observe during the field investigation. No asbestos was identified by laboratory analysis within the recovered laboratory samples from the remaining boreholes (BH1-4, BH6-11).

The above report is only a primary contamination and salinity investigation (factual investigation) assessment which comprises a brief desktop study and sub-surface investigation of the fill material at eleven boreholes within the site as advised by the client. The initial results indicate that there is a low risk of widespread contamination across the site, as chemical levels in all samples were below the Health Investigation Levels (HIL) for all four different exposure settings. One potenetial asbestos contamination hot spot was observed at the location of borehole BH5. Hence It is recommended that an additional assessment (detailed investigation) be undertaken at the time of proposed development works to further determine the full nature, location and likely distribution of any contamination of the fill material within the subject site.

It is understood that the north-western portion of the site, currently covered by a car park, is to potentially be re-developed for Independent Unit Living. Based upon the results of this preliminary study, the site would be low risk of presenting a contamination risk, especially if the development was to comprise an apartment style development with limited site access to soils (HIL B assessment criteria).

1. INTRODUCTION

Ground Technologies Pty Ltd have undertaken a Preliminary Contamination Investigation and Salinity Report at Club Marconi, No. 121-133 Prairie Valley Road, Bossley Park. It is understood that this preliminary investigation was undertaken for due diligence purposes prior to re-development of the site. No details pertaining to the re-development were made available to Ground Technologies at the time of preparing this report. Borehole and sampling locations were provided by Mr. Sam Restifa to determine the quality of the subsurface soil material within the marked areas given in figure 6.

2. SCOPE OF WORK

The following scope of work was conducted:

- Desktop Study of the following to assist in identification of potential contamination issues:
 - Data from Environment Protection Authority
 - o Scheduled premises
 - o Sites which are likely contaminated and not contaminated
 - Data from the Protection of the Environment Operations Public Register (POEO)
- Review of soils and geological maps.
- Review of aerial photography
- Site Inspection by a Geotechnical Engineer to ascertain current activities, and any visible signs of contamination.
- Collection of soil samples (fill material) by a Geotechnical Engineer according to a sampling plan (11 Boreholes) marked out by the client.
- Chemical analysis by a NATA accredited laboratory.
- Assessment of the results of the chemical analysis against the appropriate guidelines.
- Preparation of the Contamination Report.

3. SITE DESCRIPTION

Table 1 - Summary of Site Details

Site Address	121-133 Prairie Vale Road Bossley Park
Council Area	Fairfield City Council
Lot / DP	Lot 5 Section B DP6934, Lot 6 Section B DP 6934, Lot 1 DP 332770, Lot 3B DP 407243, Lot 7 DP664803

Figure 1 – Site Location



4. SITE CONDITION AND SURROUNDING ENVIRONMENT

The site investigation was conducted on 13th and 14th September 2017. The field observations are summarised in the table below:

Table 2 – Summary of Field Observations

Parameter	Observation
Visible observations on soil contamination	No visible evidence of contamination was observed, however a small piece of asbestos cement sheeting was recovered from borehole 5. No staining of the soils or odours were documented.
Signs of plant stress	None observed.
Signs of Agriculture	None observed. No visible indicators of tilled land
Presence of drums or waste materials	No visible indicators of underground fuel tanks (bowzers or venting pipes)
Presence of fill	Significant filling was observed across the majority of the site, however, deep fill was concentrated within the south west portion of the site

5. SITE GEOLOGY

The 1:100,000 scale Geological Series Map of the Penrith region indicates that the subject site is underlain by Bringelly Shale of the Wianamatta Group dating back to the Middle Triassic period and generally comprises *shale, carbonaceous claystone, claystone, laminate, fine to medium grained lithic sandstone, and rare coal / tuff.*

6. SITE HISTORY

In order to ascertain the site history, a limited documentary review of past and present land use at the subject site and the surrounding area has been undertaken as follows

6.1 Aerial Photographs:

A review of Historical Aerial Photographs was undertaken in order to provide a greater insight into the site history.

1961 – In 1961 the subject site was predominatly covered with vegetation(trees), however there appears to be a small house and some sheds at the north-west portion of the site facing Restwell Road. There appears to be a water body at the south-west portion of the site. The area surrounding the site appears to be predominately undeveloped. The approximate location of the subject site is highlighted in figure 2.

Figure 2 – Aerial Photograph from 1961



1975 – In 1975, the house and structures have been demolished. The site has been cleared off trees and has been developed. A building (club building) is present on the central portion of the site. The water body at the south-west portion of the site is still present on site. The remainder of the site has been cleared and remain unsealed with sparse vegetation. There also appears to be a structure at the rear of the club building. The area surrounding the site appears to be predominately undeveloped. The subject site is highlighted in figure 3.

Figure 3 – Aerial Photograph from 1975



1984 – In 1984 the water body(dam) at the south west corner of the site appear to be back filled. The area to the west of the property has been cleared off trees. Some houses have been constructed to the north and south of the property. The subject site is highlighted in figure 4.

Figure 4 – Aerial Photograph from 1984



1994 – In 1994, there has been further development at the site. There are other structures that appear within the site. There also appears to be a building on the south east corner of the property where currently part of the carpark is located. The playing fields and courts also appear on site. Further residential development of land surrounding the site has occurred, since the 1987 aerial photograph was taken. The subject site is highlighted in figure 5.

Figure 5 – Aerial Photograph from 1994



6.2 Search of Contaminated Land Management Register (NSW EPA):

A summary of the search of the NSW EPA Contaminated Land Management record of notices for Bossley Park can be found in Appendix A. No notices have been issued to the subject site and no notices have been issued within the region.

6.3 Search of Protection of Environment Operations Public Register(POEO)

A search of the POEO public register of licensed and delicensed premises showed there are no premises within the Bossley Park area, see Appendix B.

7. POTENTIAL SOURCES OF CONTAMINATION

A search of the NSW EPA Contaminated Land Management record of notices revealed that there were no notices issued to the subject site. No history of dangerous manufacturing utilizing heavy chemicals or metals was observed. No history of heavy chemicals or metals storage was documented. No industrial facilities undertaking heavy manufacturing are located within 500m of the subject site. The surrounding sites are residential therefore, the risk of contamination migration caused by surface run-off from adjoining sites is minimal.

During the course of the site walk over, the morphology of the site indicated significant filling within the rear portion of the site mainly at the south-west portion of the site. No documentation pertaining to the source of this fill was provided.

From the aerial photographs it can be inferred that part of the fill was placed at the site some time between 1975 and 1984. The source of the fill material is unknown, and as such presents a contamination risk. Potential contamination exists in the form of heavy metals, petroleum hydrocarbons (TPH), polynuclear aromatic hydrocarbons (PAH) and asbestos.

8. SAMPLING AND ANALYSIS PLAN

8.1 Sampling Points

The sampling regime for this investigation was advised by the client. As part of this investigation, eleven (11) boreholes were drilled across the site (see Figure 6). Twenty four (24) discrete samples were recovered from within the fill for chemical analysis, eleven (11) composite samples were recovered from the fill for asbestos identification and eight (8) samples were recovered for salinity / aggressivity analysis from within the fill and natural soil profile.

8.2 Sampling Methodology

Each sample location was excavated using a solid flight auger drill rig. The sample was collected from the auger using a stainless steel trowel. The samples were placed in 250g laboratory prepared glass jars which were capped using Teflon-sealed screw caps and then placed in a chilled container. The samples were forwarded to Australian Laboratory Services Pty Ltd (ALS) for analysis along with a Chain of Custody which was subsequently returned to confirm the receipt of all samples.

8.3 Soil Profiles

Fieldwork was undertaken on 13th and 14th of September 2017 and comprised drilling 11 boreholes using a solid flight auger drill rig and a hand auger at locations shown on Figure 6. The profile of the boreholes are broadly summarised in table 3 and the full borehole logs are supplied within Appendix C. A summary of fill depth is presented in Table 4.

Figure 6- Location of Boreholes



(Note: This investigation is limited to the areas marked in yellow)

Table 3 - Borehole Profile

Profile	Depth
TOPSOIL; Silty Sand	Brown Silty SAND to depths of 0.1m
FILL; Silty Clay, yellow brown to red brown	Yellow brown to red brown Silty Clay at depths between 0.1m and 1.5≈2.0m and in two boreholes to depths of 3.0≈3.5m
FILL; Admixed Silty Sandy Clay, with gravels	Yellow brown, red brown to grey brown, Silty Sandy Clay with gravels at depths between 0.1m and 1.5≈2.0m
NATURAL; Silty Clay	Red brown to grey brown, Silty Clay mostly from depths between 1.8≈3.5m
BEDROCK; Extremely Weathered Sandstone	Weathered shale slightly mottled brown in two boreholes(9 and 11) from depths 0.8m≈1.4m

Table 4 – Fill Depth

Borehole	BH1	BH2	BH3	BH4	BH5	BH6	BH7	BH8	BH9	BH10	BH11
Depth of Fill	1.8m	3.5m	3.0m	3.5m	2.8m	2.5m	2.4m	0.8m+	1.4m	0.8m	1.2m+

8.4 Groundwater

No Groundwater was encountered during the course of the investigation.

9. BASIS FOR ASSESMENT CRITERIA

The source fill material is unknown, and as such presents a contamination risk. Potential contamination exists in the form of heavy metals, petroleum hydrocarbons (TPH), Polynuclear aromatic hydrocarbons (PAH), BTEX and asbestos.

The Assessment criteria used in this investigation have been obtained from the National Environment Protection (Assessment of Site Contamination) Measure (NEPM, 1999). This document presents risk-based Health Investigation Levels based on a variety of exposure settings for a number of organic and inorganic contaminants. As the details of any future development are unknown the results of the laboratory analysis are compared against all four of the Health Investigation Levels (HIL) for different exposure settings. The selected assessment criteria used in this assessment are summarized in table 5 below:

Table 5 - Site Assessment Criteria

Chemicals and other attributes		Health Based Investigation Level (HIL'A') ₁	Health Based Investigation Level (HIL'B') ₂	Health Based Investigation Level (HIL'C') ₃	Health Based Investigation Level (HIL'D') ₄
Heavy Metals	Mercury	40	120	80	730
	Cadmium	20	150	90	900
	Lead	300	1200	600	1500
	Arsenic	100	500	300	3000
	Chromium	100	500	300	3600
	Copper	6000	30000	17000	240000
	Nickel	400	1200	1200	6000
	Zinc	7400	60000	30000	400000
PAH	Total PAH	300	400	300	4000
	Carcinogenic PAH	3	4	3	40
	Benzo(a)pyrene	0.7	0.7	0.7	0.7
BTEX	Benzene	65	65	65	95
	Toluene	105	105	105	135
	Ethyl-Benzene	125	125	125	185
	Xylenes	45	45	45	95
TPH	TPH – C6-C10	800	800	800	800
	TPH – C10-C16	1000	1000	1000	1000
	TPH – C16-C34	3500	3500	3500	5000
	TPH – C34-C40	10000	10000	10000	10000

1. HIL A: Residential A with garden/accessible soil also includes children's day care centres, preschools and primary schools.

2. HIL B: Residential B with minimal opportunities for soil access; includes dwellings with fully and permanently paved yard space such as high-rise buildings and apartments.

3. HIL C: Recreational C includes public open space such as parks, playgrounds, playing fields (e.g. ovals), secondary schools and unpaved footpaths.

4. HIL D: Commercial/industrial D includes premises such as shops, offices, factories and industrial sites.

10. LABORATORY TEST RESULTS – CHEMICAL CONTAMINATION

Test results obtained from ALS (Certificate Reference number ES1723266) are summarised in Table 6 with the above mentioned contaminant threshold values. The test values are highlighted in bold if they exceed the values obtained from the guidelines.

Table 6 Laboratory Test Results – Chemical Contamination

Contaminant of Concern	E1	E2	E3	E4	E5	E6	E7	E8	E9	E10	E11	E12	HIL (A) Threshold	HIL (B) Threshold	HIL (C) Threshold	HIL (D) Threshold
Mercury	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	40	120	80	730
Cadmium	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	20	150	90	900
Lead	16	13	18	18	19	16	15	54	14	13	38	30	300	1200	600	1500
Arsenic	6	7	<5	9	9	15	6	9	11	<5	8	9	100	500	300	3000
Chromium	16	14	18	19	14	40	12	19	24	12	18	20	100	500	300	3600
Copper	24	24	34	25	23	65	21	34	8	24	28	28	6000	30000	17000	240000
Nickel	12	8	11	12	5	9	8	10	<2	9	10	16	400	1200	1200	6000
Zinc	46	36	71	50	36	60	37	2960	20	48	66	86	7400	60000	30000	400000
Total PAH	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	300	400	300	4000
Carcinogenic PAH	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	3	4	3	40
Benzo(a)pyrene	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	0.7	0.7	0.7	0.7
Benzene	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	65	65	65	95
Toluene	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	105	105	105	135
Ethylbenzene	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	125	125	125	185
Total Xylenes	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	45	45	45	95
C6 – C10 Fraction (sum)	<10	<10	<10	<10	<10	<10	<10	<10	<10	<10	<10	<10	800	800	800	800
C10 - C16 Fraction (sum)	<50	<50	<50	<50	<50	<50	<50	<50	<50	<50	<50	<50	1000	1000	1000	1000
C16 - C34 Fraction (sum)	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	3500	3500	3500	5000
C34 - C40 Fraction (sum)	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	10000	10000	10000	10000

Contaminant of Concern	E13	E14	E15	E16	E17	E18	E19	E20	E21	E22	E23	E24	HIL (A) Threshold	HIL (B) Threshold	HIL (C) Threshold	HIL (D) Threshold
Mercury	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	40	120	80	730
Cadmium	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	20	150	90	900
Lead	39	15	16	17	16	13	15	13	11	17	18	17	300	1200	600	1500
Arsenic	5	6	7	6	<5	<5	7	11	7	19	17	8	100	500	300	3000
Chromium	22	11	10	14	16	13	14	10	12	14	21	18	100	500	300	3600
Copper	31	20	26	21	40	36	14	25	31	37	26	27	6000	30000	17000	240000
Nickel	11	6	16	8	16	25	10	9	11	8	20	13	400	1200	1200	6000
Zinc	55	144	61	45	88	76	35	74	76	59	61	68	7400	60000	30000	400000
Total PAH	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	300	400	300	4000
Carcinogenic PAH	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	3	4	3	40
Benzo(a)pyrene	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	0.7	0.7	0.7	0.7
Benzene	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	<0.2	65	65	65	95
Toluene	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	105	105	105	135
Ethylbenzene	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	125	125	125	185
Total Xylenes	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	45	45	45	95
C6 – C10 Fraction (sum)	<10	<10	<10	<10	<10	<10	<10	<10	<10	<10	<10	<10	800	800	800	800
C10 - C16 Fraction (sum)	<50	<50	<50	<50	<50	<50	<50	<50	<50	<50	<50	<50	1000	1000	1000	1000
C16 - C34 Fraction (sum)	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	3500	3500	3500	5000
C34 - C40 Fraction (sum)	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	<100	10000	10000	10000	10000

10.1 Discussion of Laboratory Test Results


No suspicious odours or obvious signs of contamination were observed within the fill material. Twenty four (24) samples were submitted for chemical testing. The results of the laboratory testing are summarized below;

- The concentrations of all Heavy Metals were well below the exposure threshold values for all four of the Health Investigation Levels (HIL) exposure settings.
- The concentrations of all Polycyclic Aromatic Hydrocarbons (PAHs) were well below the exposure threshold values for all four of the Health Investigation Levels (HIL) exposure settings.
- The concentrations of all Petroleum Hydrocarbons were well below the exposure threshold values for all four of the Health Investigation Levels (HIL) exposure settings.
- The concentrations of all BTEX were well below the exposure threshold values for all four of the Health Investigation Levels (HIL) exposure settings.

11. SALINITY ASSESSMENT

The Department of Infrastructure and Planning (2002) Salinity Potential in Western Sydney map “Salinity Potential in Western Sydney 2002” indicates that the subject site is situated in a region with a moderate to high risk of saline soils. The moderate classification is attributed to scattered areas of scalding and vegetation indicators in areas where the concentrations have not been mapped. There is the possibility of encountering saline areas which were not identified due to localised factors. Saline soils could occur within areas of lower slopes and drainage systems where water accumulation is high or where movement of water through the soil profile is low.

Figure 6- Location of Site on Salinity Map

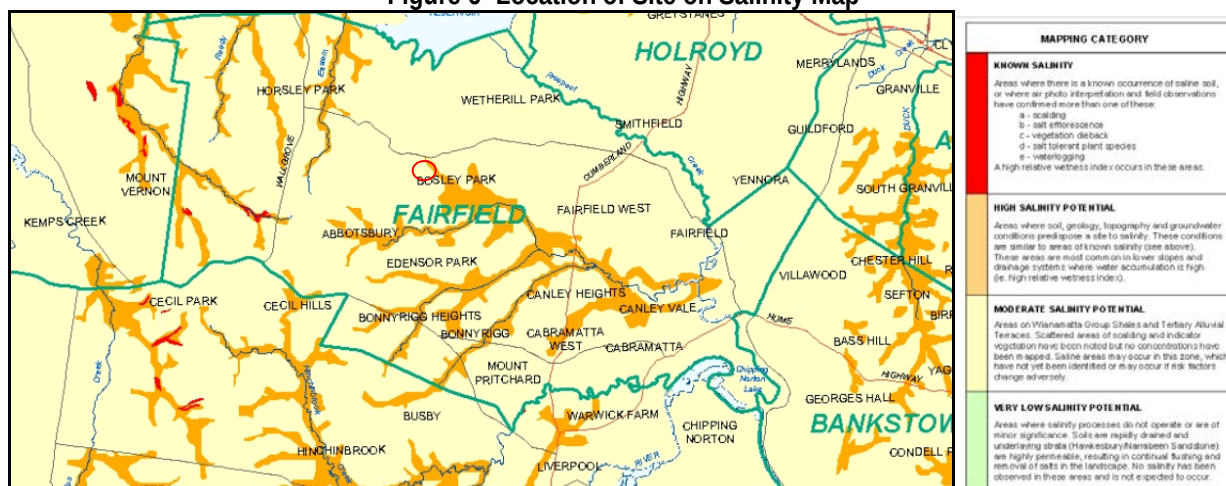

Eight (8) preliminary screening tests were collected as a part of this assessment in order to gain a limited view on the risk of saline soils. This assessment is based on the booklet “Site Investigations for Urban Salinity” published by Department of Land and Water Conservation 2002. Laboratory analysis was completed by Australian Laboratory Services (ALS) Pty Ltd, a NATA accredited laboratory. See appendix D for laboratory test results.

12. LABORATORY TEST RESULTS – SALINITY

Test results obtained from ALS (Certificate Reference number ES1723266) are summarised in Tables 7 & 8.

Table 7 : Analysis of the Soil Samples (Salinity)

Sample	Depth (m)	EC $\mu\text{S/cm}$	Texture Factor	ECe	Salinity Class
S1	0.50	0.104	10	1.04	NS
S2	1.50	0.474	10	4.74	MS
S3	2.50	0.484	10	4.84	MS
S4	0.50	0.502	7	3.51	SS
S5	1.50	0.458	7	3.21	SS
S6	0.50	0.212	10	2.12	SS
S7	1.50	0.256	14	3.58	SS
S8	2.00	0.226	14	3.16	SS
Abbreviations:					
NS	Not Saline				
SS	Slightly Saline				
MS	Moderate Saline				
VS	Very Saline				

Table 8 - Analysis of the Soil Samples (Aggressiveness)

Sample	Depth (m)	pH	Chloride	Sulphate	Resistivity	Aggressivity to Concrete	Aggressivity to Steel
		pH Units	mg/kg	mg/kg	Ohm.cm		
S1	0.50	8.2	40	40	9620	Not Agg	Not Agg
S2	1.50	8.6	230	370	2110	Not Agg	Not Agg
S3	2.50	8.3	730	100	2070	Not Agg	Not Agg
S4	0.50	6.2	540	460	1990	Not Agg	Not Agg
S5	1.50	6.1	550	360	2180	Not Agg	Not Agg
S6	0.50	5.8	170	180	4720	Not Agg	Not Agg
S7	1.50	6.0	220	140	3910	Not Agg	Not Agg
S8	2.00	9.0	70	110	4420	Not Agg	Not Agg
Abbreviations:							
Not Agg	Non-Aggressive						
Mild	Mildly Aggressive						
Mod	Moderately Aggressive						

From the results presented in Table 7, the electrical conductivity results indicate that the soil salinity is predominately non saline to slightly saline, with the exception of two samples which were moderately saline. However, the moderately saline test results were at the lower end of the classification threshold.

Table 8 provides the test results for the aggressiveness of the soil samples. The pH, resistivity, chloride and sulphate concentrations in the soil samples are compared with the Australian Standard 2159:2009 *Piling – Design and Installation*. The laboratory test values of sulphates, chlorides and pH indicate that the soil samples are not aggressive to both steel and concrete.

13. LABORATORY TEST RESULTS – ASBESTOS

Eleven samples of the fill material were recovered and sent for laboratory analysis of asbestos identification, with one sample composited from each borehole location. Test results obtained from ALS (Certificate Reference number ES1723266) are summarised in Table 8.

Table 9- Laboratory Test Results for Asbestos Identification

Sample No.	Borehole	Depth (Composite samples)	Material	Asbestos Identification
AS1	BH1	0.100-2.10m	Fill	NIL
AS2	BH2	0.100-3.50m	Fill	NIL
AS3	BH3	0.100-3.50m	Fill	NIL
AS4	BH4	0.100-3.50m	Fill	NIL
AS5	BH5	0.150-3.50m	Fill	NIL
AS6	BH6	0.025-2.50m	Fill	Yes-(Chrysotile)
AS7	BH7	0.000-3.00m	Fill	NIL
AS8	BH8	0.100-0.800m	Fill	NIL
AS9	BH9	0.150-2.00m	Fill	NIL
AS10	BH10	0.129-1.20m	Fill	NIL
AS11	BH11	0.100-1.40m	Fill	NIL

13.1 Discussion of Laboratory Test Results

Eleven samples of the fill material were recovered and sent for laboratory analyses. The results of the laboratory testing indicate that a small piece of cement sheeting that was recovered from borehole 5 at the time of the site investigation is identified as asbestos chrysotile cement sheeting (approximately 20 x18 x 7mm). However there was no other signs of bonded asbestos or asbestos fibres within any of the other boreholes.

14. LABORATORY QUALITY ASSESSMENT AND QUALITY CONTROL

14.1 Laboratory Accreditation

Australian Laboratory Services (ALS) are accredited by the National Association of Testing Authorities (NATA) for the analyses carried out and are also accredited for compliance with ISO/IEC 17025.

14.2 Laboratory Duplicate Results

The quality control term Laboratory Duplicate refers to a randomly selected intralaboratory split. Laboratory duplicates provide information regarding method precision and sample heterogeneity. Laboratory Duplicates were within the recovery limits, see certificates in Appendix D.

14.3 Laboratory Blanks

The quality control term Method / Laboratory Blank refers to an analyte free matrix to which all reagents are added in the same volumes or proportions as used in standard sample preparation. The purpose of this QC parameter is to monitor potential laboratory contamination. All blanks were reported at Limits of Recovery (LOR), see certificates in Appendix D.

14.4 Laboratory Control Spikes

The quality control term Laboratory Control Spike (LCS) refers to a certified reference material, or a known interference free matrix spiked with target analytes. The purpose of this QC parameter is to monitor method precision and accuracy independent of sample matrix. Laboratory Control Spikes were within the recovery limits, see certificates in Appendix D.

14.5 Laboratory Matrix Spikes

The quality control term Matrix Spike (MS) refers to an intralaboratory split sample spiked with a representative set of target analytes. The purpose of this QC parameter is to monitor potential matrix effects on analyte recoveries. Matrix Spikes were within the recovery limits, see certificates in Appendix D.

15. CONCLUSIONS AND RECOMMENDATIONS

The conclusions of this preliminary contamination report are as follows:

- A review of aerial photography suggests that the neighbouring properties are residential and not considered to have posed a risk for potential contamination to the site.
- A search of the NSW EPA Contaminated Land Management record of notices revealed that there were no notices issued to the subject site. No history of dangerous manufacturing utilizing heavy chemicals or metals was documented.
- Significant filling was observed predominantly at the south-west portion of the site. The source of this fill material is unknown.
- Eleven borehole and sampling locations were requested to be investigated as a part of this investigation in order to determine the quality of the subsurface soil material.
- Twenty four (24) samples were submitted for chemical analysis. The concentrations of all Heavy Metals, PAHs, Petroleum Hydrocarbons and BTEX were well below the Health Investigation Levels (HIL) for all four different exposure settings.
- Eight (8) samples were submitted for salinity analysis. The electrical conductivity results indicate that the soil salinity is predominately non saline to slightly saline, with the exception of two samples which were moderately saline.
- Eight (8) samples were submitted for aggressivity analysis. The laboratory test values of sulphates, chlorides and pH indicate that the soil samples are not aggressive to both steel and concrete.
- One (1) small piece of cement sheeting was recovered from borehole 5 at the time of the site investigation and was identified by laboratory analysis as a piece of asbestos chrysotile cement sheeting (approximately 20 x18 x 7mm). No other signs of bonded asbestos or asbestos fibres were observe during the field investigation. No asbestos was identified by laboratory analysis within the recovered laboratory samples from the remaining boreholes (BH1-4, BH6-11).

The above report is only a primary contamination and salinity investigation (factual investigation) assessment which comprises a brief desktop study and sub-surface investigation of the fill material at eleven boreholes within the site as advised by the client. The initial results indicate that there is a low risk of widespread contamination across the site, as chemical levels in all samples were below the Health Investigation Levels (HIL) for all four different exposure settings. One potenetial asbestos contamination hot spot was observed at the location of borehole BH5. Hence It is recommended that an additional assessment (detailed investigation) be undertaken at the time of proposed development works to further determine the full nature, location and likely distribution of any contamination of the fill material within the subject site.

It is understood that the north-western portion of the site, currently covered by a car park, is to potentially be re-developped for Independent Unit Living. Based upon the results of this preliminary study, the site would be low risk of presenting a contamination risk, especially if the development was to comprise an apartment style development with limited site access to soils (HIL B assessment criteria).

16. LIMITATIONS

It is possible that contaminated soils and differing ground conditions may be present between sampling locations, or in the remainder of the site not intrusively investigated. If the materials or conditions encountered are other than those that have been described, Ground Technologies should be notified immediately as further assessment will be required.

The scope and the period of Ground Technologies services are described in the report and are subject to restrictions and limitations. Ground Technologies did not perform a complete assessment of all possible conditions or circumstances that may exist at the site. If a service is not expressly indicated, do not assume it has been provided. If a matter is not addressed, do not assume that any determination has been made by Ground Technologies in regards to it.

Where data has been supplied by the client or a third party, it is assumed that the information is correct unless otherwise stated. No responsibility is accepted by Ground Technologies for incomplete or inaccurate data supplied by others.

Any drawings or figures presented in this report should be considered only as pictorial evidence of our work. Therefore, unless otherwise stated, any dimensions should not be used for accurate calculations or dimensioning.

This document is COPYRIGHT- all rights reserved. No part of this document may be reproduced or copied in any form or by means without written permission by Ground Technologies Pty Ltd. All other property in this submission shall not pass until all fees for preparation have been settled. This submission is for the use only of the party to whom it is addressed and for no other purpose. No responsibility is accepted to any third party who may use or rely on the whole or any part of the content of this submission. No responsibility will be taken for this report if it is altered in any way, or not reproduced in full. This document remains the property of Ground Technologies Pty Ltd until all fees and monies have been paid in full.

17. REFERENCES:

Geological Series Sheet 9130 (EDITION 1) 1983, Map of the Sydney region, scale 1:100,000

Contaminated Sites – Guidelines for Consultants Reporting on Contaminated Sites. NSW Environment Protection Authority (EPA) 2000.

Managing Land Contamination: Planning Guidelines SEPP55 – Remediation of Land - Department of Urban Affairs and Planning and Environment Protection Authority (DUAP and EPA) 1998.

National Environment Protection (Assessment of Site Contamination) Measure – National Environmental Protection Council 1999.

APPENDIX A

SEARCH RESULTS OF EPA CONTAMINATED LAND REGISTER



[Home](#) [Contaminated land](#) [Record of notices](#)

Search results

Your search for: Suburb: BOSSLEY PARK

did not find any records in our database.

If a site does not appear on the record it may still be affected by contamination. For example:

- Contamination may be present but the site has not been regulated by the EPA under the Contaminated Land Management Act 1997 or the Environmentally Hazardous Chemicals Act 1985.
- The EPA may be regulating contamination at the site through a licence or notice under the Protection of the Environment Operations Act 1997 (POEO Act).
- Contamination at the site may be being managed under the [planning process](#).

[Search Again](#)

[Refine Search](#)

Search TIP

To search for a specific site, search by LGA (local government area) and carefully review all sites listed.

... [more search tips](#)

More information about particular sites may be available from:

- The [POEO public register](#)
- The appropriate planning authority: for example, on a planning certificate issued by the local council under [section 149 of the Environmental Planning and Assessment Act](#).

See [What's in the record and What's not in the record](#).

If you want to know whether a specific site has been the subject of notices issued by the EPA under the CLM Act, we suggest that you search by Local Government Area only and carefully review the sites that are listed.

This public record provides information about sites regulated by the EPA under the Contaminated Land Management Act 1997, including sites currently and previously regulated under the Environmentally Hazardous Chemicals Act 1985. Your inquiry using the above search criteria has not matched any record of current or former regulation. You should consider searching again using different criteria. The fact that a site does not appear on the record does not necessarily mean that it is not affected by contamination. The site may have been notified to the EPA but not yet assessed, or contamination may be present but the site is not yet being regulated by the EPA. Further information about particular sites may be available from the appropriate planning authority, for example, on a planning certificate issued by the local council under section 149 of the Environmental Planning and Assessment Act. In addition the EPA may be regulating contamination at the site through a licence under the Protection of the Environment Operations Act 1997. You may wish to search the POEO public register. [POEO public register](#)

Connect

Feedback

We Put

9 October 2017

APPENDIX B

SEARCH OF POEO REGISTER OF LICENSED AND DELICENSED PREMISES



[Home](#) > [Environment protection licences](#) > [POEO Public Register](#) > [Search for licences, applications and notices](#)

Search results

Your search for: **General Search** with the following criteria
Suburb - BOSSLEY PARK
returned 0 result

Search Again

Connect

Feedback

Web support
Public consultation

Contact

Contact us
Offices
Report pollution

Government

NSW Government
jobs.nsw

About

Accessibility
Disclaimer
Privacy
Copyright

APPENDIX C

BOREHOLE LOGS

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 1

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Silty SAND, brown, dry to slightly moist			TOPSOIL FILL
		Silty CLAY, yellow-brown, grey brown with minor gravel, slightly moist		AS1 0-1.0m & 1.5-1.8m	
	0.5				
	1			E1 1.0m	NATURAL
	1.5			E2 1.50 - 1.80m	
	2	Silty CLAY, red-brown, damp to dry, very stiff			
	2.5	Borehole terminated at 2.5m			
	3				
	3.5				

Method: 4WD Mounted Rig/Solid FlightSpiral Augers

Date of Drilling: 14/09/2017

Logged and Drilled by: JG/SM

SITE LOCATION: Club Marconi, Bossley Park					
Borehole NO. 2					
WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Silty SAND, brown, dry to slightly moist			TOPSOIL
		Silty CLAY, yellow-brown, grey brown with minor gravel, slightly moist			FILL
	0.5				
	1			E3 1.0m	AS2 Composite sample 1.0-3.0m
	1.5				
	2			E4 2.0m	
	2.5				
	3			E5 3.0m	
		Silty CLAY, brown and red brown with minor gravel, damp to slightly moist			Fill
	3.5	Silty CLAY, red brown, damp to dry, very stiff			Natural
		Borehole terminated at 3.5m			
Method: 4WD Mounted Rig/Solid FlightSpiral Augers Date of Drilling: 14/9/2017 Logged and Drilled by: JG/SM					

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 3

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Silty SAND, brown, dry to slightly moist			TOPSOIL
		Silty CLAY, brown and red brown with minor gravel, damp to slightly moist			FILL
	0.5			E7 0.1-1.0m	
	1	Silty CLAY, yellow-brown, grey brown with minor gravel, slightly moist			AS3 Composite sample 0.1-1.0m and 2.0m
	1.5				
	2			E8 2.0m	
	2.5				
	3	Silty CLAY, red-brown, damp to dry, very stiff			Natural
	3.5	Borehole terminated at 3.5m			


Method: 4WD Mounted Rig/Solid FlightSpiral Augers

Date of Drilling: 14/9/2017

Logged and Drilled by: JG/SM

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 4

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Silty SAND, brown, dry to slightly moist			TOPSOIL FILL
		Silty CLAY, yellow brown, grey brown with minor gravel, slightly moist to moist		AS1 0.1- 1.0m, 2.0m, 3.0- 3.5m	
	0.5				
	1				
	1.5	slightly moist to moist			
	2			E11 2.0m	
	2.5				
	3	Silty CLAY, brown to grey brown, yellow brown peaty smell, moist and hydrocarbon smell		E12 3.0m	
				E13 3.0- 3.5m	rotten wood chips
	3.5	Silty CLAY, red-brown, damp to dry, very stiff			Natural
		Borehole terminated at 3.6m			

Method: 4WD Mounted Rig/Solid FlightSpiral Augers

Date of Drilling: 14/9/2017

Logged and Drilled by: JG/SM

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 5

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Silty SAND, brown, dry to slightly moist			TOPSOIL FILL
	0.5	Admixed Silty Sandy CLAY, yellow-brown, grey brown with some small gravels damp to slightly moist		S1 0.5m	
	1			E14 1.0m	AS5 Composite sample 1.5-3.5m
	1.5	slightly moist to moist		S2 1.5m	
	2	Admixed Silty Shaley CLAY, grey brown orange brown, slightly moist		E15 2.0m	
	2.5			S3 2.50 m	
	3	Silty Clay (Alluvial), pale grey, brown, moist to very moist		E16 2.8m	Natural
	3.5	Borehole terminated at 3.5m			

Method: 4WD Mounted Rig/Solid FlightSpiral Augers

Date of Drilling: 14/9/2017

Logged and Drilled by: JG/SM

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 6

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Bitumen sprayed surface			TOPSOIL
		Roadbase, dark grey, brown gravel			FILL
		Silty Clay, orange brown, slightly mottled, pale grey			
	0.5			S4 0.50m	
	1			E17 1.0m	
	1.5	Silty CLAY, orange brown, pale grey, slightly moist		S5 1.50m	
	2			E18 2.00m	
		some gravel encountered			
	2.5	Borehole terminated at 2.5m			
	3				
	3.5				

Method: 4WD Mounted Rig/Solid FlightSpiral Augers

Date of Drilling: 14/9/2017

Logged and Drilled by: JH/SM

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 7

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L	0.5	Admixed silty sandy gravelly CLAY, brown, slightly grey brown, dry to damp			FILL
	1			E19 1.0m	
	1.5				
	2	Silty CLAY, red-brown, damp to dry, very stiff		E20 2.0m	
	2.5	Silty CLAY, pale grey, brown, dark brown, slightly moist very stiff			NATURAL
	3	Borehole terminated at 3.0m			
	3.5				

Method: 4WD Mounted Rig/Solid FlightSpiral Augers

Date of Drilling: 14/09/2017

Logged and Drilled by: JG/SM

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 8

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Clayey Silt, slightly moist, dark brown, black			TOPSOIL
	0.5	Silty CLAY, brown, orange brown, grey brown, yellow brown, slightly moist, with some gravel pieces of bricks		E21& AS8 0.1- 0.8m	FILL
	1	Borehole terminated at 0.8m			
	1.5				
	2				
	2.5				
	3				
	3.5				

Method: Hand Auger

Date of Drilling: 14/09/2017

Logged and Drilled by: JG/SM

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 9

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Concrete core			TOPSOIL
		Silty gravelly CLAY, yellow-brown, orange brown			FILL
	0.5			E22 0.1- 1.0m	S6 0.50m AS9 0.19-1.40m
	1				
	1.5	SHALE, weathered and extremely weathered		S7 1.50m	Natural
	2	Borehole terminated at 2.0m		S8 2.0m	
	2.5				
	3				
	3.5				

Method: 4WD Mounted Rig/Solid FlightSpiral Augers

Date of Drilling: 14/09/2017

Logged and Drilled by: JG/SM

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 10

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Concrete core			TOPSOIL
	0.5	Silty gravelly CLAY, yellow-brown, orange brown with some gravel grey-brown dry to damp		E23 &AS1 0 0.1- 1.2m	FILL AS10 0.19-1.40m
	1				Hit gravel fill
	1.5	Borehole terminated at 1.2m			
	2				
	2.5				
	3				
	3.5				

Method: Hand Auger

Date of Drilling: 14/09/2017

Logged and Drilled by: JG/SM

SITE LOCATION: Club Marconi, Bossley Park

Borehole NO. 11

WATER	DEPTH (m)	SOIL DESCRIPTION (SOIL TYPE, COLOUR, MOISTURE, CONSISTENCY)	GRAPHIC LOG	SAMPLES	REMARKS
N I L		Concrete core			TOPSOIL FILL
	0.5	Silty gravelly CLAY, brown, yellow-brown, orange brown, grey-brown dry to damp		AS11 0.1- 0.8m	
	1	SHALE, completely weathered and extremely weathered, pale grey and grey with slightly mottled brown extremely low strength		E24 1.00m	
	1.5	Borehole terminated at 1.4m			
	2				
	2.5				
	3				
	3.5				

Method: 4WD Mounted Rig/Solid FlightSpiral Augers

Date of Drilling: 14/09/2017

Logged and Drilled by: JG/SM

APPENDIX D

LABORATORY RESULTS

CHAIN OF CUSTODY
ALC Laboratory
Please tick ->

CLIMATEC 21 Burrum Road, Presstons
Ph: 08 8359 0200 E: info@climatec.com.au
JERRIBERRIE 20 Sharn Road, Sharn Road QLD 4503
Ph: 07 3241 7222 E: samples@climatec.com.au
JERRIBERRIE 20 Sharn Road, Sharn Road QLD 4503
Ph: 07 3241 7222 E: samples@climatec.com.au

CLIMATEC 21 Burrum Road, Presstons
Ph: 08 8359 0200 E: info@climatec.com.au
JERRIBERRIE 20 Sharn Road, Sharn Road QLD 4503
Ph: 07 3241 7222 E: samples@climatec.com.au

CLIMATEC 21 Burrum Road, Presstons
Ph: 08 8359 0200 E: info@climatec.com.au
JERRIBERRIE 20 Sharn Road, Sharn Road QLD 4503
Ph: 07 3241 7222 E: samples@climatec.com.au

CLIENT: Ground Technologies
OFFICE: 19 Bernera Road, Presstons
PROJECT: GTE1366 (Bosley Park)
ORDER NUMBER:
PROJECT MANAGER: Anthony Bennett
SAMPLER: Jasmine George and Shaezad Malik
COC emailed to ALS? (NO)
Email Reports to: anthony@groundtech.com.au, malik@groundtech.com.au, jasmine@groundtech.com.au
Email Invoice to: (will default to PM if no other addresses are listed): lab@groundtech.com.au

TURNAROUND REQUIREMENTS:
Standard TAT may be longer for some tests e.g. Ultra Trace Organics
Non Standard or urgent TAT (list due date):
SY/55414

RELINQUISHED BY: JG & SM
DATE/TIME: 15-09-17

RECEIVED BY: M. Paul
DATE/TIME: 15-09-17

RELINQUISHED BY: RECEIVED BY:

FOR LABORATORY USE ONLY (circle)
Quantity Seal intact? Yes No
Freeze / frozen for preservation upon receipt? Yes No
Random Sample Temperature on Receipt: 18.4
Other comment:

SAMPLE DETAILS MATRIX: SOLID (S) WATER (W)				CONTAINER INFORMATION				ANALYSIS REQUIRED including SUITES (NB Suite Codes must be listed where Metals are required, specify Total (unfiltered bottle required) or Dissolved (filtered bottle required))			
LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	(refer	TOTAL CONTAINERS	S26	pH&EC	Sulphates & Chloride	Resistivity	Asbestos

1	E1	14/9/17	S			1	X	X			
2	E2	14/9/17	S			1	X	X			
3	E3	14/9/17	S			1	X	X			
4	E4	14/9/17	S			1	X	X			
5	E5	14/9/17	S			1	X	X			
6	E6	14/9/17	S			1	X	X			
7	E7	14/9/17	S			1	X	X			
8	E8	14/9/17	S			1	X	X			
9	E9	14/9/17	S			1	X	X			
10	E10	14/9/17	S			1	X	X			
11	E11	14/9/17	S			1	X	X			
12	E12	14/9/17	S			1	X	X			
13	E13	14/9/17	S			1	X	X			
14	E14	14/9/17	S			1	X	X			
15	E15	14/9/17	S			1	X	X			
16	E16	14/9/17	S			1	X	X			
17	E17	14/9/17	S			1	X	X			
18	E18	14/9/17	S			1	X	X			
19	E19	14/9/17	S			1	X	X			
20	E20	14/9/17	S			1	X	X			
21	E21	14/9/17	S			1	X	X			
22	E22	14/9/17	S			1	X	X			
23	E23	14/9/17	S			1	X	X			
TOTAL							1	X	X		

Water Container Codes: P = Unpreserved Plastic, N = Nitric Preserved Plastic, ORC = Nitric Preserved ORC, SH = Sodium Hydroxide Preserved, S = Sodium Hydroxide Preserved Plastic, AG = Amber Glass Unpreserved, AP = Airfreight Unpreserved Plastic
V = VOA Vial HCl Preserved, VB = VOA Vial Sodium Bisulphate Preserved, VS = VOA Vial Sulfuric Preserved, AV = Airfreight Unpreserved Vial SG = Sulfuric Preserved Amber Glass, H = HCl Preserved Plastic, HS = HCl Preserved Specimen bottle, SP = Sulfuric Preserved Plastic, F = Formaldehyde Preserved Glass,
Z = Zinc Acetate Preserved Bottle, E = EDTA Preserved Bottle, ST = Sterile Bottle, ASS = Plastic Bag for Acid Supplie Soils, B = Unpreserved Bag.



CHAIN OF CUSTODY

ALS Laboratory
please tick →

LABORATORY: 21 Barbra Road, Preston
Ph: 08 8758 0920 E: alslab@alslab.com
LABORATORY: 32 Sharn Street, Stirling QLD 4213
Ph: 07 3249 7222 E: samples@alslab.com
LABORATORY: 400 Caldermead Drive, Chirnoull NSW 2570
Ph: 02 6372 6775 E: als@alslab.com

LABORATORY: 70 Harbour Road, Mackay QLD 4740
Ph: 07 4844 0171 E: als@alslab.com
LABORATORY: 24 Vennal Road, Scone NSW 3171
Ph: 03 5549 9000 E: samples@alslab.com
LABORATORY: 27 Smeaton Road, Murrumbidgee NSW 2570
Ph: 02 6372 6775 E: als@alslab.com

LABORATORY: 51 Ross Street, Randwick NSW 2204
Ph: 02 4396 0433 E: samples@alslab.com
LABORATORY: 413 Gentry Street, North Sydney NSW 2060
Ph: 02 4423 4231 E: als@alslab.com
LABORATORY: 10 Main Street, Warragul VIC 3920
Ph: 03 9246 7855 E: samples@alslab.com

LABORATORY: 277 289 Woodpark Road, Smithton TAS 7164
Ph: 02 5784 8505 E: samples@alslab.com
LABORATORY: 14 15 Deane Court, Boro QLD 4213
Ph: 07 4795 0800 E: samples@alslab.com
LABORATORY: 29 Kerry Street, Wollongong NSW 2502
Ph: 02 4225 3123 E: samples@alslab.com

CLIENT: Ground Technologies

OFFICE: 19 Barbra Road, Prestons

PROJECT: GTE1355 (Bosley Park)

ORDER NUMBER:

PROJECT MANAGER: Anthony Bennett

SAMPLER: Jasmine George and Shahzad Malik

COC emailed to ALS7 (NO)

Email Reports to: anthony@groundtech.com.au malik@groundtech.com.au jasmine@groundtech.com.au

Email Invoice to (will default to PM if no other addresses are listed): lab@groundtech.com.au

COMMENTS/SPECIAL HANDLING/STORAGE OR DISPOSAL:

TURNAROUND REQUIREMENTS:

Standard TAT (List due date):

Standard TAT may be longer for some tests e.g. Ultra Trace Organics

ALS QUOTE NO.:

CONTACT PH: 0414 806 603

SAMPLER MOBILE: 0430462394

EDD FORMAT (or default):

RELINQUISHED BY:

DATE/TIME:

Standard TAT (List due date):

Standard TAT may be longer for some tests e.g. Ultra Trace Organics

ALS QUOTE NO.:

CONTACT PH: 0414 806 603

SAMPLER MOBILE: 0430462394

EDD FORMAT (or default):

RELINQUISHED BY:

DATE/TIME:

FOR LABORATORY USE ONLY (Circled)

Quality Seal intact?

Freeze / frozen ice blocks present upon receipt?

Random Sample Temperature of Receipt

Other comment:

RECEIVED BY:

DATE/TIME:

DATE/TIME:

DATE/TIME:

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

LAB ID	SAMPLE ID	DATE / TIME	MATRIX	TYPE & PRESERVATIVE (to codes below)	REFER	TOTAL CONTAINERS	ANALYSIS REQUIRED INCLUDING SUITES AND Suite Codes must be listed to attract suite price) Where Metals are required, specify Total (unfilled bottles required) or Discolored (field filtered bottle required).	Additional Information
--------	-----------	-------------	--------	---	-------	---------------------	---	------------------------

CERTIFICATE OF ANALYSIS

Work Order : **ES1723266**
Client : **GROUND TECHNOLOGIES**
Contact : **MR ANTHONY BENNETT**
Address : **16 Weld Street**
PRESTONS NSW, AUSTRALIA 2170
Telephone : **+61 02 8783 8200**
Project : **GTE1355 (BOSLEY PARK)**
Order number : **----**
C-O-C number : **----**
Sampler : **JASMINE GEORGE AND SHAHEZAD MALIK**
Site : **----**
Quote number : **SYBQ/270/16**
No. of samples received : **43**
No. of samples analysed : **43**

Page : 1 of 22
Laboratory : Environmental Division Sydney
Contact : Customer Services ES
Address : 277-289 Woodpark Road Smithfield NSW Australia 2164
Telephone : +61-2-8784 8555
Date Samples Received : 15-Sep-2017 15:15
Date Analysis Commenced : 18-Sep-2017
Issue Date : 25-Sep-2017 15:28



Accreditation No. 825
 Accredited for compliance with
 ISO/IEC 17025 - Testing

This report supersedes any previous report(s) with this reference. Results apply to the sample(s) as submitted. This document shall not be reproduced, except in full.

This Certificate of Analysis contains the following information:

- General Comments
- Analytical Results
- Descriptive Results
- Surrogate Control Limits

Additional information pertinent to this report will be found in the following separate attachments: Quality Control Report, QA/QC Compliance Assessment to assist with Quality Review and Sample Receipt Notification.

Signatories

This document has been electronically signed by the authorized signatories below. Electronic signing is carried out in compliance with procedures specified in 21 CFR Part 11.

<i>Signatories</i>	<i>Position</i>	<i>Accreditation Category</i>
Alex Rossi	Organic Chemist	Sydney Organics, Smithfield, NSW
Ankit Joshi	Inorganic Chemist	Sydney Inorganics, Smithfield, NSW
Christopher Owler	Team Leader - Asbestos	Newcastle - Asbestos, Mayfield West, NSW
Edwandy Fadjjar	Organic Coordinator	Sydney Inorganics, Smithfield, NSW
Rassem Ayoubi	Senior Organic Chemist	Sydney Organics, Smithfield, NSW
Raymond Commodore	Instrument Chemist	Sydney Inorganics, Smithfield, NSW



General Comments

The analytical procedures used by the Environmental Division have been developed from established internationally recognized procedures such as those published by the USEPA, APHA, AS and NEPM. In house developed procedures are employed in the absence of documented standards or by client request.

Where moisture determination has been performed, results are reported on a dry weight basis.

Where a reported less than (<) result is higher than the LOR, this may be due to primary sample extract/digestate dilution and/or insufficient sample for analysis.

Where the LOR of a reported result differs from standard LOR, this may be due to high moisture content, insufficient sample (reduced weight employed) or matrix interference.

When no sampling time is provided, the sampling time will default 00:00 on the date of sampling. If no sampling date is provided, the sampling date will be assumed by the laboratory and displayed in brackets without a time component.

Where a result is required to meet compliance limits the associated uncertainty must be considered. Refer to the ALS Contact for details.

Key : CAS Number = CAS registry number from database maintained by Chemical Abstracts Services. The Chemical Abstracts Service is a division of the American Chemical Society.

LOR = Limit of reporting

^ = This result is computed from individual analyte detections at or above the level of reporting

Ø = ALS is not NATA accredited for these tests.

~ = Indicates an estimated value.

- EA200 'Am' Amosite (brown asbestos)
- EA200 'Cr' Crocidolite (blue asbestos)
- EA200 'Trace' - Asbestos fibres ("Free Fibres") detected by trace analysis per AS4964. The result can be interpreted that the sample contains detectable 'respirable' asbestos fibres
- EA200: Asbestos Identification Samples were analysed by Polarised Light Microscopy including dispersion staining.
- EA200 Legend
- EA200 'Ch' Chrysotile (white asbestos)
- EA200: 'UMF' Unknown Mineral Fibres. "-" indicates fibres detected may or may not be asbestos fibres. Confirmation by alternative techniques is recommended.
- EA200: Negative results for vinyl tiles should be confirmed by an independent analytical technique.
- Benzo(a)pyrene Toxicity Equivalent Quotient (TEQ) is the sum total of the concentration of the eight carcinogenic PAHs multiplied by their Toxicity Equivalence Factor (TEF) relative to Benzo(a)pyrene. TEF values are provided in brackets as follows: Benz(a)anthracene (0.1), Chrysene (0.01), Benzo(b+j) & Benzo(k)fluoranthene (0.1), Benzo(a)pyrene (1.0), Indeno(1.2.3.cd)pyrene (0.1), Dibenzo(a,h)anthracene (1.0), Benzo(g,h,i)perylene (0.01). Less than LOR results for 'TEQ Zero' are treated as zero, for 'TEQ 1/2LOR' are treated as half the reported LOR, and for 'TEQ LOR' are treated as being equal to the reported LOR.
Note: TEQ 1/2LOR and TEQ LOR will calculate as 0.6mg/Kg and 1.2mg/Kg respectively for samples with non-detects for all of the eight TEQ PAHs.
- EA200: For samples larger than 30g, the <2mm fraction may be sub-sampled prior to trace analysis as outlined in ISO23909:2008(E) Sect 6.3.2-2
- EA200: 'Yes' - Asbestos detected by polarised light microscopy including dispersion staining.
- EA200: 'No*' - No asbestos found, at the reporting limit of 0.1g/kg, by polarised light microscopy including dispersion staining. Asbestos material was detected and positively identified at concentrations estimated to be below 0.1g/kg.
- EA200: 'No' - No asbestos found at the reporting limit 0.1g/kg, by polarised light microscopy including dispersion staining.



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E1	E2	E3	E4	E5
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-001	ES1723266-002	ES1723266-003	ES1723266-004	ES1723266-005
					Result	Result	Result	Result	Result
EA002 : pH (Soils)									
pH Value	----	0.1	pH Unit		8.1	7.7	7.5	8.3	7.6
EA010: Conductivity									
Electrical Conductivity @ 25°C	----	1	µS/cm		119	246	78	391	359
EA055: Moisture Content (Dried @ 105-110°C)									
Moisture Content	----	1.0	%		12.9	13.1	12.3	15.6	18.3
EG005T: Total Metals by ICP-AES									
Arsenic	7440-38-2	5	mg/kg		6	7	<5	9	9
Cadmium	7440-43-9	1	mg/kg		<1	<1	<1	<1	<1
Chromium	7440-47-3	2	mg/kg		16	14	18	19	14
Copper	7440-50-8	5	mg/kg		24	24	34	25	23
Lead	7439-92-1	5	mg/kg		16	13	18	18	19
Nickel	7440-02-0	2	mg/kg		12	8	11	12	5
Zinc	7440-66-6	5	mg/kg		46	36	71	50	36
EG035T: Total Recoverable Mercury by FIMS									
Mercury	7439-97-6	0.1	mg/kg		<0.1	<0.1	<0.1	<0.1	<0.1
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons									
Naphthalene	91-20-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Acenaphthylene	208-96-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Acenaphthene	83-32-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Fluorene	86-73-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Phenanthrene	85-01-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Anthracene	120-12-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Fluoranthene	206-44-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Pyrene	129-00-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benz(a)anthracene	56-55-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Chrysene	218-01-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(b+j)fluoranthene	205-99-2 205-82-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(k)fluoranthene	207-08-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(a)pyrene	50-32-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Indeno(1.2.3.cd)pyrene	193-39-5	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Dibenz(a.h)anthracene	53-70-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(g.h.i)perylene	191-24-2	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Sum of polycyclic aromatic hydrocarbons	----	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Benzo(a)pyrene TEQ (zero)	----	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E1	E2	E3	E4	E5
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-001	ES1723266-002	ES1723266-003	ES1723266-004	ES1723266-005
					Result	Result	Result	Result	Result
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons - Continued									
^ Benzo(a)pyrene TEQ (half LOR)	----	0.5	mg/kg		0.6	0.6	0.6	0.6	0.6
^ Benzo(a)pyrene TEQ (LOR)	----	0.5	mg/kg		1.2	1.2	1.2	1.2	1.2
EP080/071: Total Petroleum Hydrocarbons									
C6 - C9 Fraction	----	10	mg/kg		<10	<10	<10	<10	<10
C10 - C14 Fraction	----	50	mg/kg		<50	<50	<50	<50	<50
C15 - C28 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
C29 - C36 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
^ C10 - C36 Fraction (sum)	----	50	mg/kg		<50	<50	<50	<50	<50
EP080/071: Total Recoverable Hydrocarbons - NEPM 2013 Fractions									
C6 - C10 Fraction	C6_C10	10	mg/kg		<10	<10	<10	<10	<10
^ C6 - C10 Fraction minus BTEX (F1)	C6_C10-BTEX	10	mg/kg		<10	<10	<10	<10	<10
>C10 - C16 Fraction	----	50	mg/kg		<50	<50	<50	<50	<50
>C16 - C34 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
>C34 - C40 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
^ >C10 - C40 Fraction (sum)	----	50	mg/kg		<50	<50	<50	<50	<50
^ >C10 - C16 Fraction minus Naphthalene (F2)	----	50	mg/kg		<50	<50	<50	<50	<50
EP080: BTEXN									
Benzene	71-43-2	0.2	mg/kg		<0.2	<0.2	<0.2	<0.2	<0.2
Toluene	108-88-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Ethylbenzene	100-41-4	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
meta- & para-Xylene	108-38-3 106-42-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
ortho-Xylene	95-47-6	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Sum of BTEX	----	0.2	mg/kg		<0.2	<0.2	<0.2	<0.2	<0.2
^ Total Xylenes	1330-20-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Naphthalene	91-20-3	1	mg/kg		<1	<1	<1	<1	<1
EP075(SIM)S: Phenolic Compound Surrogates									
Phenol-d6	13127-88-3	0.5	%		91.6	89.3	90.5	95.7	89.3
2-Chlorophenol-D4	93951-73-6	0.5	%		97.8	94.9	96.2	102	94.9
2,4,6-Tribromophenol	118-79-6	0.5	%		90.3	84.0	91.8	89.6	89.6
EP075(SIM)T: PAH Surrogates									
2-Fluorobiphenyl	321-60-8	0.5	%		95.2	92.2	93.7	98.1	91.4
Anthracene-d10	1719-06-8	0.5	%		109	107	108	103	104



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E1	E2	E3	E4	E5
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-001	ES1723266-002	ES1723266-003	ES1723266-004	ES1723266-005
					Result	Result	Result	Result	Result
EP075(SIM)T: PAH Surrogates - Continued									
4-Terphenyl-d14	1718-51-0	0.5	%		85.4	84.4	85.9	90.8	82.9
EP080S: TPH(V)/BTEX Surrogates									
1,2-Dichloroethane-D4	17060-07-0	0.2	%		92.7	96.4	98.3	99.2	89.8
Toluene-D8	2037-26-5	0.2	%		82.3	87.3	91.8	106	85.3
4-Bromofluorobenzene	460-00-4	0.2	%		91.2	93.9	97.1	97.2	92.9



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E6	E7	E8	E9	E10
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-006	ES1723266-007	ES1723266-008	ES1723266-009	ES1723266-010
					Result	Result	Result	Result	Result
EA002 : pH (Soils)									
pH Value	----	0.1	pH Unit		7.6	7.3	7.6	7.0	8.0
EA010: Conductivity									
Electrical Conductivity @ 25°C	----	1	µS/cm		365	96	524	588	105
EA055: Moisture Content (Dried @ 105-110°C)									
Moisture Content	----	1.0	%		16.4	8.8	15.5	15.3	14.4
EG005T: Total Metals by ICP-AES									
Arsenic	7440-38-2	5	mg/kg		15	6	9	11	<5
Cadmium	7440-43-9	1	mg/kg		<1	<1	4	<1	<1
Chromium	7440-47-3	2	mg/kg		40	12	19	24	12
Copper	7440-50-8	5	mg/kg		65	21	34	8	24
Lead	7439-92-1	5	mg/kg		16	15	54	14	13
Nickel	7440-02-0	2	mg/kg		9	8	10	<2	9
Zinc	7440-66-6	5	mg/kg		60	37	2960	20	48
EG035T: Total Recoverable Mercury by FIMS									
Mercury	7439-97-6	0.1	mg/kg		<0.1	<0.1	<0.1	<0.1	<0.1
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons									
Naphthalene	91-20-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Acenaphthylene	208-96-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Acenaphthene	83-32-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Fluorene	86-73-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Phenanthrene	85-01-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Anthracene	120-12-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Fluoranthene	206-44-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Pyrene	129-00-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benz(a)anthracene	56-55-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Chrysene	218-01-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(b+j)fluoranthene	205-99-2 205-82-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(k)fluoranthene	207-08-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(a)pyrene	50-32-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Indeno(1.2.3.cd)pyrene	193-39-5	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Dibenz(a.h)anthracene	53-70-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(g.h.i)perylene	191-24-2	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Sum of polycyclic aromatic hydrocarbons	----	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Benzo(a)pyrene TEQ (zero)	----	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E6	E7	E8	E9	E10
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-006	ES1723266-007	ES1723266-008	ES1723266-009	ES1723266-010
					Result	Result	Result	Result	Result
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons - Continued									
^ Benzo(a)pyrene TEQ (half LOR)	-----	0.5	mg/kg		0.6	0.6	0.6	0.6	0.6
^ Benzo(a)pyrene TEQ (LOR)	-----	0.5	mg/kg		1.2	1.2	1.2	1.2	1.2
EP080/071: Total Petroleum Hydrocarbons									
C6 - C9 Fraction	-----	10	mg/kg		<10	<10	<10	<10	<10
C10 - C14 Fraction	-----	50	mg/kg		<50	<50	<50	<50	<50
C15 - C28 Fraction	-----	100	mg/kg		<100	<100	<100	<100	<100
C29 - C36 Fraction	-----	100	mg/kg		<100	<100	<100	<100	<100
^ C10 - C36 Fraction (sum)	-----	50	mg/kg		<50	<50	<50	<50	<50
EP080/071: Total Recoverable Hydrocarbons - NEPM 2013 Fractions									
C6 - C10 Fraction	C6_C10	10	mg/kg		<10	<10	<10	<10	<10
^ C6 - C10 Fraction minus BTEX (F1)	C6_C10-BTEX	10	mg/kg		<10	<10	<10	<10	<10
>C10 - C16 Fraction	-----	50	mg/kg		<50	<50	<50	<50	<50
>C16 - C34 Fraction	-----	100	mg/kg		<100	<100	<100	<100	<100
>C34 - C40 Fraction	-----	100	mg/kg		<100	<100	<100	<100	<100
^ >C10 - C40 Fraction (sum)	-----	50	mg/kg		<50	<50	<50	<50	<50
^ >C10 - C16 Fraction minus Naphthalene (F2)	-----	50	mg/kg		<50	<50	<50	<50	<50
EP080: BTEXN									
Benzene	71-43-2	0.2	mg/kg		<0.2	<0.2	<0.2	<0.2	<0.2
Toluene	108-88-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Ethylbenzene	100-41-4	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
meta- & para-Xylene	108-38-3 106-42-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
ortho-Xylene	95-47-6	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Sum of BTEX	-----	0.2	mg/kg		<0.2	<0.2	<0.2	<0.2	<0.2
^ Total Xylenes	1330-20-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Naphthalene	91-20-3	1	mg/kg		<1	<1	<1	<1	<1
EP075(SIM)S: Phenolic Compound Surrogates									
Phenol-d6	13127-88-3	0.5	%		89.9	86.3	92.0	89.2	86.9
2-Chlorophenol-D4	93951-73-6	0.5	%		95.3	90.7	97.0	94.0	91.3
2,4,6-Tribromophenol	118-79-6	0.5	%		101	85.9	93.3	86.4	85.7
EP075(SIM)T: PAH Surrogates									
2-Fluorobiphenyl	321-60-8	0.5	%		91.7	88.5	93.9	91.1	89.2
Anthracene-d10	1719-06-8	0.5	%		106	102	107	103	103



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E6	E7	E8	E9	E10
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-006	ES1723266-007	ES1723266-008	ES1723266-009	ES1723266-010
					Result	Result	Result	Result	Result
EP075(SIM)T: PAH Surrogates - Continued									
4-Terphenyl-d14	1718-51-0	0.5	%		84.5	81.3	86.0	83.9	82.1
EP080S: TPH(V)/BTEX Surrogates									
1,2-Dichloroethane-D4	17060-07-0	0.2	%		96.8	83.6	94.4	89.4	103
Toluene-D8	2037-26-5	0.2	%		99.8	96.7	87.0	83.6	78.0
4-Bromofluorobenzene	460-00-4	0.2	%		93.4	73.4	83.3	85.1	85.9



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E11	E12	E13	E14	E15
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-011	ES1723266-012	ES1723266-013	ES1723266-014	ES1723266-015
					Result	Result	Result	Result	Result
EA002 : pH (Soils)									
pH Value	----	0.1	pH Unit		8.6	8.5	7.4	6.4	8.9
EA010: Conductivity									
Electrical Conductivity @ 25°C	----	1	µS/cm		641	507	428	812	437
EA055: Moisture Content (Dried @ 105-110°C)									
Moisture Content	----	1.0	%		14.4	12.8	19.6	14.1	12.3
EG005T: Total Metals by ICP-AES									
Arsenic	7440-38-2	5	mg/kg		8	9	5	6	7
Cadmium	7440-43-9	1	mg/kg		<1	<1	<1	<1	<1
Chromium	7440-47-3	2	mg/kg		18	20	22	11	10
Copper	7440-50-8	5	mg/kg		28	28	31	20	26
Lead	7439-92-1	5	mg/kg		38	30	39	15	16
Nickel	7440-02-0	2	mg/kg		10	16	11	6	16
Zinc	7440-66-6	5	mg/kg		66	86	55	144	61
EG035T: Total Recoverable Mercury by FIMS									
Mercury	7439-97-6	0.1	mg/kg		<0.1	<0.1	<0.1	<0.1	<0.1
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons									
Naphthalene	91-20-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Acenaphthylene	208-96-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Acenaphthene	83-32-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Fluorene	86-73-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Phenanthrene	85-01-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Anthracene	120-12-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Fluoranthene	206-44-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Pyrene	129-00-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benz(a)anthracene	56-55-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Chrysene	218-01-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(b+j)fluoranthene	205-99-2 205-82-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(k)fluoranthene	207-08-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(a)pyrene	50-32-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Indeno(1.2.3.cd)pyrene	193-39-5	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Dibenz(a.h)anthracene	53-70-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(g.h.i)perylene	191-24-2	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Sum of polycyclic aromatic hydrocarbons	----	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Benzo(a)pyrene TEQ (zero)	----	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E11	E12	E13	E14	E15
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-011	ES1723266-012	ES1723266-013	ES1723266-014	ES1723266-015
					Result	Result	Result	Result	Result
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons - Continued									
^ Benzo(a)pyrene TEQ (half LOR)	----	0.5	mg/kg		0.6	0.6	0.6	0.6	0.6
^ Benzo(a)pyrene TEQ (LOR)	----	0.5	mg/kg		1.2	1.2	1.2	1.2	1.2
EP080/071: Total Petroleum Hydrocarbons									
C6 - C9 Fraction	----	10	mg/kg		<10	<10	<10	<10	<10
C10 - C14 Fraction	----	50	mg/kg		<50	<50	<50	<50	<50
C15 - C28 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
C29 - C36 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
^ C10 - C36 Fraction (sum)	----	50	mg/kg		<50	<50	<50	<50	<50
EP080/071: Total Recoverable Hydrocarbons - NEPM 2013 Fractions									
C6 - C10 Fraction	C6_C10	10	mg/kg		<10	<10	<10	<10	<10
^ C6 - C10 Fraction minus BTEX (F1)	C6_C10-BTEX	10	mg/kg		<10	<10	<10	<10	<10
>C10 - C16 Fraction	----	50	mg/kg		<50	<50	<50	<50	<50
>C16 - C34 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
>C34 - C40 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
^ >C10 - C40 Fraction (sum)	----	50	mg/kg		<50	<50	<50	<50	<50
^ >C10 - C16 Fraction minus Naphthalene (F2)	----	50	mg/kg		<50	<50	<50	<50	<50
EP080: BTEXN									
Benzene	71-43-2	0.2	mg/kg		<0.2	<0.2	<0.2	<0.2	<0.2
Toluene	108-88-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Ethylbenzene	100-41-4	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
meta- & para-Xylene	108-38-3 106-42-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
ortho-Xylene	95-47-6	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Sum of BTEX	----	0.2	mg/kg		<0.2	<0.2	<0.2	<0.2	<0.2
^ Total Xylenes	1330-20-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Naphthalene	91-20-3	1	mg/kg		<1	<1	<1	<1	<1
EP075(SIM)S: Phenolic Compound Surrogates									
Phenol-d6	13127-88-3	0.5	%		87.7	88.3	87.0	88.9	86.2
2-Chlorophenol-D4	93951-73-6	0.5	%		92.9	93.4	92.0	94.2	91.4
2,4,6-Tribromophenol	118-79-6	0.5	%		94.5	91.3	92.0	87.2	86.8
EP075(SIM)T: PAH Surrogates									
2-Fluorobiphenyl	321-60-8	0.5	%		90.5	91.0	89.4	91.4	89.7
Anthracene-d10	1719-06-8	0.5	%		103	105	103	105	103



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E11	E12	E13	E14	E15
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-011	ES1723266-012	ES1723266-013	ES1723266-014	ES1723266-015
					Result	Result	Result	Result	Result
EP075(SIM)T: PAH Surrogates - Continued									
4-Terphenyl-d14	1718-51-0	0.5	%		83.2	83.6	82.7	84.0	82.7
EP080S: TPH(V)/BTEX Surrogates									
1,2-Dichloroethane-D4	17060-07-0	0.2	%		93.1	86.4	103	93.9	90.9
Toluene-D8	2037-26-5	0.2	%		83.1	79.3	75.6	84.5	83.0
4-Bromofluorobenzene	460-00-4	0.2	%		79.0	83.8	83.8	84.5	77.8



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E16	E17	E18	E19	E20
Client sampling date / time					14-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-016	ES1723266-017	ES1723266-018	ES1723266-019	ES1723266-020
					Result	Result	Result	Result	Result
EA002 : pH (Soils)									
pH Value	----	0.1	pH Unit		8.5	7.3	7.6	6.8	5.4
EA010: Conductivity									
Electrical Conductivity @ 25°C	----	1	µS/cm		258	651	332	377	741
EA055: Moisture Content (Dried @ 105-110°C)									
Moisture Content	----	1.0	%		14.6	15.9	11.0	7.8	10.3
EG005T: Total Metals by ICP-AES									
Arsenic	7440-38-2	5	mg/kg		6	<5	<5	7	11
Cadmium	7440-43-9	1	mg/kg		<1	<1	<1	<1	<1
Chromium	7440-47-3	2	mg/kg		14	16	13	14	10
Copper	7440-50-8	5	mg/kg		21	40	36	14	25
Lead	7439-92-1	5	mg/kg		17	16	13	15	13
Nickel	7440-02-0	2	mg/kg		8	16	25	10	9
Zinc	7440-66-6	5	mg/kg		45	88	76	35	74
EG035T: Total Recoverable Mercury by FIMS									
Mercury	7439-97-6	0.1	mg/kg		<0.1	<0.1	<0.1	<0.1	<0.1
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons									
Naphthalene	91-20-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Acenaphthylene	208-96-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Acenaphthene	83-32-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Fluorene	86-73-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Phenanthrene	85-01-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Anthracene	120-12-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Fluoranthene	206-44-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Pyrene	129-00-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benz(a)anthracene	56-55-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Chrysene	218-01-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(b+j)fluoranthene	205-99-2 205-82-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(k)fluoranthene	207-08-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(a)pyrene	50-32-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Indeno(1.2.3.cd)pyrene	193-39-5	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Dibenz(a.h)anthracene	53-70-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(g.h.i)perylene	191-24-2	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Sum of polycyclic aromatic hydrocarbons	----	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Benzo(a)pyrene TEQ (zero)	----	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E16	E17	E18	E19	E20
Client sampling date / time					14-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-016	ES1723266-017	ES1723266-018	ES1723266-019	ES1723266-020
					Result	Result	Result	Result	Result
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons - Continued									
^ Benzo(a)pyrene TEQ (half LOR)	----	0.5	mg/kg		0.6	0.6	0.6	0.6	0.6
^ Benzo(a)pyrene TEQ (LOR)	----	0.5	mg/kg		1.2	1.2	1.2	1.2	1.2
EP080/071: Total Petroleum Hydrocarbons									
C6 - C9 Fraction	----	10	mg/kg		<10	<10	<10	<10	<10
C10 - C14 Fraction	----	50	mg/kg		<50	<50	<50	<50	<50
C15 - C28 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
C29 - C36 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
^ C10 - C36 Fraction (sum)	----	50	mg/kg		<50	<50	<50	<50	<50
EP080/071: Total Recoverable Hydrocarbons - NEPM 2013 Fractions									
C6 - C10 Fraction	C6_C10	10	mg/kg		<10	<10	<10	<10	<10
^ C6 - C10 Fraction minus BTEX (F1)	C6_C10-BTEX	10	mg/kg		<10	<10	<10	<10	<10
>C10 - C16 Fraction	----	50	mg/kg		<50	<50	<50	<50	<50
>C16 - C34 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
>C34 - C40 Fraction	----	100	mg/kg		<100	<100	<100	<100	<100
^ >C10 - C40 Fraction (sum)	----	50	mg/kg		<50	<50	<50	<50	<50
^ >C10 - C16 Fraction minus Naphthalene (F2)	----	50	mg/kg		<50	<50	<50	<50	<50
EP080: BTEXN									
Benzene	71-43-2	0.2	mg/kg		<0.2	<0.2	<0.2	<0.2	<0.2
Toluene	108-88-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Ethylbenzene	100-41-4	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
meta- & para-Xylene	108-38-3 106-42-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
ortho-Xylene	95-47-6	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
^ Sum of BTEX	----	0.2	mg/kg		<0.2	<0.2	<0.2	<0.2	<0.2
^ Total Xylenes	1330-20-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	<0.5
Naphthalene	91-20-3	1	mg/kg		<1	<1	<1	<1	<1
EP075(SIM)S: Phenolic Compound Surrogates									
Phenol-d6	13127-88-3	0.5	%		87.0	86.1	90.6	89.0	88.3
2-Chlorophenol-D4	93951-73-6	0.5	%		92.1	91.3	95.8	93.9	93.7
2,4,6-Tribromophenol	118-79-6	0.5	%		93.3	90.0	93.6	91.0	88.2
EP075(SIM)T: PAH Surrogates									
2-Fluorobiphenyl	321-60-8	0.5	%		90.1	89.2	93.7	92.5	91.4
Anthracene-d10	1719-06-8	0.5	%		103	102	107	105	103



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E16	E17	E18	E19	E20
Client sampling date / time					14-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-016	ES1723266-017	ES1723266-018	ES1723266-019	ES1723266-020
					Result	Result	Result	Result	Result
EP075(SIM)T: PAH Surrogates - Continued									
4-Terphenyl-d14	1718-51-0	0.5	%		82.5	82.2	86.4	84.8	84.0
EP080S: TPH(V)/BTEX Surrogates									
1,2-Dichloroethane-D4	17060-07-0	0.2	%		110	110	97.0	104	102
Toluene-D8	2037-26-5	0.2	%		86.8	92.3	83.5	78.5	81.5
4-Bromofluorobenzene	460-00-4	0.2	%		87.6	88.7	83.9	79.7	88.8



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E21	E22	E23	E24	S1
Client sampling date / time					15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-021	ES1723266-022	ES1723266-023	ES1723266-024	ES1723266-025
					Result	Result	Result	Result	Result
EA002 : pH (Soils)									
pH Value	----	0.1	pH Unit		7.8	6.4	9.0	5.2	8.2
EA010: Conductivity									
Electrical Conductivity @ 25°C	----	1	µS/cm		49	244	215	588	104
EA055: Moisture Content (Dried @ 105-110°C)									
Moisture Content	----	1.0	%		19.0	9.9	19.2	11.3	10.4
EA080: Resistivity									
Resistivity at 25°C	----	1	ohm cm		----	----	----	----	9620
ED040S : Soluble Sulfate by ICPAES									
Sulfate as SO4 2-	14808-79-8	10	mg/kg		----	----	----	----	40
ED045G: Chloride by Discrete Analyser									
Chloride	16887-00-6	10	mg/kg		----	----	----	----	40
EG005T: Total Metals by ICP-AES									
Arsenic	7440-38-2	5	mg/kg		7	19	17	8	----
Cadmium	7440-43-9	1	mg/kg		<1	<1	<1	<1	----
Chromium	7440-47-3	2	mg/kg		12	14	21	18	----
Copper	7440-50-8	5	mg/kg		31	37	26	27	----
Lead	7439-92-1	5	mg/kg		11	17	18	17	----
Nickel	7440-02-0	2	mg/kg		11	8	20	13	----
Zinc	7440-66-6	5	mg/kg		76	59	61	68	----
EG035T: Total Recoverable Mercury by FIMS									
Mercury	7439-97-6	0.1	mg/kg		<0.1	<0.1	<0.1	<0.1	----
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons									
Naphthalene	91-20-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Acenaphthylene	208-96-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Acenaphthene	83-32-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Fluorene	86-73-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Phenanthrene	85-01-8	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Anthracene	120-12-7	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Fluoranthene	206-44-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Pyrene	129-00-0	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Benz(a)anthracene	56-55-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Chrysene	218-01-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Benzo(b+)fluoranthene	205-99-2 205-82-3	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----
Benzo(k)fluoranthene	207-08-9	0.5	mg/kg		<0.5	<0.5	<0.5	<0.5	----

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E21	E22	E23	E24	S1
Client sampling date / time				15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit	ES1723266-021	ES1723266-022	ES1723266-023	ES1723266-024	ES1723266-025	
				Result	Result	Result	Result	Result	
EP075(SIM)B: Polynuclear Aromatic Hydrocarbons - Continued									
Benzo(a)pyrene	50-32-8	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
Indeno(1.2.3.cd)pyrene	193-39-5	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
Dibenz(a.h)anthracene	53-70-3	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
Benzo(g.h.i)perylene	191-24-2	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
^ Sum of polycyclic aromatic hydrocarbons	----	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
^ Benzo(a)pyrene TEQ (zero)	----	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
^ Benzo(a)pyrene TEQ (half LOR)	----	0.5	mg/kg	0.6	0.6	0.6	0.6	----	
^ Benzo(a)pyrene TEQ (LOR)	----	0.5	mg/kg	1.2	1.2	1.2	1.2	----	
EP080/071: Total Petroleum Hydrocarbons									
C6 - C9 Fraction	----	10	mg/kg	<10	<10	<10	<10	----	
C10 - C14 Fraction	----	50	mg/kg	<50	<50	<50	<50	----	
C15 - C28 Fraction	----	100	mg/kg	<100	<100	<100	<100	----	
C29 - C36 Fraction	----	100	mg/kg	<100	<100	<100	<100	----	
^ C10 - C36 Fraction (sum)	----	50	mg/kg	<50	<50	<50	<50	----	
EP080/071: Total Recoverable Hydrocarbons - NEPM 2013 Fractions									
C6 - C10 Fraction	C6_C10	10	mg/kg	<10	<10	<10	<10	----	
^ C6 - C10 Fraction minus BTEX (F1)	C6_C10-BTEX	10	mg/kg	<10	<10	<10	<10	----	
>C10 - C16 Fraction	----	50	mg/kg	<50	<50	<50	<50	----	
>C16 - C34 Fraction	----	100	mg/kg	<100	<100	<100	<100	----	
>C34 - C40 Fraction	----	100	mg/kg	<100	<100	<100	<100	----	
^ >C10 - C40 Fraction (sum)	----	50	mg/kg	<50	<50	<50	<50	----	
^ >C10 - C16 Fraction minus Naphthalene (F2)	----	50	mg/kg	<50	<50	<50	<50	----	
EP080: BTEXN									
Benzene	71-43-2	0.2	mg/kg	<0.2	<0.2	<0.2	<0.2	----	
Toluene	108-88-3	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
Ethylbenzene	100-41-4	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
meta- & para-Xylene	108-38-3 106-42-3	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
ortho-Xylene	95-47-6	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
^ Sum of BTEX	----	0.2	mg/kg	<0.2	<0.2	<0.2	<0.2	----	
^ Total Xylenes	1330-20-7	0.5	mg/kg	<0.5	<0.5	<0.5	<0.5	----	
Naphthalene	91-20-3	1	mg/kg	<1	<1	<1	<1	----	
EP075(SIM)S: Phenolic Compound Surrogates									



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	E21	E22	E23	E24	S1
Client sampling date / time					15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-021	ES1723266-022	ES1723266-023	ES1723266-024	ES1723266-025
					Result	Result	Result	Result	Result
EP075(SIM)S: Phenolic Compound Surrogates - Continued									
Phenol-d6	13127-88-3	0.5	%		80.9	77.2	78.9	76.8	----
2-Chlorophenol-D4	93951-73-6	0.5	%		95.1	92.7	90.5	97.8	----
2,4,6-Tribromophenol	118-79-6	0.5	%		81.1	85.8	76.4	85.3	----
EP075(SIM)T: PAH Surrogates									
2-Fluorobiphenyl	321-60-8	0.5	%		97.7	94.9	102	97.7	----
Anthracene-d10	1719-06-8	0.5	%		106	100	96.8	94.1	----
4-Terphenyl-d14	1718-51-0	0.5	%		108	103	100.0	101	----
EP080S: TPH(V)/BTEX Surrogates									
1,2-Dichloroethane-D4	17060-07-0	0.2	%		90.5	104	92.9	97.0	----
Toluene-D8	2037-26-5	0.2	%		94.6	110	97.3	103	----
4-Bromofluorobenzene	460-00-4	0.2	%		90.8	103	90.4	97.7	----



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	S2	S3	S4	S5	S6
Client sampling date / time					14-Sep-2017 00:00	14-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-026	ES1723266-027	ES1723266-028	ES1723266-029	ES1723266-030
					Result	Result	Result	Result	Result
EA002 : pH (Soils)									
pH Value	----	0.1	pH Unit		8.6	8.3	6.2	6.1	5.8
EA010: Conductivity									
Electrical Conductivity @ 25°C	----	1	µS/cm		474	484	502	458	212
EA055: Moisture Content (Dried @ 105-110°C)									
Moisture Content	----	1.0	%		15.4	14.9	16.2	16.6	8.2
EA080: Resistivity									
Resistivity at 25°C	----	1	ohm cm		2110	2070	1990	2180	4720
ED040S : Soluble Sulfate by ICPAES									
Sulfate as SO4 2-	14808-79-8	10	mg/kg		370	100	460	360	180
ED045G: Chloride by Discrete Analyser									
Chloride	16887-00-6	10	mg/kg		230	730	540	550	170



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	S7	S8	AS1	AS2	AS3
Client sampling date / time					15-Sep-2017 00:00	15-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00	14-Sep-2017 00:00
Compound	CAS Number	LOR	Unit		ES1723266-031	ES1723266-032	ES1723266-033	ES1723266-034	ES1723266-035
					Result	Result	Result	Result	Result
EA002 : pH (Soils)									
pH Value	----	0.1	pH Unit		6.0	9.0	----	----	----
EA010: Conductivity									
Electrical Conductivity @ 25°C	----	1	µS/cm		256	226	----	----	----
EA055: Moisture Content (Dried @ 105-110°C)									
Moisture Content	----	1.0	%		5.8	18.7	----	----	----
EA080: Resistivity									
Resistivity at 25°C	----	1	ohm cm		3910	4420	----	----	----
EA200: AS 4964 - 2004 Identification of Asbestos in Soils									
Asbestos Detected	1332-21-4	0.1	g/kg		----	----	No	No	No
Asbestos Type	1332-21-4	-	--		----	----	-	-	-
Sample weight (dry)	----	0.01	g		----	----	707	772	701
APPROVED IDENTIFIER:	----	-	--		----	----	S.SPOONER	S.SPOONER	S.SPOONER
ED040S : Soluble Sulfate by ICPAES									
Sulfate as SO4 2-	14808-79-8	10	mg/kg		140	110	----	----	----
ED045G: Chloride by Discrete Analyser									
Chloride	16887-00-6	10	mg/kg		220	70	----	----	----



Analytical Results

Sub-Matrix: **SOIL**
 (Matrix: **SOIL**)

Client sample ID

				AS4	AS5	AS6	AS7	AS8
Client sampling date / time				14-Sep-2017 00:00	14-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00
Compound	CAS Number	LOR	Unit	ES1723266-036	ES1723266-037	ES1723266-038	ES1723266-039	ES1723266-040
				Result	Result	Result	Result	Result
EA200: AS 4964 - 2004 Identification of Asbestos in Soils								
Asbestos Detected	1332-21-4	0.1	g/kg	No	Yes	No	No	No
Asbestos Type	1332-21-4	-	--	-	Ch	-	-	-
Sample weight (dry)	----	0.01	g	954	839	404	832	751
APPROVED IDENTIFIER:	----	-	--	S.SPOONER	C.OWLER	S.SPOONER	S.SPOONER	G.MORGAN



Analytical Results

Sub-Matrix: SOIL (Matrix: SOIL)				Client sample ID	AS9	AS10	AS11	----	----
Client sampling date / time					15-Sep-2017 00:00	15-Sep-2017 00:00	15-Sep-2017 00:00	----	----
Compound	CAS Number	LOR	Unit		ES1723266-041	ES1723266-042	ES1723266-043	-----	-----
					Result	Result	Result	----	----
EA200: AS 4964 - 2004 Identification of Asbestos in Soils									
Asbestos Detected	1332-21-4	0.1	g/kg		No	No	No	----	----
Asbestos Type	1332-21-4	-	--		-	-	-	----	----
Sample weight (dry)	----	0.01	g		1040	920	141	----	----
APPROVED IDENTIFIER:	----	-	--		G.MORGAN	S.SPOONER	S.SPOONER	----	----

Analytical Results

Descriptive Results

Sub-Matrix: SOIL	
Method: Compound	Client sample ID - Client sampling date / time
Analytical Results	
EA200: AS 4964 - 2004 Identification of Asbestos in Soils	
EA200: Description	AS1 - 14-Sep-2017 00:00
EA200: Description	AS2 - 14-Sep-2017 00:00
EA200: Description	AS3 - 14-Sep-2017 00:00
EA200: Description	AS4 - 14-Sep-2017 00:00
EA200: Description	AS5 - 14-Sep-2017 00:00
EA200: Description	AS6 - 15-Sep-2017 00:00
EA200: Description	AS7 - 15-Sep-2017 00:00
EA200: Description	AS8 - 15-Sep-2017 00:00
EA200: Description	AS9 - 15-Sep-2017 00:00
EA200: Description	AS10 - 15-Sep-2017 00:00
EA200: Description	AS11 - 15-Sep-2017 00:00

Mid brown clay soil
 Mid brown clay soil
 Mid brown clay soil
 Mid brown clay soil
 Mid brown clay soil plus one piece of asbestos cement sheeting approx 20 x 18 x 7mm
 Mid brown clay soil
 Mid brown clay soil
 Mid brown clay soil
 Mid brown clay soil
 Mid brown clay soil
 Mid brown sandy soil



Surrogate Control Limits

Sub-Matrix: SOIL		Recovery Limits (%)	
Compound	CAS Number	Low	High
EP075(SIM)S: Phenolic Compound Surrogates			
Phenol-d6	13127-88-3	63	123
2-Chlorophenol-D4	93951-73-6	66	122
2,4,6-Tribromophenol	118-79-6	40	138
EP075(SIM)T: PAH Surrogates			
2-Fluorobiphenyl	321-60-8	70	122
Anthracene-d10	1719-06-8	66	128
4-Terphenyl-d14	1718-51-0	65	129
EP080S: TPH(V)/BTEX Surrogates			
1,2-Dichloroethane-D4	17060-07-0	73	133
Toluene-D8	2037-26-5	74	132
4-Bromofluorobenzene	460-00-4	72	130